Form 260-5 NMOCO

WINDER

UNITED STATES

DEPARTMENT OF THE INTERIOR

BUREAU OF LAND MANAGEMENT

SUNDRY MOTOR

MAY	1 6 2013 FORM APPROVED
	OMB No. 1004-0137
Farminato	Expires: July 31, 2010

201000	01 20.10	NMSF
6. If Indian	, Allottee or	Tribe Name

RECEIVED

SUNDRY NOTICES AND REPORTS ON WELLS
Do not use this form for proposals to drill or to re-enter an
abandoned well. Use Form 3160-3 (APD) for such proposals

abanaona	TON OCCION CIOS OF	Tr by for outli propostio.	
SUBMIT IN TRIPLICATE - Other instructions on page 2.		7. If Unit of CA/Agreement, Name and/or No.	
1. Type of Well			7
X Oil Well X	Gas Well Other		8. Well Name and No.
		Bisti Coal 6 2T	
2. Name of Operator		-	9. API Well No.
	DJR Operating, LLC		30-045-32482
3a. Address		3b. Phone No. (include area code)	10. Field and Pool or Exploratory Area
c/o A Plus WS Farmingto	on, NM	505-486-6958	Basin Fruitland Coal
4. Location of Well (Footage, Sec., T.,R.,	M., or Survey Description)	•	11. Country or Parish, State
UL - F	, 1730' FNL & 1810' FWL	, Sec. 6, T25N, R12W	San Juan , New Mexico
12. CHECK T	HE APPROPRIATE BOX(ES) TO INDICATE NATURE OF N	OTICE, REPORT OR OTHER DATA
TYPE OF SUBMISSION	TYPE OF SUBMISSION TYPE OF ACTION		

X Notice of Intent	Acidize	Deepen	Production (Start/Resume)	Water Shut-Off
	Alter Casing	Fracture Treat	Reclamation	Well Integrity
Subsequent Report	Casing Repair	New Construction	Recomplete	Other
<u> </u>	Change Plans	X Plug and Abandon	Temporarily Abandon	
Final Abandonment Notice	Convert to Injection	Plug Back	Water Disposal	
13. Describe Proposed or Completed Operation: Clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof.				

If the proposal is to deepen directionally or recomplete horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports must be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompletion in a new interval, a Form 3160-4 must be filed once Testing has been completed. Final Abandonment Notices must be filed only after all requirements, including reclamation, have been completed and the operator has determined that the site is ready for final inspection.)

DJR Operating, LLC requests permission to plug & abandon the subject well per the attached procedure, current and proposed wellbore diagram.

NMOCD

UN 25 2018

DISTRICT 111

SEE ATTACHED FOR **CONDITIONS OF APPROVAL**

RIADS ADDRESS OF A RECORD OF THIS ACTION 1 1915 NOT RELIEVE THE LESSEE AND OPERATOR FROM OBTAINING ANY OTHER **AUTHORIZATION REQUIRED FOR OPERATIONS** Notify NMOCD 24 hrs

prior to beginning operations

14. I hereby certify that the foregoing is true and correct. Name (Printed/Typed) Nell Lindenmeyer / Agent for DJR	Engineer Tech Title			
Signature Mul Laurley	Date 5/	116/18	3	
THIS SPACE FOR FED	ERAL OR ST	TATE O	FFICE USE	
Approved by Mark Muse		Title	PE	Date 6/21/18
Conditions of approval, if any are attached. Approval of this notice does not warrant or that the applicant holds legal or equitable title to those rights in the subject lease which entitle the applicant to conduct operations thereon.		Office	FFO	

Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

PLUG AND ABANDONMENT PROCEDURE

May 1, 2018

Bisti Coal 6 #2T

Basin Fruitland Coal
1730' FNL and 1810' FWL, Section 6, T25N, R12W
San Juan County, New Mexico / API 30-045-32482
Lat: N _____ / Lat: W ______

Lat: N _____/ Lat: W _____ Note: All cement volumes use 100% excess outside pipe and 50' excess inside. The stabilizing wellbore fluid will be 8.3 ppg, sufficient to balance all exposed formation pressures. All cement will be Class G, mixed at 15.8 ppg with a 1.15 cf/sx yield. 1. Install and test location rig anchors. Comply with all NMOCD, BLM, and Operator safety regulations. MOL and RU daylight pulling unit. Conduct safety meeting for all personnel on location. Record casing, tubing and bradenhead pressures. NU relief line and blow down well. Kill well with water as necessary and at least pump tubing capacity of water down the tubing. ND wellhead and NU BOP. Function test BOP. 2. Rods: Yes_X_, No___, Unknown__ Tubing: Yes X, No, Unknown, Size <u>2-3/8</u>, Length <u>1230</u>. Packer: Yes____, No _X__, Unknown____, Type_____. 3. Plug #1 (PC and Fruitland interval, 1235' - 830') RIH with open-ended tubing. Mix and pump 62 sxs Class G cement, long plug 30% excess, from 1235' to 830' to isolate PC and Fruitland interval. PUH and WOC. TIH and tag cement; top off if necessary. PUH. 4. Plug #2 (Kirtland, Ojo Alamo tops and 7" casing shoe, 207' - 0'): Attempt to pressure test the bradenhead annulus to 300 PSI; note the volume to load. If the BH annulus holds pressure, then establish circulation out casing valve with water. Mix approximately 25 sxs cement and spot a balanced plug from 207' to surface, circulate good cement out casing valve. TOH and LD tubing. Shut well in and WOC. If the BH annulus does not test, then perforate at the appropriate depth and attempt to circulate cement to surface filling the casing and annulus from the squeeze holes to surface. Shut in well and WOC. 5. ND cementing valves and cut off wellhead. Fill annuli with cement as necessary. Install P&A

ND cementing valves and cut off wellhead. Fill annuli with cement as necessary. Install P&A
marker to comply with regulations. Record GPS coordinate for P&A marker on tower report.
Photograph P&A marker in place. RD, MOL and cut off anchors. Restore location per BLM
stipulations

Bisti Coal 6 #2T

Current

Basin Fruitland Coal 1730' FNL & 1810' FWL, Section 6, T25N, R12W

Today's Date: 5/1/18 Spud: 2/04/06 Completed: 4/17/07

Elevation: 6200' GL


12.25" hole

Kirtland @ 157'

Fruitland @ 880'

Pictured Cliffs @ 1185'

7-7/8" hole

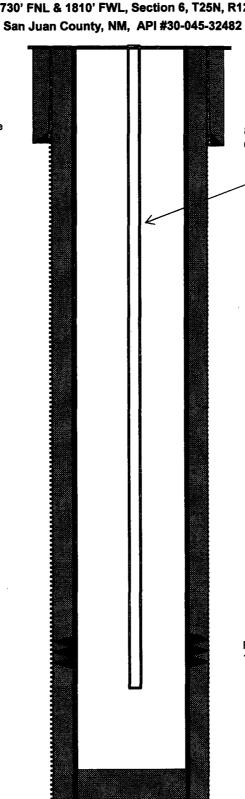

Circulated cement to surface

8.625" 24# Casing set @ 146' Cement with 115 sxs, circulated to surface.

2-3/8" tubing @ 1230' with rods and pump

Fruitland Coal Perforations: 1138' - 1181'

5.5",15.5#, Casing set @ 1332' Cement with 265 sxs, circulated to surface

TD 1350' **PBTD 1291'**

Bisti Coal 6 #2T

Proposed P&A

Basin Fruitland Coal 1730' FNL, 1810' FWL, Section 6, T-25-N, R-12-W

Today's Date: 5/1/18 Spud: 2/04/06 Completed: 4/17/07

Elevation: 6200' GL


12.25" hole

Kirtland @ 157'

Fruitland @ 880'

Pictured Cliffs @ 1185'

7-7/8" hole

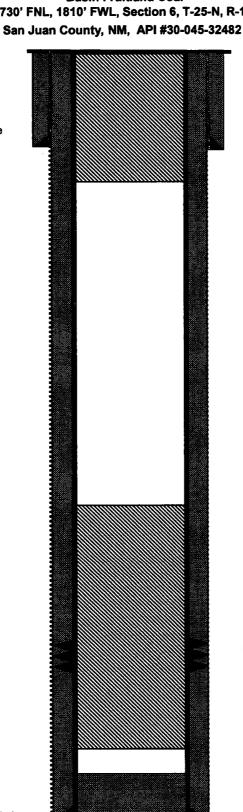

TD 1350' PBTD 1291' Circulated cement to surface

8.625" 24# Casing set @ 146' Cement with 115 sxs, circulated to surface.

> Plug #2: 207' - 0' Class G cement, 25 sxs

Plug #1: 1235' - 830' Class G cement, 62 sxs 30% excess, long plug

Set CR @ 1088'

Fruitland Coal Perforations: 1138' - 1181'

5.5",15.5#, Casing set @ 1332' Cement with 265 sxs, circulated to surface

UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT FARMINGTON DISTRICT OFFICE

6251 COLLEGE BLVD. FARMINGTON, NEW MEXICO 87402

Attachment to notice of Intention to Abandon:

Re: Permanent Abandonment

Well: Bisti Coal 6 #2T

CONDITIONS OF APPROVAL

- 1. Plugging operations authorized are subject to the attached "General Requirements for Permanent Abandonment of Wells on Federal and Indian Lease."
- 2. Farmington Office is to be notified at least 24 hours before the plugging operations commence (505) 564-7750.

You are also required to place cement excesses per 4.2 and 4.4 of the attached General Requirements.

Office Hours: 7:45 a.m. to 4:30 p.m.