, <i>S</i>	X									
¢	Form 3160-5 (June 2015) UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT SUNDRY NOTICES AND REPORTS ON WELLS Do not use this form for proposals to drill or to re-enter an abandoned well. Use form 3160-3 (APD) for such proposals.					FORM APPROVED OMB NO. 1004-0137 Expires: January 31, 2018 5. Lease Serial No. NMSF079043 6. If Indian, Allottee or Tribe Name				
	SUBMIT IN TRIPLICATE - Other instructions on page 2						 If Unit or CA/Agreement, Name and/or No. 892000929C 			
	1. Type of Well ☐ Oil Well ⊠ Gas Well ☐ Other						8. Well Name and No. NEBU 340			
	2. Name of Operator Contact: TOYA COLVIN BP AMERICA PRODUCTION COMPAS Mail: Toya.Colvin@bp.com						9. API Well No. 30-045-33212-00-S1			
	3a. Address 380 AIRPOR DURANGO, 0	3b. Phone No. (include area code) Ph: 281.892.5369			10. Field and Pool or Exploratory Area BASIN DAKOTA					
	4. Location of Well (Footage, Sec., T., R., M., or Survey Description)						11. County or Parish, State			
	Sec 30 T31N R7W SWSE 65FSL 2480FEL						SAN JUAN COUNTY, NM			
	12. CHECK THE APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA									
	TYPE OF SU	TYPE OF SUBMISSION TYPE OF ACTION								
	☑ Notice of Intent □ Subsequent Report		 Acidize Alter Casing Cosing Remain 	 Deepen Hydraulic Fracturing New Construction 		C Reclam	 Production (Start/Resume) Water Shute Reclamation Well Integration 			
	Final Abandonment Notice		Change Plans		g and Abandon g Back	 Recomplete Other Temporarily Abandon Water Disposal 				
dy .	13. Describe Proposed or Completed Operation: Clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recomplete horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports must be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompletion in a new interval, a Form 3160-4 must be filed once testing has been completed. Final Abandonment Notices must be filed only after all requirements, including reclamation, have been completed and the operator has determined that the site is ready for final inspection.									
	BP requests to P&A the subject well. Please see the attached P&A procedure, wellbore diagram, and BLM required reclamation plan documents.									
	In accordance with NMOCD Pit Rule 19.15.17.9 NMAC, BP will use a closed-loop system during operations.									
	Notify NMOCD 2 prior to beginn operations			ning	4 hrs					
	DISTRICT III									
	14. I hereby certify that the foregoing is true and correct. Electronic Submission #423445 verified by the BLM Well Information System For BP AMERICA PRODUCTION COMPANY, sent to the Farmington Committed to AFMSS for processing by JACK SAVAGE on 08/14/2018 (18JWS0179SE)									
	Name (Printed/Typed) TOYA COLVIN					ATORY AN	,			
	Signature	Signature (Electronic Submission)			Date 06/11/2018					
		THIS SPACE FOR FEDERAL OR STATE OFFICE USE								
	Approved By_JACK SAVAGEConditions of approval, if any, are attached. Approval of this notice does not w				TitlePETROLEUM ENGINEER Date 08/14/20			/2018		
		ant holds legal or equ	itable title to those rights in the							
	Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the Units States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.									
	(Instructions on page	²⁾ ** BLM REV	ISED ** BLM REVISEI	D ** BLM R	EVISED ** BLN	I REVISEI	D ** BLM REVISE	D **		

NMOCDry

5

PLUG AND ABANDONMENT PROCEDURE

June 6, 2018

NEBU 340

Basin Dakota

65' FSL and 2480' FEL, Section 30, T31N, R7W San Juan County, New Mexico / API 30-045-33212

- Note: All cement volumes use 100% excess outside pipe and 50' excess inside. The stabilizing wellbore fluid will be 8.3 ppg, sufficient to balance all exposed formation pressures. All cement will be Class G, mixed at 15.8 ppg with a 1.15 cf/sx yield.
 - Install and test location rig anchors. Comply with all NMOCD, BLM, and Operator safety regulations. MOL and RU daylight pulling unit. Conduct safety meeting for all personnel on location. Record casing, tubing and bradenhead pressures. NU relief line and blow down well. Kill well with water as necessary and at least pump tubing capacity of water down the tubing. ND wellhead and NU BOP. Function test BOP.
 - Rods: Yes ____, No __X, Unknown ____. Tubing: Yes _X , No ___, Unknown ____, Size ___2-3/8" , Length __8006' ____

NOTE: BLM requires a CBL log to be run on all wells where the cement did not circulatetosurface or a CBL log was not previously run. This procedure is prepared withtheunderstanding that it may be modified based on the TOC from the CBL

- Plug #1 (Dakota interval and Gallup top, 7885' 7044'): Round trip 4.5" mill to 7885' or deep as possible. RIH and set 4.5" HYDRO-SET CIBP at 7885'. Pressure test tubing to 1000#. Pressure test casing to 800#. *If casing does not test then spot or tag subsequent plugs as appropriate.* Mix 70 sxs Class G cement spot above CIBP to isolate through the Gallup top. PUH.
- Plug #2 (Mancos top, 6075' 5975'): Mix 12 sxs Class G cement inside casing to cover the Mancos top. PUH.
- 5. Plug #3 (Mesaverde and Chacra tops, 5447' 4747'): Mix 59 sxs Class G cement inside casing to cover the Mesaverde and Chacra tops. PUH.
- Plug #4 (7" casing shoe, Pictured Cliffs top, 3765' 3343'): Mix 38 sxs Class G cement inside casing to cover through the PC top. PUH.
- Plug #5 (Fruitland, Kirtland and Ojo Alamo tops, 3013' 2284'): Mix 60 sxs Class G cement inside casing to cover through the OA top. PUH.
- Plug #6 (Nacimiento top, 994' 894'): Mix 12 sxs Class G cement inside casing to cover the Nacimiento top. PUH.

- Plug #7 (9-5/8" casing shoe, and surface, 348' 0'): Perforate 4 squeeze holes at 284'. Establish circulation out annuli with water and circulate the BH annulus clean. RIH with tubing to 348'. Mix approximately 125 sxs cement from 348' to surface; squeeze cement out from 284'. Circulate good cement out annuli. LD tubing. SI well and WOC.
- ND cementing valves and cut off wellhead. Fill annuli with cement as necessary. Install P&A marker to comply with regulations. Record GPS coordinate for P&A marker on tower report. Photograph P&A marker in place. RD, MOL and cut off anchors. Restore location per BLM stipulations

NEBU 340


Proposed P&A Basin Dakota

65' FSL, 2480' FEL, Section 30, T-31-N, R-7-W

. .

Today's Date: 6/6/18

San Juan County, NM, API #30-045-33212

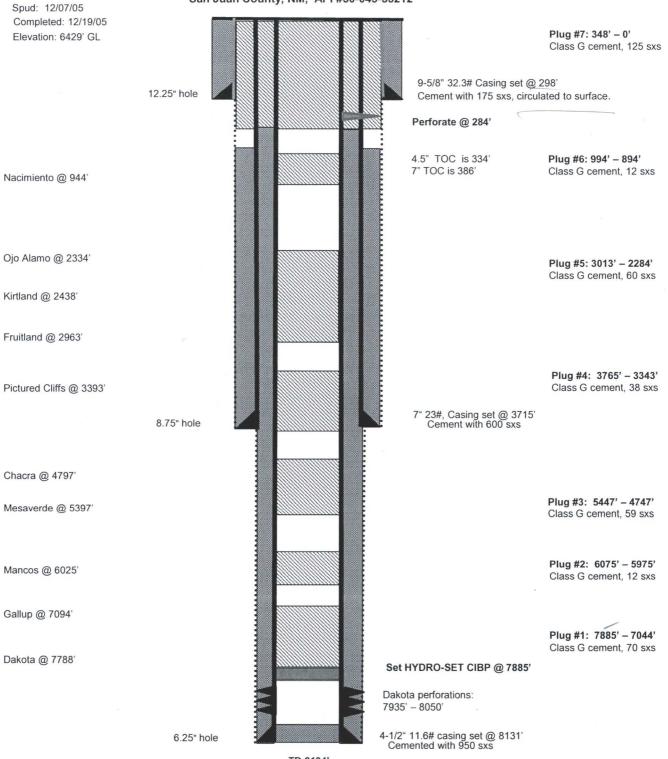

TD 8134' PBTD 7988'

UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT FARMINGTON DISTRICT OFFICE

6251 COLLEGE BLVD. FARMINGTON, NEW MEXICO 87402

Attachment to notice of Intention to Abandon:

• •

Re: Permanent Abandonment Well: NEBU 340

CONDITIONS OF APPROVAL

1. Plugging operations authorized are subject to the attached "General Requirements for Permanent Abandonment of Wells on Federal and Indian Lease."

2. Farmington Office is to be notified at least 24 hours before the plugging operations commence (505) 564-7750.

- 3. The following modifications to your plugging program are to be made:
 - a) Set Plug 1 (7885 6751) ft. to cover the Graneros and Gallup tops. BLM picks top of Graneros at 7714 ft. BLM picks top of Gallup at 6801 ft.
 - b) Set Plug 2 (6186 6086) ft. to cover the Mancos top. BLM picks top of Mancos at 6136 ft.
 - c) Set Plug 3 (4163 4063) ft. to cover the Chacra top. BLM picks top of Chacra at 4113 ft.
 - d) Set Plug 4 (3402 3302) ft. to cover the Pictured Cliffs top. BLM picks top of Pictured Cliffs at 3352 ft.
 - e) Set Plug 5 (2989 2192) ft. to cover the Fruitland and Ojo Alamo tops. BLM picks top of Fruitland at 2939 ft. BLM picks top of Ojo Alamo at 2242 ft.
 - f) Set Plug 6 (755 655) ft. to cover the Nacimiento top. BLM picks top of Nacimiento at 705 ft.

Operator must run a CBL to verify cement top. Submit the electronic copy of the log for verification to the following addresses: jwsavage@blm.gov Brandon.Powell@state.nm.us

You are also required to place cement excesses per 4.2 and 4.4 of the attached General Requirements.

Office Hours: 7:45 a.m. to 4:30 p.m.