

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUBMIT IN TRIPPLICATE*
(Other instructions on reverse side)

Form approved.
Budget Bureau No. 42-R1421.

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>		5. LEASE DESIGNATION AND SERIAL NO. Mims No. 1 SF 078067	
2. NAME OF OPERATOR Shell Oil Company		6. IF INDIAN, ALLOTTEE OR TRIBE NAME	
3. ADDRESS OF OPERATOR 1700 Broadway, Denver, Colorado 80202		7. UNIT AGREEMENT NAME Carson Unit	
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.* See also space 17 below.) At surface 1890' FNL & 616' FEL of Sec. 23, T25N, R12W, NMPM, San Juan Co., N.M.		8. FARM OR LEASE NAME	
14. PERMIT NO.		9. WELL NO. 42-23	
15. ELEVATIONS (Show whether DF, RT, CR, etc.) 6341' KB		10. FIELD AND POOL, OR WILDCAT Bisti	
		11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA Sec. 23, T25N, R12W, NMPM	
		12. COUNTY OR PARISH San Juan	13. STATE N.M.

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
TEST WATER SHUT-OFF <input type="checkbox"/>	PULL OR ALTER CASING <input type="checkbox"/>	WATER SHUT-OFF <input type="checkbox"/>	REPAIRING WELL <input type="checkbox"/>
FRACTURE TREAT <input type="checkbox"/>	MULTIPLE COMPLETE <input type="checkbox"/>	FRACTURE TREATMENT <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
SHOOT OR ACIDIZE <input type="checkbox"/>	ABANDON* <input checked="" type="checkbox"/>	SHOOTING OR ACIDIZING <input type="checkbox"/>	ABANDONMENT* <input type="checkbox"/>
REPAIR WELL <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	(Other) <input type="checkbox"/>	

(Other) _____

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

See attached abandonment prognosis

18. I hereby certify that the foregoing is true and correct

SIGNED R. O. Planty TITLE Division Operations Engr. DATE 6/17/77

(This space for Federal or State office use)


APPROVED BY _____ TITLE _____ DATE _____

CONDITIONS OF APPROVAL, IF ANY: _____


CC: NMOCC

*See Instructions on Reverse Side

Obel

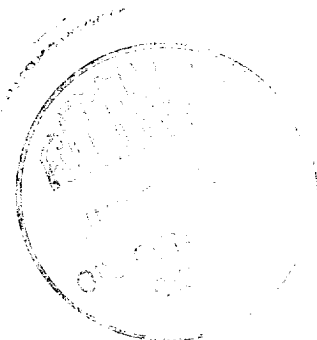

24" $8\frac{5}{8}$ "
104'

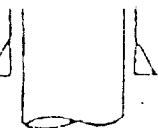

Plug and Abandonment
Carson Unit 42-23
Section 23, T. 25N, R. 12W
San Juan County, New Mexico

Pertinent Data

TD: 4945' PBD: 4920'

$8\frac{5}{8}$ " Csg. @ 104'

$4\frac{1}{2}$ " Csg. @ 4940' w/ 150 sax.

$7\frac{7}{8}$ " Hole

Elevation: 6391' KB

KB - GL = 9'
Permanent Datum = KB

Past and current status: Presently T.A'd.
Pump and anchor fish in hole.

Proposed Work: Plug and Abandon

1. No equipment. Run tubing openended, lower to PBD, load hole with mud. (Add 20 sax aquagel + 1 sack Benes per 100 bbls of mud or 20 sax salt gel per 100 bbls mud).
2. Spot 20 sax Class "G" cement mixed w/1# flocele/sack over perforations and above perforations. Minimum requirements - 100' cement plug above perforations. 12 hrs
3. Pull tubing.
4. Rig up casing pullers. Determine casing free point.
5. Attempt to shoot and pull casing at free point (theoretical cement top at 4170'). Top of Mancos Shale 3800'. Do not spend more than 3 hrs. on attempt to pull casing. If unable to pull any casing go to step 8.
6. If casing is recoverable, place cement plugs by cementing through casing or running tubing inside of csg. as it is pulled. Spot Class "G" cement plugs as follows:
 - a. 150' plug across stub of $4\frac{1}{2}$ " casing. (50' in casing, 100' in open hole)
 - b. 200' plug from top of Fruitland Coal at 1140' to 1340'.
 - c. 150' plug across base of Ojo Alamo sand at 230'. (100' below base of sand and 50' above base of sand).
 - d. 100' plug across shoe of $8\frac{5}{8}$ " casing (30' in casing, 70' in open hole).
 - e. 10 sack plug at surface.

Pump and anchor fish in hole

4805'

4818'

4833'

4859'

4864'

4876'

4885'

4896'

4902'

4912'

PBD

4920'

$4\frac{1}{2}$ "

4940'

9.5"

7. Install permanent abandonment marker as follows:

Steel marker at least 4 inches in diameter set in concrete and extending at least 4' above mean ground level. The name and number of the well and its location (Unit letter, section, township and range) shall be welded, stamped, or otherwise permanently engraved into the metal marker.

(Continuation from Step 5)

8. Perforate 4 1/2" casing w/4 JSPF as follows:
- Fruitland Coal - Pictures Cliffs interval 1170' to 1171'.
 - Below Ojo Alamo sand from 330' to 331'.
9. Run tubing, spot a 50 sack Class "G" cement plug from 1170' to 530'.
10. Pull tubing to $\pm 400'$, close bradenhead, displace 20 sax through perforations 1170' to 1171'. WOC 2 hours.
11. Pull tubing to perforations 330' to 331'.
12. Load 4 1/2" casing with cement (\pm 30 sax) and pull tubing. With bradenhead open, displace 20 sax cement through perforations 330' to 331'.
13. Spot 10 sack plug at surface.
14. Install abandonment marker as outlined in step 7.

COC:maf

J. A. Stanzione