

State of New Mexico
Energy, Minerals and Natural Resources Department
Oil Conservation Division

Sundry Notices and Reports on Wells

1. Type of Well
GAS

2. Name of Operator

**BURLINGTON
RESOURCES**

OIL & GAS COMPANY

3. Address & Phone No. of Operator

PO Box 4289, Farmington, NM 87499 (505) 326-9700

4. Location of Well, Footage, Sec., T, R, M

2375' FNL, 2200' FEL, Sec. 16, T-27-N, R-5-W, NMPM, Rio Arriba County

API # (assigned by OCD)

30-039-82362

5. Lease Number

6. State Oil & Gas Lease #

E-29C-30

7. Lease Name/Unit Name

San Juan 27-5 Unit

8. Well No.

90

9. Pool Name or Wildcat

Basin Dakota

10. Elevation:

Type of Submission

☒ Notice of Intent

☐ Subsequent Report

☐ Final Abandonment

Type of Action

☐ Abandonment

☐ Recompletion

☐ Plugging Back

☐ Casing Repair

☐ Altering Casing

☒ Other - Tubing repair

☐ Change of Plans

☐ New Construction

☐ Non-Routine Fracturing

☐ Water Shut off

☐ Conversion to Injection

13. Describe Proposed or Completed Operations

It is intended to repair the tubing of the subject well according to the attached procedure.

RECEIVED
DEC 11 1996

OIL CON. DIV.
DIST. 3

SIGNATURE *Reggie Bradfield* (ROS8) Regulatory Administrator December 10, 1996

(This space for State Use)

Approved by *Johnny Robinson* Title DEPUTY OIL & GAS INSPECTOR DIST. # 3 Date DEC 11 1996

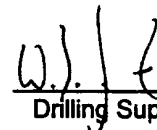
San Juan 27-5 Unit #90
Basin Dakota
2375' FNL, 2200' FEL
NE Section 16, T-27-N, R-5-W
Latitude/Longitude: 36°34.4467' / 107°21.6861'
Recommended Tubing Repair Procedure

1. Comply with all NMOCD, BLM and Burlington safety and environmental regulations. Test rig anchors and build blow pit prior to moving in rig. **Notify BROG Regulatory (Peggy Bradfield 326-9727) and the appropriate Regulatory Agency prior to pumping any cement job. If an unplanned cement job is required, approval is required before the job can be pumped. If verbal approval is obtained, document approval in DIMS/WIMS. As much time as possible to the pump time is needed for the Agency to be able to show up for the cement job.**
2. MOL and RU workover rig. Blow well down. NU 7-1/16" 3000 psi (6" 900 series) BOP with stripping head. Test and record operation of BOP rams. Kill well with 1% KCL water only if necessary. Have christmas tree serviced as needed.
3. Release donut, pick up additional joints of tubing and tag bottom (record depth). TOOH with tubing. Visually inspect tbg for corrosion, and replace any bad joints as necessary. Check tbg for scale and notify Operations Engineer.
4. TIH with casing scraper, bit and bit sub, and round trip to below perforations. TOOH. TIH with RBP on tubing and set at approximately 50' above top perf. Pressure test the casing to 500 psig. If pressure test fails, isolate leak and contact Operations Engineer for cement squeeze procedure.
5. Unload casing with air prior to releasing RBP. Release RBP and TOOH. TIH with tubing with an expendable check on bottom and a seating nipple one jt off bottom. Rabbit all tubing. CO to PBTD with air.
6. Land tubing near bottom perforation. ND BOP and NU wellhead. Pump off expendable check and record final gauges. Return well to production.

Recommended:


Operations Engineer

Approved:

 12/9
Drilling Superintendent

Rob Stanfield Phone 326-9715
Pager 324-2674