

State of New Mexico
Energy, Minerals and Natural Resources Department
Oil Conservation Division

Sundry Notices and Reports on Wells

<p>1. Type of Well GAS</p> <hr/> <p>2. Name of Operator BURLINGTON RESOURCES OIL & GAS COMPANY</p> <hr/> <p>3. Address & Phone No. of Operator PO Box 4289, Farmington, NM 87499 (505) 326-9700</p> <hr/> <p>4. Location of Well, Footage, Sec., T, R, M 990' FNL, 990' FWL, Sec.2, T-29-N, R-12-W, NMPM, San Juan County, NM</p>	<p>API # (assigned by OCD) 30-045-08839</p> <p>5. Lease Number Fee</p> <p>6. State Oil&Gas Lease #</p> <p>7. Lease Name/Unit Name Young</p> <p>8. Well No. #1</p> <p>9. Pool Name or Wildcat Basin Dakota</p> <p>10. Elevation:</p>
--	---

Type of Submission	Type of Action	
<input checked="" type="checkbox"/> Notice of Intent	<input type="checkbox"/> Abandonment	<input type="checkbox"/> Change of Plans
<input type="checkbox"/> Subsequent Report	<input type="checkbox"/> Recompletion	<input type="checkbox"/> New Construction
<input type="checkbox"/> Final Abandonment	<input type="checkbox"/> Plugging Back	<input type="checkbox"/> Non-Routine Fracturing
	<input type="checkbox"/> Casing Repair	<input type="checkbox"/> Water Shut off
	<input type="checkbox"/> Altering Casing	<input type="checkbox"/> Conversion to Injection
	<input checked="" type="checkbox"/> Other - Tubing Repair	

13. Describe Proposed or Completed Operations

It is intended to repair the tubing in the subject well according to the attached procedure.

RECEIVED
NOV 12 1999
OIL CON. DIV.
DIST. 3

SIGNATURE



Regulatory Administrator November 8, 1999

trc

(This space for State Use)

ORIGINAL SIGNED BY CHARLIE T. PERROW

Approved by

Title

DEPUTY OIL & GAS INSPECTOR, DIST. 3

Date

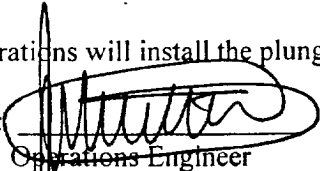
NOV 12 1999

Young #1
Dakota
990' FNL & 990' FWL
Unit D, Section 2, T29N, R12W
Latitude / Longitude: 36° 45.5465' / 107° 4.3753'
DPNO: 8680001
Tubing Repair Procedure

Project Summary: The Young #1 was drilled in 1961. The tubing has not been pulled since originally installed. We propose to pull the tubing, check for fill, replace any worn or scaled tubing, install a separator with pipe sweeps, lower the tubing and add a plunger lift. There is a possibility that the tubing is bull plugged and perforated. The Young #1 is currently producing 52 MCFD (3 month average). Estimated uplift is 50 MCFD gross and 12 MCFD net.

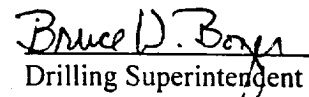
1. Hold safety meeting. Comply with all NMOCD, BLM and Burlington safety and environmental regulations. Test rig anchors and build blow pit prior to moving in rig. **Notify BROG Regulatory (Peggy Bradfield 326-9727) and the appropriate Regulatory Agency prior to pumping any cement job. If an unplanned cement job is required, approval is required before the job can be pumped. If verbal approval is obtained, document approval in DIMS/WIMS.** Allow as much time as possible prior to pump time in case the Agency decides to witness the cement job.
2. MOL and RU workover rig. Obtain and record all wellhead pressures. NU relief line. Blow well down and kill with 2% KCl water if necessary. NU BOP with stripping head. Test and record operation of BOP rams. Have wellhead and valves serviced as necessary. Test secondary seal and replace/install as necessary.
3. The Dakota tubing is 2-3/8", 4.7# set at 6436'. Release donut, pick up additional joints of tubing and tag bottom (record depth.) PBTD should be at +/- 6707'. TOOH with tubing. Visually inspect tubing for corrosion and replace any bad joints. Check tubing for scale build up and notify Operations Engineer.
4. If fill covers any perforations then TIH with 3-7/8" bit and a watermelon mill on 2-3/8" tubing to below perforations, cleaning out with air/mist. PU above the perforations and flow the well naturally, making short trips for clean up when necessary. TOOH with tubing. **NOTE: When using air/mist, minimum mist rate is 12 bph.**
5. TIH with one joint of 2-3/8" tubing with an expendable check on bottom and a seating nipple one joint off bottom. Run a broach on sandline to insure that the tubing is clear. Land tubing at approximately 6630'. ND BOP and NU WH. Pump off expendable check. Connect to casing and circulate air to assure that expendable check has pumped off. If well will not flow on it's own, make swab run to SN. RD and MOL. Return well to production.
6. Production operations will install the plunger lift.

Recommended:


Operations Engineer

Joe Michetti
Office - 326-9764
Pager - 564-7187

Approved:

 10-25-99
Drilling Superintendent