

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir. Use Form 9-331-C for such proposals.)

1. oil ☐ gas ☒ other ☐
well well

2. NAME OF OPERATOR
Tenneco Oil Company

3. ADDRESS OF OPERATOR
Box 3249, Englewood, CO 80155

4. LOCATION OF WELL (REPORT LOCATION CLEARLY. See space 17 below.)
AT SURFACE: 990' FSL, 810' FWL "P"
AT TOP PROD. INTERVAL:
AT TOTAL DEPTH:

16. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

REQUEST FOR APPROVAL TO:

SUBSEQUENT REPORT OF:

TEST WATER SHUT-OFF ☐
FRACTURE TREAT ☐
SHOOT OR ACIDIZE ☐
REPAIR WELL ☐
PULL OR ALTER CASING ☐
MULTIPLE COMPLETE ☐
CHANGE ZONES ☐
ABANDON* ☐

☐
☒
☒
☐
☐
☐
☐
☐

(other) Final tbg. detail

5. LEASE

NM 03561

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

Sullivan Gas Unit A

9. WELL NO.

1E

10. FIELD OR WILDCAT NAME

B. Dakota/Und. MV/B1. Chacra

11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA

Section 25, T29N, R11W

12. COUNTY OR PARISH

San Juan

13. STATE


New Mexico

14. API NO.

15. ELEVATIONS (SHOW DF, KDB, AND WD)

5598' gr.

(NOTE: Report results of multiple completion or zone change on Form 9-331.)

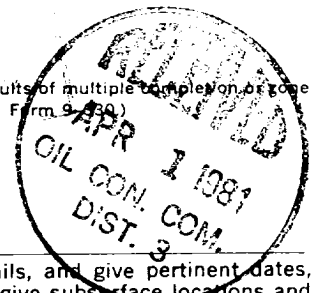

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

3/1/81. MIRUSU. Kill well. Install BOP. POOH w/tbg.

3/3/81. RIH w/wireline bridge plug. Set @ 3051'. Dumped 3 sx sand on top of BP. Loaded hole w/2% KCL wtr. and pressure test to 3000 PSI. Test good. Perf'd Chacra w/4" gun @ 2 JSPF as follows: 2754-64', 2854-68', 24', 48 holes. RIH w/fullbore prk. and set @ 2788'. Acidize w/500 gals 15% HCL over upper perms. Acidize remaining perms down tbg. w/500 gals 15% HCL, 300# salt and 42 balls. Knocked balls off perms w/pkr. Blew hole dry w/N₂. POOH w/tbg and pkr. Frac'd Chacra w/77,500 gals quality foam, 2% KCL water and 85,000# 20/40 sand, AIR: 20 BPM, AIP: 1570 PSI, ISIP: 1500 PSI, 15 min SIP: 1490 PSI. Flowing to clean up.

3/4/81. Killed well. RIH w/tbg, retrieving head, and string float. Tagged sand @ 3035'. Clean out to bridge plug w/N₂ and foam. POOH w/tbg & BP. RIH w/2-3/8" tbg, seal assy, F nipple & blast jts. Landed long string @ 6175'. RIH w/2-3/8" tbg. w/F nipple & 4 perf'd it. Landed @ 4142'. Subsurface Safety Valve: Manu. and Type _____ Set @ _____ Ft.

18. I hereby certify that the foregoing is true and correct

SIGNED Wm. J. Jenkins TITLE Asst. Div. Adm. Mgr. DATE 3/12/81

(This space for Federal or State office use)

APPROVED BY _____ TITLE _____ DATE _____
CONDITIONS OF APPROVAL, IF ANY:

NMOCC

*See Instructions on Reverse Side

MAR 31 1981

FARMINGTON DISTRICT

BY

Instructions

General: This form is designed for submitting proposals to perform certain well operations, and reports of such operations when completed, as indicated, on Federal and Indian lands pursuant to applicable Federal law and regulations, and, if approved or accepted by any State, on all lands in such State, pursuant to applicable State law and regulations. Any necessary special instructions concerning the use of this form and the number of copies to be submitted, particularly with regard to local, area, or regional procedures and practices, either are shown below or will be issued by, or may be obtained from, the local Federal and/or State office.

Item 4: If there are no applicable State requirements, locations on Federal or Indian land should be described in accordance with Federal requirements. Consult local State or Federal office for specific instructions.

Item 17: Proposals to abandon a well and subsequent reports of abandonment should include such special information as is required by local Federal and/or State offices. In addition, such proposals and reports should include reasons for the abandonment; data on any former or present productive zones, or other zones with present significant fluid contents not sealed off by cement or otherwise; depths (top and bottom) and method of placement of cement plugs; mud or other material placed below, between and above plugs; amount, size, method of parting of any casing, liner or tubing pulled and the depth to top of any left in the hole; method of closing top of well; and date well site conditioned for final inspection looking to approval of the abandonment.