Office	opropriate District	Sta	ate of New Me	exico		Fo	rm C-103 ¹
	Energy, Minerals and Natural Resources			TYPET Y A DY		July 18, 2013	
	1625 N. French Dr., Hobbs, NM 88240 District II – (575) 748-1283			WELL API 1 30-025-037			
811 S. First St., Artes	811 S. First St., Artesia, NM 88210 OIL CONSERVATION DIVISION					Type of Lease	
	strict III – (505) 334-6178 1220 South St. Francis Dr.			STAT	ΓE 🔽 FEE		
<u>District IV</u> – (505) 47 1220 S. St. Francis D	76-3460	Sa	inta Fe, NM 87	7505	6. State Oil	& Gas Lease No.	
87505	SUNDRY NO	TICES AND REPOR	RTS ON WELLS		7. Lease Na	me or Unit Agreeme	ent Name
DIFFERENT RESER	FORM FOR PROI	POSALS TO DRILL OR T PLICATION FOR PERMIT	TO DEEPEN OR PLU	JG BACK TO A		Paddock Unit	
PROPOSALS.) 1. Type of Well:	Oil Well	Gas Well Ot	her INJECTOF	₹	8. Well Nur		
2. Name of Oper CHEVRON MID	ator			<u> </u>	9. OGRID N 241333		
3. Address of Op						me or Wildcat	
		dland TX 79706)		[40660] Lo	ovington, Paddo	ock
4. Well Location Unit Let		: 660 feet fro	om the SOUTH	l line and 99	00 fee	et from the WEST	- line
Section	36			inge 36E	NMPM		ΕA
		11. Elevation (S		RKB, RT, GR, etc.	.)	·	
	12. Check	Appropriate Box	x to Indicate N	ature of Notice,	Report or O	ther Data	
N	OTICE OF	INTENTION TO		l SHE	SEOLIENT	REPORT OF:	
PERFORM REMI	_		/	REMEDIAL WOR		☐ ALTERING C	ASING
TEMPORARILY A	ABANDON [CHANGE PLAN		COMMENCE DR	ILLING OPNS.	P AND A	
PULL OR ALTER	_	MULTIPLE COM	MPL	CASING/CEMEN	IT JOB		
DOWNHOLE CO							
CLOSED-LOOP S OTHER:	SYSTEM [П	OTHER:			П
13. Describe		npleted operations. (
	g any proposed completion or r	work). SEE RULE 1 recompletion.	9.15.7.14 NMAC	C. For Multiple Co	ompletions: Att	ach wellbore diagra	m of
Spot 26 sa	acks Class (C cement from 5	971' to 5721	'.			
Spot 35 sa	acks Class (C cement from 4	599' to 4256	' .			
Spot 26 sa	acks Class (C cement from 3	1929' to 3679	•			
		48 sacks Class (
		118 sacks Class				orf/caugozo or	
		psi. If bubble te ss with NMOCD		nan to add cor	illigency pe	sii/squeeze oi	
Perforate of	& squeeze 8	39 sacks Class (C cement fro	m 376' to 0'.			
4" diameter	4' tall Above	Ground Marker			HED CONDI	TIONS	
				OF APPRO\	/AL		
Spud Date:			Rig Release Da	ite:			
I hereby certify that	at the information	on above is true and c	complete to the be	est of my knowleds	ge and belief.		
			r r		9		
SIGNATURE	Hayes?	Thibodeaux	_ _{TITLE} Engir	neer		DATE_8/12/202	22
Type or print name	_∍ Hayes Thi	bodeaux	_ E-mail address	Hayes.Thibodeau	x@chevron.com	_ PHONE: 281-7	26-9683
For State Use On	<u>ly</u>	4					
APPROVED BY:_ Conditions of App	Kerry	Fortner	_TITLECom	pliance Officer A	Α	_DATE10/5/22	
conditions of App	Tovai (II ally						

CONDITIONS OF APPROVAL FOR PLUGGING AND ABANDONMENT OCD - Southern District

The following is a guide or checklist in preparation of a plugging program, this is not all inclusive and care must be exercised in establishing special plugging programs in unique and unusual cases, Notify NMOCD District Office I (Hobbs) at (575)-263-6633 at least 24 hours before beginning work. After MIRU rig will remain on well until it is plugged to surface. OCD is to be notified before rig down.

Company representative will be on location during plugging procedures.

- **1.** A notice of intent to plug and abandon a wellbore is required to be approved before plugging operations are conducted. A cement evaluation tool is required in order to ensure isolation of producing formations, protection of water and correlative rights. A cement bond log or other accepted cement evaluation tool is to be provided to the division for evaluation if one has not been previously run or if the well did not have cement circulated to surface during the original casing cementing job or subsequent cementing jobs. Insure all bradenheads have been exposed, identified and valves are operational prior to rig up.
- **2.** Closed loop system is to be used for entire plugging operation. Upon completion, contents of steel pits are to be hauled to a permitted disposal location.
- **3.** Trucking companies being used to haul oilfield waste fluids to a disposal commercial or private- shall have an approved NMOCD C-133 permit. A copy of this permit shall be available in each truck used to haul waste products. It is the responsibility of the operator as well as the contractor, to verify that this permit is in place prior to performing work. Drivers shall be able to produce a copy upon request of an NMOCD Field inspector.
- 4. Filing a subsequent C-103 will serve as notification that the well has been plugged.
- **5.** A final C-103 shall be filed (and a site inspection by NMOCD Inspector to determine if the location is satisfactorily cleaned, all equipment, electric poles and trash has been removed to Meet NMOCD standards) before bonding can +be released.
- **6.** If work has not begun within 1 Year of the approval of this procedure, an extension request must be file stating the reason the well has not been plugged.
- 7. Squeeze pressures are not to exceed 500 psi, unless approval is given by NMOCD.
- **8.** Produced water will not be used during any part of the plugging operation.
- 9. Mud laden fluids must be placed between all cement plugs mixed at 25 sacks per 100 bbls of water.
- **10.** All cement plugs will be a minimum of 100' in length or a minimum of 25 sacks of cement, whichever is greater. 50' of calculated cement excess required for inside casing plugs and 100% calculated cement excess required on outside casing plugs.
- 11. Class 'C' cement will be used above 7500 feet.
- 12. Class 'H' cement will be used below 7500 feet.
- **13.** A cement plug is required to be set 50' above and 50' below, casing stubs, DV tools, attempted casing cut offs, cement tops outside casing, salt sections and anywhere the casing is perforated, these plugs require a 4 hour WOC and then will be tagged
- **14.** All Casing Shoes Will Be Perforated 50' below shoe depth and Attempted to be Squeezed, cement needs to be 50' above and 50' Below Casing Shoe inside the Production Casing.
- **16.** When setting the top out cement plug in production, intermediate and surface casing, wellbores should remain full at least 30 minutes after plugs are set
- 17. A CIBP is to be set within 100' of production perforations, capped with 100' of cement, WOC 4 hours and tag.
- **18.** A CIBP with 35' of cement may be used in lieu of the 100' plug if set with a bailer. This plug will be placed within 100' of the top perforation, (WOC 4 hrs and tag).

- 19. No more than 3000' is allowed between cement plugs in cased hole and 2000' in open hole.
- 20. Some of the Formations to be isolated with cement plugs are: These plugs to be set to isolate formation tops
- A) Fusselman
- B) Devonian
- C) Morrow
- D) Wolfcamp
- E) Bone Springs
- F) Delaware
- G) Any salt sections
- H) Abo
- I) Glorieta
- J) Yates.
- K) Potash---(In the R-111-P Area (Potash Mine Area),

A solid cement plug must be set across the salt section. Fluid used to mix the cement shall be saturated with the salts that are common to the section penetrated and in suitable proportions, not more than 3% calcium chloride (by weight of cement) will be considered the desired mixture whenever possible, WOC 4 hours and tag, this plug will be 50' below the bottom and 50' above the top of the Formation.

21. If cement does not exist behind casing strings at recommended formation depths, the casing can be cut and pulled with plugs set at recommended depths. If casing is not pulled, perforations will be shot and cement squeezed behind casing, WOC and tagged. These plugs will be set 50' below formation bottom to 50' above formation top inside the casing.

DRY HOLE MARKER REQ.UIRMENTS

The operator shall mark the exact location of the plugged and abandoned well with a steel marker not less than four inches in diameter, 3' below ground level with a plate of at least ¼" welded to the top of the casing and the dry hole marker welded on the plate with the following information welded on the dry hole marker:

- 1. Operator name
- 2. Lease and Well Number
- 3. API Number
- 4. Unit letter
- 5. Quarter Section (feet from the North, South, East or West)
- 6. Section, Township and Range
- 7. Plugging Date
- 8. County

SPECIAL CASES ----AGRICULTURE OR PRARIE CHICKEN BREEDING AREAS

In these areas, a below ground marker is required with all pertinent information mentioned above on a plate, set 3' below ground level, a picture of the plate will be supplied to NMOCD for record, the exact location of the marker (longitude and latitude by GPS) will be provided to NMOCD (We typically require a current survey to verify the GPS)

SITE REMEDIATION DUE WITHIN ONE YEAR OF WELL PLUGGING COMPLETION

Plugging Plan – Lovington Paddock Unit #042

API: 30-025-03776

Note:


Injection well with IPC tubing installed

Proposed procedure:

- 1. Move in P&A spread, N/U BOPE and pressure test same to 250 psi low for 5 minutes / 2500 psi high for 10 minutes.
- 2. Conduct bubble tests on all annuli. Adjust forward plan as necessary to perforate and squeeze any intervals listed below with the approval of NMOCD.
- 3. Pressure test casing/tubing string to 500 psi. If tubing tests, Sunset Well Services has frequently opted to bullhead cement below packer to assist in killing well. If this is selected as path forward, bullhead agreed upon cement volume per NMOCD. WOC. Plan to spot cement plug #1 per C-103 above the packer once released. If tubing does not test, see next job steps.
- 4. [Option if tubing does not test] Plan to set mechanical plug inside packer profile to form mechanical barrier at 5971'.
 - a. Attempt to run gauge ring through IPC tubing to 5971'
 - b. If successful, plan to set cast iron tubing plug adjacent to packer
 - c. If unsuccessful, plan to release from packer and TOH with IPC tubing. Run gauge ring then CIBP and set above packer left in hole.
- 5. TIH with pressure tested workstring to tag mechanical barrier
- 6. Spot 26 sacks Class C cement from 5971' to 5721'.
- 7. Spot 35 sacks Class C cement from 4599' to 4256'.
- 8. Spot 26 sacks Class C cement from 3929' to 3679'.
- 9. Perforate & squeeze 48 sacks Class C cement from 3379' to 3179'.
- 10. Perforate & squeeze 118 sacks Class C cement from 2135' to 1635'.
- 11. Conduct 30 minute bubble test in all annuli. Discuss contingency plan for additional perforation and squeezes or casing cut/pull. Confirm forward plan with NMOCD.
- 12. Once a passing bubble test is achieved, Perforate & squeeze 89 sacks Class C cement from 376' to 0'.
- 13. Confirm cement returns at surface
- 14. Rig down move off location

Wellbore Diagram


Created:	04/22/19	By:		Well #:	42	St. Lse:	
Updated:		By:		API	30-025-03	776	
Lease:	Loving	ton Paddock U	Jnit	Unit Ltr.:	M	Section:	36
Field:		Lovington		TSHP/Rng:		16S-36E	
Surf. Loc.:	660 F	SL & 990 FW	L	Unit Ltr.:		Section:	
Bot. Loc.:				TSHP/Rng:		_	
County:	Lea	St.:	NM	Directions:		Buckeye, NM	
Status:	Activ	e Injection We	ell	Chevno:		FA4923	

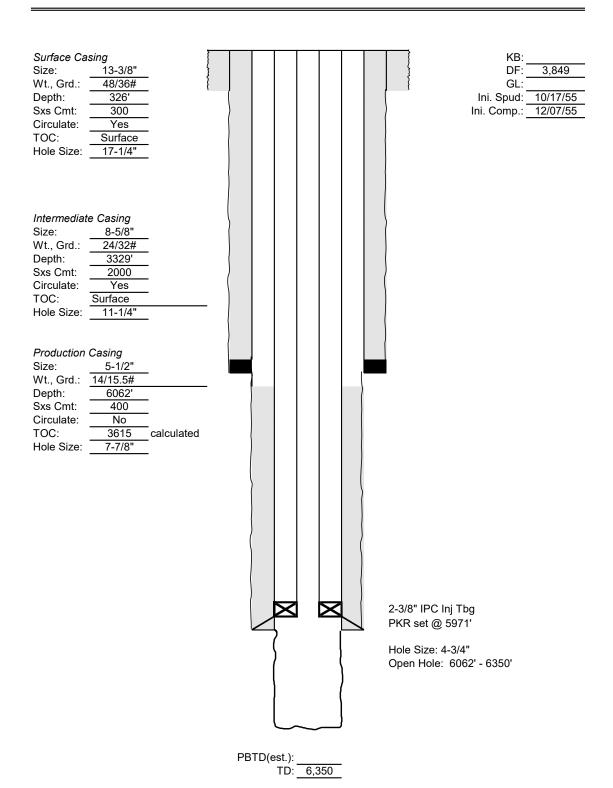

Proposed Wellbore Diagram

Created:	04/22/19	By:				
Updated:		By:				
Lease:	Lovir	Lovington Paddock Unit				
Field:	Lovington					
Surf. Loc.:	660 FSL & 990 FWL					
Bot. Loc.:						
County:	Lea	St.:	NM			
Status:	Active Injection Well					

Well #: 42 St. Lse: 30-025-03776 Unit Ltr.: Section: 36 М TSHP/Rng: 16S-36E Unit Ltr.: Section: TSHP/Rng: Directions: Buckeye, NM FA4923 Chevno:

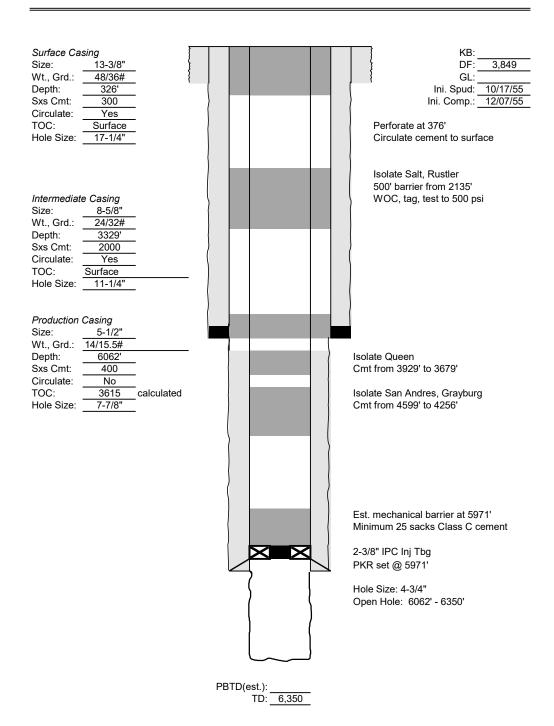

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720

District II 811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720

District III 1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. **Santa Fe, NM 87505**

COMMENTS

Action 133544

COMMENTS

Operator:	OGRID:
CHEVRON U S A INC	4323
6301 Deauville Blvd	Action Number:
Midland, TX 79706	133544
	Action Type:
	[C-103] NOI Plug & Abandon (C-103F)

COMMENTS

Created By		Comment Date
plmartinez	DATA ENTRY PM	10/6/2022

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720

District II 811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720

District III 1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. **Santa Fe, NM 87505**

CONDITIONS

Action 133544

CONDITIONS

Operator:	OGRID:
CHEVRON U S A INC	4323
6301 Deauville Blvd	Action Number:
Midland, TX 79706	133544
	Action Type:
	[C-103] NOI Plug & Abandon (C-103F)

CONDITIONS

Created By		Condition Date
kfortner	See attached COA	10/6/2022