Office Appropriate Bistrict 7	State of New N	10/11/0			Form (2 103
<u>District I</u> – (575) 393-6161 1625 N. French Dr., Hobbs, NM 88240	Energy, Minerals and Natural Resources		WELL API N	O.	evised July 1	
District II - (575) 748-1283	OIL CONSERVATIO	N DIVISION	30-015-23			
811 S. First St., Artesia, NM 88210 District III – (505) 334-6178	1220 South St. Fi			5. Indicate Type of Lease		
1000 Rio Brazos Rd., Aztec, NM 87410				STATE K FEE		
<u>District IV</u> – (505) 476-3460 1220 S. St. Francis Dr., Santa Fe, NM 87505	Santa Fe, NM	87303	6. State Oil &	c Gas Lease	No.	
	ICES AND REPORTS ON WELL		7. Lease Nan	ne or Unit A	greement N	ame
DIFFERENT RESERVOIR. USE "APPLI PROPOSALS.)	CATION FOR PERMIT" (FORM C-101)		TIGER	han aa.		
1. Type of Well: Oil Well			8. Well Number 001			
Name of Operator Matador Production Company			9. OGRID No 228937	9. OGRID Number 228937		
3. Address of Operator			10. Pool nam	e or Wildca	ıt	
	y Ste 1500 Dallas, TX 75240		PURPLE SA	AGE; WOL	FCAMP (G	AS)
4. Well Location Unit Letter C:	660 feet from the NO	RTH line and		from the	WEST	line
Section 14	Township 24S	Range 28E	NMPM	Count	ty EDDY	
	11. Elevation (Show whether L			0000		
	2988 GR					
NOTICE OF IN PERFORM REMEDIAL WORK □	NTENTION TO: PLUG AND ABANDON □	SU REMEDIAL WO	<mark>BSE</mark> Q <mark>UEN</mark> T DRK [RING CASIN	IG □
TEMPORARILY ABANDON PULL OR ALTER CASING DOWNHOLE COMMINGLE CLOSED-LOOP SYSTEM OTHER: 13. Describe proposed or comp	CHANGE PLANS MULTIPLE COMPL Deleted operations. (Clearly state a	COMMENCE D CASING/CEME OTHER: Il pertinent details, a	and give pertinent	dates, inclu	ding estima	
TEMPORARILY ABANDON PULL OR ALTER CASING DOWNHOLE COMMINGLE CLOSED-LOOP SYSTEM OTHER: 13. Describe proposed or composed or starting any proposed with proposed completion or recently and starting any proposed with proposed completion or recently and starting any proposed with proposed completion or recently and starting any proposed with proposed completion or recently and starting any proposed with proposed completion or recently and starting any proposed with proposed completion or recently and starting any proposed with proposed completion or recently and starting any proposed with a starting and start	CHANGE PLANS MULTIPLE COMPL Deleted operations. (Clearly state a ork). SEE RULE 19.15.7.14 NM completion. In CBL to surface. In Gr30 minutes, good test; TIH & tag CIBP @ 10,400" h); Circulate wellbore full of MLF; Spot 25 additional s lug @ 9,550" TM; WOC for 6 hours; TIH & tag TOC @ t casing to 550 psi for 30 minutes, good test; Spot additional s 1/2" casing; unable to pull free. 1/2" casing; unable to pull free. 2,288; Perf @ 1,000" WLM; Establish circulation & squeeze 252 sks Class C cmt; WOC for 4 hours; R ation & squeeze 125 sks Class C cmt; WOC for 4 hours; R ation & squeeze 125 sks Class C cmt; WOC for 4 hours; P ation & squeeze 125 sks Class C cmt; WOC for 4 hours; P ation & squeeze 125 sks Class C cmt; WOC for 4 hours; P ation & squeeze 250 sks C	COMMENCE D CASING/CEME OTHER: Il pertinent details, a AC. For Multiple C TM; Perform bubble test, no bub ks of Class H cmt on CIBP; WO 9,383' TM; Spot additional 55 sl onal 35 sks Class H cmt @ 9,141 g, no success; Make second jet ct IIH & tag TOC @ 5,389' WLM. RIH & tag TOC @ 2,520' WLM teeze 125 sks Class C cmt. ass C cmt total, cement to surface	and give pertinent Completions: Atta bles; Spot 25 sks of Class H c C for 6 hours; TIH & tag TOC ks of Class H cmt @ 9,383' TI 'TM; PU & spot a 25 sk Clas ut @ 6,296' WLM; Circulate M d. te on all strings.	dates, inclu ch wellbore mt on CIBP. C @ 10,336' TM. M. ss C cmt balanced p	ding estima diagram of	Ted date
TEMPORARILY ABANDON PULL OR ALTER CASING DOWNHOLE COMMINGLE CLOSED-LOOP SYSTEM OTHER: 13. Describe proposed or composed or starting any proposed with proposed completion or recently and starting any proposed with proposed completion or recently and starting any proposed with proposed completion or recently and starting any proposed with proposed completion or recently and starting any proposed with proposed completion or recently and starting any proposed with proposed with a starting and	CHANGE PLANS MULTIPLE COMPL Deleted operations. (Clearly state a ork). SEE RULE 19.15.7.14 NM completion. In CBL to surface. In Gr30 minutes, good test; TIH & tag CIBP @ 10,400" h); Circulate wellbore full of MLF; Spot 25 additional s lug @ 9,550" TM; WOC for 6 hours; TIH & tag TOC @ t casing to 550 psi for 30 minutes, good test; Spot additional s 1/2" casing; unable to pull free. 1/2" casing; unable to pull free. 2,288; Perf @ 1,000" WLM; Establish circulation & squeeze 252 sks Class C cmt; WOC for 4 hours; R ation & squeeze 125 sks Class C cmt; WOC for 4 hours; R ation & squeeze 125 sks Class C cmt; WOC for 4 hours; P ation & squeeze 125 sks Class C cmt; WOC for 4 hours; P ation & squeeze 125 sks Class C cmt; WOC for 4 hours; P ation & squeeze 250 sks C	COMMENCE D CASING/CEME OTHER: Il pertinent details, a AC. For Multiple C TM; Perform bubble test, no bub ks of Class H cmt on CIBP; WO 9,383' TM; Spot additional 55 sl onal 35 sks Class H cmt @ 9,141 g, no success; Make second jet ct IH & tag TOC @ 5,389' WLM. RIH & tag TOC @ 3,520' WLM. RIH & tag TOC @ 2,520' WLM teeze 125 sks Class C cmt. lass C cmt total, cement to surface g cement at 55' in 20" Surface Ca	and give pertinent Completions: Atta bles; Spot 25 sks of Class H c C for 6 hours; TIH & tag TOC ks of Class H cmt @ 9,383' TI 'TM; PU & spot a 25 sk Clas ut @ 6,296' WLM; Circulate M d. ce on all strings. asing; TIH w/ 1" tubing and ci	dates, inclu ch wellbore mt on CIBP. C @ 10,336' TM. M. ss C cmt balanced p	ding estima diagram of	Ted date
PULL OR ALTER CASING DOWNHOLE COMMINGLE CLOSED-LOOP SYSTEM OTHER: 13. Describe proposed or composed completion or recomposed completion or recomp	CHANGE PLANS MULTIPLE COMPL Deleted operations. (Clearly state a cork). SEE RULE 19.15.7.14 NM completion. In CBL to surface. In Gr30 minutes, good test; TIH & tag CIBP @ 10,400" h); Circulate wellbore full of MLF; Spot 25 additional slug @ 9,550' TM; WOC for 6 hours; TIH & tag TOC @ t casing to 550 psi for 30 minutes, good test; Spot additional solug @ 9,550' TM; WOC for 6 hours; TIH & tag TOC @ t casing to 550 psi for 30 minutes, good test; Spot additional soluge @ 9,550' TM; WOC for 4 hours; Refacion & squeeze 95 sks Class C cmt; WOC for 4 hours; Refation & squeeze 95 sks Class C cmt; WOC for 4 hours; Refation & squeeze 125 sks Class C cmt; WOC for 4 hours; Refation & squeeze 125 sks Class C cmt; WOC for 4 hours; Refation & squeeze 125 sks Class C cmt; WOC for 4 hours; Refation & squeeze 125 sks Class C cmt; WOC for 4 hours; Refation & squeeze 125 sks Class C cmt; WOC for 4 hours; Refation & squeeze 250 sks C mement to surface in 5-1/2", 9-5/8", & 13-3/8" casings; Ta ion. Rig Release	COMMENCE D CASING/CEME OTHER: Il pertinent details, a AC. For Multiple C TM; Perform bubble test, no bub ks of Class H cmt on CIBP; WOG 9,383' TM; Spot additional 55 si onal 35 sks Class H cmt @ 9,141 g, no success; Make second jet ct IIH & tag TOC @ 3,350' WLM. RIH & tag TOC @ 2,520' WLM teeze 125 sks Class C cmt. ass C cmt total, cement to surface g cement at 55' in 20" Surface Ca Date: CBL on 1	and give pertinent Completions: Attaubles; Spot 25 sks of Class H c C for 6 hours; TIH & tag TOC ks of Class H cmt @ 9,383' TI 'TM; PU & spot a 25 sk Clasut @ 6,296' WLM; Circulate M d. ee on all strings. asing; TIH w/ I" tubing and cifile	dates, inclu ch wellbore mt on CIBP. C @ 10,336' TM. M. ss C cmt balanced p	ding estima diagram of	Ted date
PULL OR ALTER CASING PULL OR ALTER CASING DOWNHOLE COMMINGLE CLOSED-LOOP SYSTEM OTHER: 13. Describe proposed or composed of starting any proposed or composed completion or recomposed completi	CHANGE PLANS MULTIPLE COMPL Deleted operations. (Clearly state a cork). SEE RULE 19.15.7.14 NM completion. In CBL to surface. In Gr30 minutes, good test; TIH & tag CIBP @ 10,400" h); Circulate wellbore full of MLF; Spot 25 additional slug @ 9,550' TM; WOC for 6 hours; TIH & tag TOC @ t casing to 550 psi for 30 minutes, good test; Spot additional solug @ 9,550' TM; WOC for 6 hours; TIH & tag TOC @ t casing to 550 psi for 30 minutes, good test; Spot additional soluge @ 9,550' TM; WOC for 4 hours; Refacion & squeeze 95 sks Class C cmt; WOC for 4 hours; Refation & squeeze 95 sks Class C cmt; WOC for 4 hours; Refation & squeeze 125 sks Class C cmt; WOC for 4 hours; Refation & squeeze 125 sks Class C cmt; WOC for 4 hours; Refation & squeeze 125 sks Class C cmt; WOC for 4 hours; Refation & squeeze 125 sks Class C cmt; WOC for 4 hours; Refation & squeeze 125 sks Class C cmt; WOC for 4 hours; Refation & squeeze 250 sks C mement to surface in 5-1/2", 9-5/8", & 13-3/8" casings; Ta ion. Rig Release	COMMENCE D CASING/CEME OTHER: Il pertinent details, a AC. For Multiple C TM; Perform bubble test, no bub ks of Class H cmt on CIBP; WOG 9,383' TM; Spot additional 55 si onal 35 sks Class H cmt @ 9,141 g, no success; Make second jet ct IIH & tag TOC @ 3,350' WLM. RIH & tag TOC @ 2,520' WLM teeze 125 sks Class C cmt. ass C cmt total, cement to surface g cement at 55' in 20" Surface Ca Date: CBL on 1	and give pertinent Completions: Atta bles; Spot 25 sks of Class H c C for 6 hours; TIH & tag TOC ks of Class H cmt @ 9,383' Tl'TM; PU & spot a 25 sk Clas ut @ 6,296' WLM; Circulate M ee on all strings. asing; TIH w/ 1" tubing and ci	dates, inclu ch wellbore mt on CIBP. C @ 10,336' TM. M. ss C cmt balanced p	ding estima diagram of	Ted date

4/8/24: MIRU WOR.

4/9/24: NU & function test BOPs. 4/10/24: POOH w/ 2-7/8" tubing. 4/12/24: TIH & tag up at 11,193' TM.

4/15/24: RIH & set CIBP @ 10,400' WLM; Run CBL to surface.

4/16/24: Load casing & pressure test to 500 psi for 30 minutes, good test; TIH & tag CIBP @ 10,400' TM; Perform bubble test, no bubbles; Spot 25 sks of Class H cmt on CIBP.

4/17/24: TIH & tag @ 10,400' TM (CIBP depth); Circulate wellbore full of MLF; Spot 25 additional sks of Class H cmt on CIBP; WOC for 6 hours; TIH & tag TOC @ 10,336' TM.

4/18/24: Spot a 65 sks Class H cmt balanced plug @ 9,550' TM; WOC for 6 hours; TIH & tag TOC @ 9,383' TM; Spot additional 55 sks of Class H cmt @ 9,383' TM.

4/19/24: TIH & tag @ 9,141' TM; Pressure test casing to 550 psi for 30 minutes, good test; Spot additional 35 sks Class H cmt @ 9,141' TM; PU & spot a 25 sk Class C cmt balanced plug @ 6,615' TM; WOC for 4 hours; RIH & tag TOC @ 6,303' WLM.

4/22/24: TIH w/ jet cutter & tagged high at 5,697'; MU 4-1/2" bit and cleanout to 6,312' TM.

4/24/24: TIH w/ jet cutter and attempt to cut @ 6,301' WLM; Attempt to circulate & pick up on casing, no success; Make second jet cut @ 6,296' WLM; Circulate MLF surface to surface.

4/25/24: RU casing jacks and attempt to pull 5-1/2" casing; unable to pull free.

4/26/24: TIH & Squeeze 250 sks Class C cmt through casing cut @ 6,296' WLM; WOC for 4 hours; RIH & tag TOC @ 5,389' WLM.

4/29/24: Perf @ 3,600' WLM; Establish circulation & squeeze 95 sks Class C cmt; WOC for 4 hours; RIH & tag TOC @ 3,350' WLM.

4/30/24: Perf @ 2,700' WLM; Establish circulation & squeeze 125 sks Class C cmt; WOC for 4 hours; RIH & tag TOC @ 2,520' WLM.


5/1/24: Ran CBL log indicating 0% cement at 2,288'; Perf @ 1,000' WLM; Establish circulation & squeeze 125 sks Class C cmt.

5/2/24: RIH @ tag TOC @ 716' WLM; Perf @ 451' WLM; Establish circulation & squeeze 250 sks Class C cmt total, cement to surface on all strings.

5/17/24: Cut & removed wellhead; Verified cement to surface in 5-1/2", 9-5/8", & 13-3/8" casings; Tag cement at 55' in 20" Surface Casing; TIH w/ 1" tubing and circulate cement to surface (50 sks Class C cmt); Install dryhole marker; Fill cellar and back drag location.

Spud Date: 5/8/1981

Rig Release Date: RDMO; 5/17/24 NMOCD Inspector: David Alvarado Received by OCD: 6/5/2024 2:47:17 PM

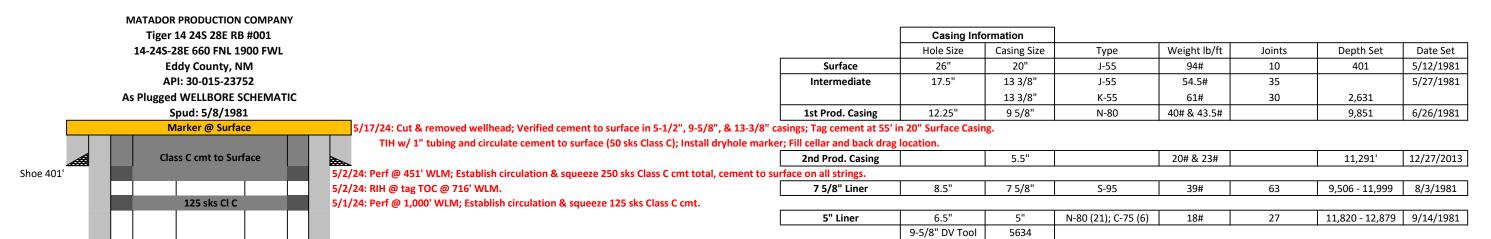

5/1/24: Ran CBL log indicating 0% cement at 2,288'.

4/30/24: Perf @ 2,700' WLM; Establish circulation & squeeze 125 sks Class C cmt; WOC for 4 hours; RIH & tag TOC @ 2,520' WLM.

4/29/24: WOC for 4 hours; RIH & tag TOC @ 3,350' WLM. 4/29/24: Perf @ 3,600' WLM; Establish circulation & squeeze 95 sks Class C cmt.

	cementing necord	
Surface	410 sx 30-60 poz w 4% D20, 300 sx Cl Cl w 2% S-I. Circ 80 sx to pit	
Intermediate	1500 sx 35/65	poz 4% gel, 5# salt, 300 sx Cl C 2% CaCl. Circ 150 sx to pit
Production		900 sx lite pox. 200 Cl C neat
7 5/8" Liner		400 sacks cement
5" Liner		150 sacks cement

Cementing Record

9-5/8" DV Tool 5,634'

Would not open

Est. TOC @ 5,779'
Per NMOCD WBD

250 sks CI C

4/26/24: TIH & Squeeze 250 sks Class C cmt through casing cut @ 6,296' WLM; WOC for 4 hours; RIH & tag TOC @ 5,389' WLM.

4/25/24: RU casing jacks and attempt to pull 5-1/2" casing; unable to pull free.

4/24/24: TIH w/ jet cutter and attempt to cut @ 6,301' WLM; Attempt to circulate & pick up on casing, no success; Make second jet cut @ 6,296' WLM; Circulate MLF surface to surface.

4/22/24: TIH w/ jet cutter & tagged high at 5,697'; MU 4-1/2" bit and cleanout to 6,312' TM.

4/19/24: PU & spot a 25 sk Class C cmt balanced plug @ 6,615' TM; WOC for 4 hours; RIH & tag TOC @ 6,303' WLM.

Geologic Markers				
Salt Bottom	2608			
Bone Spring	6280			
1st BS Sand	7243			
2nd BS Sand	8034			
Wolfcamp	9496			
Strawn	11439			
Atoka	11674			
Morrow Lime	12196			
Morrow Clastic	12401			

35 sks Cl H 4/19/24: TIH & tag @ 9,141' TM; Pressure test casing to 550 psi for 30 minutes, good test; Spot additional 35 sks Class H cmt @ 9,141' TM. Est. TOC @ 9,110' 55 sks Cl H 5/8" Liner Top @ 9,506' 65 sks Cl H 4/18/24: Spot a 65 sks Class H cmt balanced plug @ 9,550' TM; WOC for 6 hours; TIH & tag TOC @ 9,383' TM; Spot additional 55 sks of Class H cmt @ 9,383' TM. 4/17/24: TIH & tag @ 10,400' TM (CIBP depth); Circulate wellbore full of MLF; Spot 25 additional sks of Class H cmt on CIBP; WOC for 6 hours; TIH & tag TOC @ 10,336' TM. Shoe 9,851' 25 sks Cl H 4/16/24: Load casing & pressure test to 500 psi for 30 minutes, good test; TIH & tag CIBP @ 10,400' TM; Perform bubble test, no bubbles; Spot 25 sks of Class H cmt on CIBP. CIBP 4/15/24: RIH & set CIBP @ 10,400' WLM; Run CBL to surface. Perfs: 10,480-10,610 (1/18/13); 10,703-10,728 (12/27/12) Perfs: (12/27/12) 4/12/24: TIH & tag up at 11,193' TM. 11,173-11,252; non-commercial |CIBP 11,505' + 50' cmt| Shoe 11,291' CIBP as well as Permanent Packer + 3 jts tailpipe @ 11,527' 5" Liner Top @ 11,820' Guib D PKR @11,755' 11,718-11,724 (5/6/1991); 11,786-11,793 (10/6/1982) 50' CMT 4/9/24: NU & function test BOPs. 4/10/24: POOH w/ 2-7/8" tubing. CIBP 12,000' 4/8/24: MIRU WOR. Shoe 11,999' Perfs: (3/15/82) 11,820'-12,879' **CIBP 12,660'** 12,416-12,578; 12,672-12,724 MD 12.880' 13,500 gal 7.5% MSR 100, 4550 gas acid

125 sks Cl C

95 sks Cl C

Shoe 2,631

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720

District II 811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720

District III 1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. **Santa Fe, NM 87505**

CONDITIONS

Action 351150

CONDITIONS

Operator:	OGRID:
MATADOR PRODUCTION COMPANY	228937
One Lincoln Centre	Action Number:
Dallas, TX 75240	351150
	Action Type:
	[C-103] Sub. Plugging (C-103P)

CONDITIONS

Created By	Condition	Condition Date
kfortner	Need C103Q and marker photo to release CBL on file	8/13/2024