Submit 1 Copy To Appropriate District Office	State of New Mexico Energy, Minerals and Natural Resources	Form C-103 Revised July 18, 2013			
<u>District I</u> – (575) 393-6161 1625 N. French Dr., Hobbs, NM 88240 <u>District II</u> – (575) 748-1283	OIL CONSERVATION DIVISION	WELL API NO. 30-005-62382			
811 S. First St., Artesia, NM 88210 <u>District III</u> – (505) 334-6178 1000 Rio Brazos Rd., Aztec, NM 87410	1220 South St. Francis Dr.	5. Indicate Type of Lease FEDERAL STATE FEE			
<u>District IV</u> – (505) 476-3460 1220 S. St. Francis Dr., Santa Fe, NM 87505	Santa Fe, NM 87505	6. State Oil & Gas Lease No. NMNM - 032311			
SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH		7. Lease Name or Unit Agreement Name INEXCO FEDERAL			
PROPOSALS.) 1. Type of Well: Oil Well Gas	8. Well Number 4				
2. Name of Operator State of New Mexico formerly Mc	9. OGRID Number 14424				
3. Address of Operator	10. Pool name or Wildcat				
1625 N. French Drive Hobbs, N	Pecos Slope; Abo, West (Gas)				
4. Well Location Unit Letter <u>E</u> : <u>1650</u> feet from the <u>NORTH</u> line and <u>660</u> feet from the <u>WEST</u> line Section <u>30</u> Township <u>55</u> Range <u>22E</u> NMPM County <u>CHAVES</u>					
11. Elevation (Show whether DR, RKB, RT, GR, etc.)					

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:			SUBSEQUENT REPORT OF:		
PERFORM REMEDIAL WORK	PLUG AND ABANDON	×	REMEDIAL WORK	ALTERING CASING	
TEMPORARILY ABANDON	CHANGE PLANS		COMMENCE DRILLING OPNS.	P AND A	
PULL OR ALTER CASING	MULTIPLE COMPL		CASING/CEMENT JOB		
DOWNHOLE COMMINGLE					
CLOSED-LOOP SYSTEM					
OTHER:			OTHER:		
13 Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date					

 Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

SEE ATTACHED PROCEDURE & SCHEMATICS


Spud Date:	Rig Release Date	:	
I hereby certify that the information above is true and co	mplete to the best	t of my knowledge and belief.	
Type or print name Mark Whitaker For State Use Only			DATE 8/22/2017 PHONE: 575-393-6161 DATE 11/1/2017

McKay Oil Corp Inexco Federal No. 4 30-005-62382 UL – E, Sec. 30, T5S, R22E 1650' FNL & 660' FWL BLM Serial #: NM – 032311

8 5/8" 24# @ 1082' w/ 500 sx cmt 4 1/2" 10.5# @ 4242' w/ 725 sx cmt Top Perforation 3484'

- 1. MIRU. POOH w/ production equipment.
- 2. Set CIBP at 3384'. Circulate hole with mud laden fluid. Pressure test casing to 500 psi. Spot 25 sx cement on CIBP.
- 3. Perf @1132'. Sqz w/ 30 sx. WOC. Tag at 1032' or better.
- 4. Spot cement from 100' to surface.
- 5. Cut off wellhead 3' below ground level and verify cement to surface all strings.
- 6. Install below ground P&A marker. Photos should be taken prior to and after welding on plate. Record GPS reading. BLM should be notified prior to cut off so it can be witnessed.

NOTES: Mud laden fluid consists of fresh water with 25 sx salt gel per 100 bbls of fluid. If casing will not hold pressure, contact the OCD for instructions prior to proceeding with P&A.

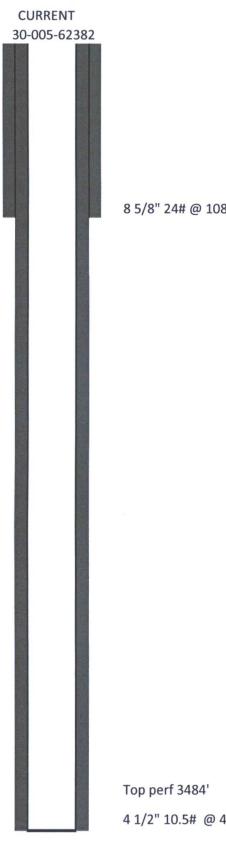

McKay Oil Corp Inexco Federal #4

8 5/8" 24# @ 1082' / 500 sx. Circ cmt.

4 1/2" 10.5# @ 4242' w/ 725 sx. Circ cmt.

McKay Oil Corp Inexco Federal #4

> CUT OFF WELLHEAD 3' BELOW GL, VERIFY CEMENT, & INSTALL BELOW GROUND MARKER. TAKE PHOTO & GPS READINGS SPOT CMT FROM 100' TO SURFACE

8 5/8" 24# @ 1082'

PERF @ 1132'. SQZ W/ 30 SX. WOC & TAG.

PRESSURE TEST CASING CIRCULATE MUD LADEN FLUID

SET CIBP AT 3384'. CAP WITH 25 SX

Top Perf 3484' 4 1/2 "10.5# @ 4242'



PROPOSED