Submit 1 Copy To Appropriate District Office	State of New Mexico	Form C-103
District I - (575) 393-6161	Energy, Minerals and Natural Resou	Revised July 18, 2013 WELL API NO.
1625 N. French Dr., Hobbs, NM 88240 <u>District II</u> – (575) 748-1283	OIL CONCEDIVATION DIVIGI	30-015-05590
811 S. First St., Artesia, NM 88210 District III – (505) 334-6178	OIL CONSERVATION DIVISION 1220 South St. Francis Dr.	5. Indicate Type of Lease
1000 Rio Brazos Rd., Aztec, NM 87410	Santa Fe, NM 87505	SOMNIK X XXXXXXXXXXXXXXXXXXXXXXXXXXXXXXXXXX
<u>District IV</u> – (505) 476-3460 1220 S. St. Francis Dr., Santa Fe, NM	Salita Fe, Nivi 87303	6. State Oil & Gas Lease No.
87505	NOTO AND DEPONTS ON WELLS	
	TICES AND REPORTS ON WELLS  OSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO	7. Lease Name or Unit Agreement Name
DIFFERENT RESERVOIR. USE "APPL	ICATION FOR PERMIT" (FORM C-101) FOR SUCH	North Shugart Queen Unit
PROPOSALS.)  1. Type of Well: Oil Well X	Gas Well  Other HOBBS OCI	
2. Name of Operator		9. OGRID Number
State of New Mexico formerl	y Tom R Cone AUG 09 2018	188152
3. Address of Operator		10. Pool name or Wildcat
	bbs, NM 88240 RECEIVED	Shugart; Yates-7RS-Qu-GB
4. Well Location Unit Letter M	990 feet from the South line	and 330 feet from the West line
Section 21		
Section 21	Township 18S Range 31 11. Elevation (Show whether DR, RKB, RT,	
	11. Elevation (Snow Whether DR, 1915), 117,	GR, etc.)
12. Check	Appropriate Box to Indicate Nature of I	Notice, Report or Other Data
NOTICE OF IN	NTENTION TO:	CURCEOUENT REPORT OF
PERFORM REMEDIAL WORK	I	SUBSEQUENT REPORT OF:  AL WORK   ALTERING CASING
TEMPORARILY ABANDON		NCE DRILLING OPNS. P AND A
PULL OR ALTER CASING		CEMENT JOB
DOWNHOLE COMMINGLE		
CLOSED-LOOP SYSTEM		
OTHER:  13 Describe proposed or compared o	OTHER:	etails, and give pertinent dates, including estimated date
		ltiple Completions: Attach wellbore diagram of
proposed completion or re-	completion.	
CEE ATTACI	HED DDOCEDIIDES & S	CLIEMATICS
SEE ATTACI	HED PROCEDURES & S	CHEMATICS
<u></u>		
Spud Date:	Rig Release Date:	
I hereby certify that the information	above is true and complete to the best of my k	nowledge and belief.
SIGNATURE	TITLE	DATE
		W4 N A M
Type or print name	E-mail address:	PHONE:
For State Use Only	P	
APPROVED BY:	Strown TITLE AD/	DATE 8/9/2018
Conditions of Approval (if any):	7.	5 51 11 200

Tom R Cone
North Shugart Queen Unit No. 10
30-015-05590
UL – M, Sec. 21, T18S, R31E
990' FSL & 330' FWL
BLM Serial #: NM LC 059569B

7 5/8" 20# @ 735' w/ 225 sx cmt 4 1/2" 9.5# @ 3560' w/ 150 sx cmt TD 3577' PBTD 3400' Perfs 3250' – 3259'

- 1. MIRU. POOH w/ production equipment.
- 2. Set CIBP at 3150'. Circulate hole with mud laden fluid. Pressure test casing to 500 psi. Spot 25 sx cement on CIBP.
- 3. Perf at 1950'. Squeeze w/ 45 sx cement. WOC & tag at 1800' or better.
- 4. Perf @ 785'. Circulate cement to surface inside/outside 4 ½" casing.
- 5. Cut off wellhead 3' below ground level and verify cement to surface all strings.
- 6. Install below ground P&A marker. Photos should be taken prior to and after welding on plate. Record GPS reading. BLM should be notified prior to cut off so it can be witnessed.

NOTES: Mud laden fluid consists of brine water with 25 sx salt gel per 100 bbls of fluid. If casing will not hold pressure, contact the OCD for instructions prior to proceeding with P&A.


## Tom R Cone North Shugart Queen Unit #10



7 5/8" 20# @ 735' w/ 225 sx.

Perfs 3250' - 3259' 4 1/2" 9.5# @ 3560' w/150 sx. CIBP @ 3400'. Covers perfs 3500' - 3516' TD 3577' PBTD 3400'

## Tom R Cone North Shugart Queen Unit #10

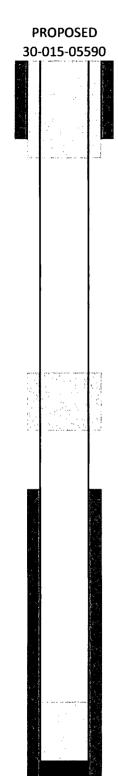

INSTALL BELOW GROUND MARKER VERIFY CMT TO SURFACE CUT OFF WELLHEAD 3' BELOW GL

7 5/8" 20# @ 735' w/ 225 sx.

PERFORATE AT 785'. CIRC CMT TO SURFACE INSIDE/OUTSIDE 4 1/2" CSG

WOC & TAG
PERFORATE AT 1950'. SQZ W/ 45 SX CMT.

SPOT 25 SX CMT ON CIBP
SET CIBP AT 3150'. CIRC MLF. PRESSURE TEST CSG

Perfs 3250' - 3259' 4 1/2" 9.5# @ 3560' w/150 sx. CIBP @ 3400'. Covers perfs 3500' - 3516' TD 3577' PBTD 3400'