

Submit 1 Copy To Appropriate District Office  
District I - (575) 393-6161  
1625 N. French Dr., Hobbs, NM 88240  
District II - (575) 748-1283  
811 S. First St., Artesia, NM 88210  
District III - (505) 334-6178  
1000 Rio Brazos Rd., Aztec, NM 87410  
District IV - (505) 476-3460  
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico  
Energy, Minerals and Natural Resources

Form C-103  
Revised August 1, 2011

OIL CONSERVATION DIVISION  
1220 South St. Francis Dr.  
Santa Fe, NM 87505

WELL API NO. 30-025-24005
5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No.
7. Lease Name or Unit Agreement Name Conoco State
8. Well Number: 4
9. OGRID Number: 16696
10. Pool name or Wildcat Hobbs; Drinkard/Hobbs;Blinebry

**SUNDRY NOTICES AND REPORTS ON WELLS**  
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: Oil Well ☒ Gas Well ☐ Other: \_\_\_\_\_

2. Name of Operator  
OXY USA Inc.

3. Address of Operator  
PO Box 4294 Houston, TX 77210

4. Well Location  
Unit Letter O : 688 feet from the South line and 2111 feet from the East line  
Section 33 Township 18S Range 38E NMPM Lea County

11. Elevation (Show whether DR, RKB, RT, GR, etc.)  
3626' (GR)

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

- PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒  
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐  
PULL OR ALTER CASING ☐ MULTIPLE COMPL ☐  
DOWNHOLE COMMINGLE ☐

SUBSEQUENT REPORT OF:

- REMEDIAL WORK ☐ ALTERING CASING ☐  
COMMENCE DRILLING OPNS. ☐ P AND A ☐  
CASING/CEMENT JOB ☐

OTHER: \_\_\_\_\_

OTHER: ☐

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

1. MIRU PU.
2. RIH with tubing and tag TOC at 5775'. Dump additional 15'.
3. Circulate plugging mud from 5760' to 5250'.
4. Spot 100' cement (Glorieta). WOC and tag. 25 SX
5. Circulate plugging mud from 5150' to 3850'.
6. Spot 150' cement (San Andres). WOC and tag.
7. Circulate plugging mud from 3700' to 2700'.
8. Perforate and squeeze at 2700' (Yates Plug). WOC and tag.
9. Circulate plugging mud from 2600' to 1650'.
10. Perforate and squeeze at 1650' (Rustler Plug). WOC and tag.
11. Circulate plugging mud to 450'.
12. Perforate and squeeze at 400' (Surface Plug).
13. Circulate cement to surface inside 7" and rig down pulling unit.
14. Cut off wellhead and install marker, 4" diameter and 4' tall.
15. Remove anchors and debris

During this procedure we plan to use the closed-loop system with a steel tank and haul contents to the required disposal per ODC Rule 19.15.17

See Attached  
Conditions of Approval  
Perf & Squeeze  
1200

Spud Date: \_\_\_\_\_

Rig Release Date: \_\_\_\_\_

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Jake Perry TITLE Production Engineer DATE 1/25/2019

Type or print name Jake Perry E-mail address: Jake Perry@oxy.com PHONE: 713-215-7546

For State Use Only

APPROVED BY: Kerry Fortner TITLE Compliance Officer A DATE 2-12-19

Conditions of Approval (if any) X




Occidental Petroleum Corporation

## Conoco St 4

API# 30-025-24005

TWN 18-S; RNG 38-E

Prod - TA'd

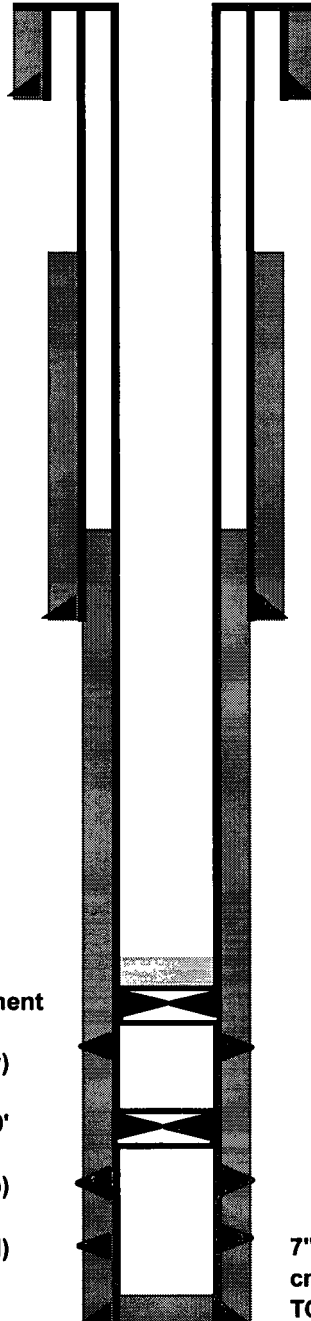

13-3/8" 48# @ 378'  
cmt'd with 350 sxs  
TOC @ surface (Circ)

9-5/8" 36# & 32# @ 3800'  
cmt'd with 350 sxs  
TOC @ 1250' (Calc)

7" CIBP at 5800', 25' of cement

5814'-6029' (Blieberry)

7" CIBP at 6300'

6523'-6534' (Tubb)

6611'-6961' (Drinkard)

7" 20#, 23# and 26# @ 7080'  
cmt'd with 600 sxs  
TOC @ 3400' (Calc)

PBTD @7040'  
TD @7080'

# Conoco St 4

API# 30-025-24005

TWN 18-S; RNG 38-E

Prod - TA'd

