UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

OCD Hobbs


FORM APPROVED OMB No. 1004-0137 Expires: July 31, 2010


Expires: J

Do not use this form for proposals to drill or to re-enter an abandoned well. Use Form 3160-3 (APD) for such proposals.

6. If Indian Allottee or Tribe Name

abandoned well. Use Form 3160-3 (APD) for such proposals.							
					A Librar of CA/Agree	ement, Name and/or No.	
I. Type of Well					8. Well Name and No.		
✓ Oil Well ☐ Gas Well ☐ Other					RATTLESNAKE FED UNIT 6		
2. Name of Operator DEVON ENERGY PRODUCTION COMPANY, LP					9. API Well No. 30-02537629		
333 West Sheridan Avenue, Oklahoma City, OK 73102-5015			nclude area code))	10. Field and Pool or Exploratory Area WILDCAT; DELAWARE		
4. Location of Well (Footage, Sec., T.,R.,M., or Survey Description) Sec 13 T26S R34E 660FSL 660FEL					11. Country or Parish, State		
Sec 13 T26S R34E 660FSL 660FEL					LEA, NM		
12. CHEC	K THE APPROPRIATE BO	OX(ES) TO INDIC	ATE NATURE C	OF NOTIC	CE, REPORT OR OTH	ER DATA	
TYPE OF SUBMISSION TYPE OF ACT					TON		
Notice of Intent	Acidize X	Deepen		=	uction (Start/Resume)	Water Shut-Off	
	Alter Casing Casing Repair	Fracture New Co	nstruction	=	amation mplete	Well Integrity Other	
Subsequent Report	Change Plans		i Abandon		oorarily Abandon		
Final Abandonment Notice	Convert to Injection	Plug Ba	ck		er Disposal		
 MIRU P&A unit. Pull rod pump and 2-7/8" product Set CIBP at 7325. Tag. Spot 25 s Spot 35 sx CI C_5409-5200. WOC Perf at 2200'-Pump 35 sx CI C 26 Perf at 4060'. Pump 35 sx CI C fr Perf @ 140'. Pump 35 sx CI C in/8. Cut wellhead off 3' BGL. Set dry 	x CI C 7325- 7256 . (open c & tag. (T. Delaware 5340 2 00-2100 '. (No more than om 106 0-960. WOC & tag out to surface.	Delaware perfs a		2	_	(Cost: 11) wood (Top Latt)	: Tay
				SEE ATTACHED FOR			
					CONDITIONS OF APPROVAL		
Bolow groun	d level	dry ho	le n	1an	Ker regu	of real	
14. I hereby certify that the foregoing is to Name (Printed/Typed)	ue and correct.						
Max Lubitz	7 1	1	itle Production	Enginee			
Signature Max Thu	Signature Max Multiple Date 1/8/2019						
	THIS SPACE	FOR FEDER	AL OR STAT	TE OFF	ICE USE		
Approved by	20.	······································	1			7 17 10	,
Conditions of approval, if any, are attached	. Approval of this notice does	s not warrant or cert	ify Title	ET		Date 2-17-19	
that the applicant holds legal or equitable ti entitle the applicant to conduct operations t	tle to those rights in the subje			0			
Title 18 U.S.C. Section 1001 and Title 43 fictitious or fraudulent statements or repre			on knowingly and	willfully to	make to any department	t or agency of the United State	s any false,

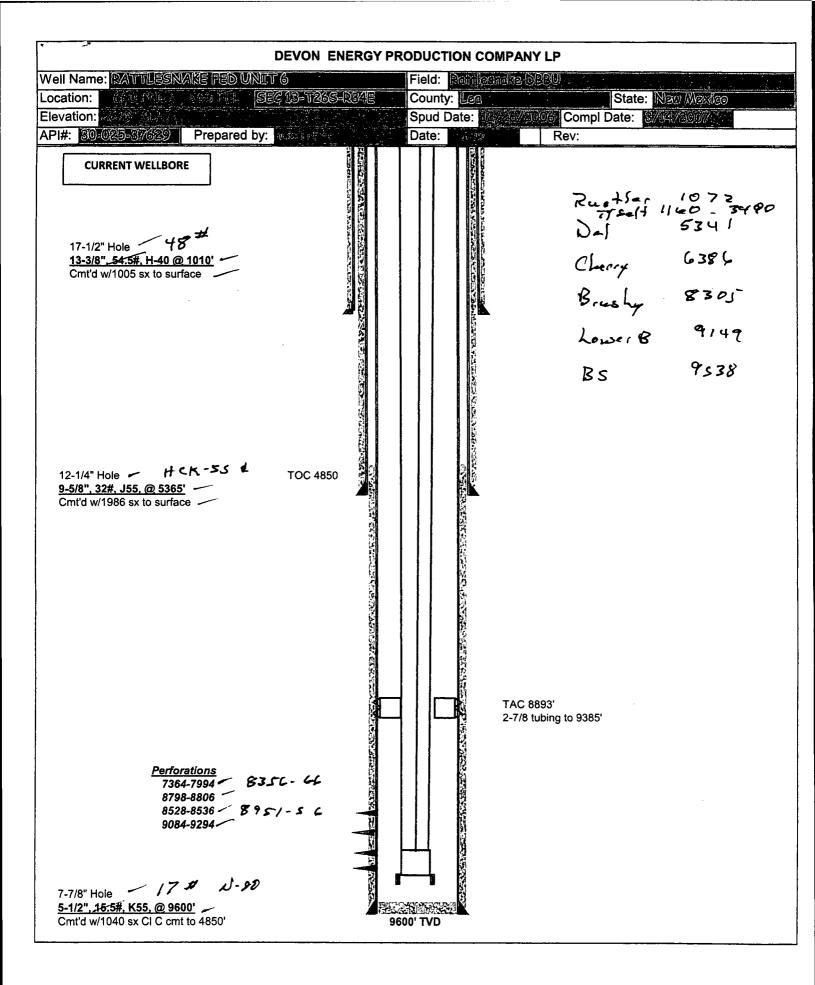

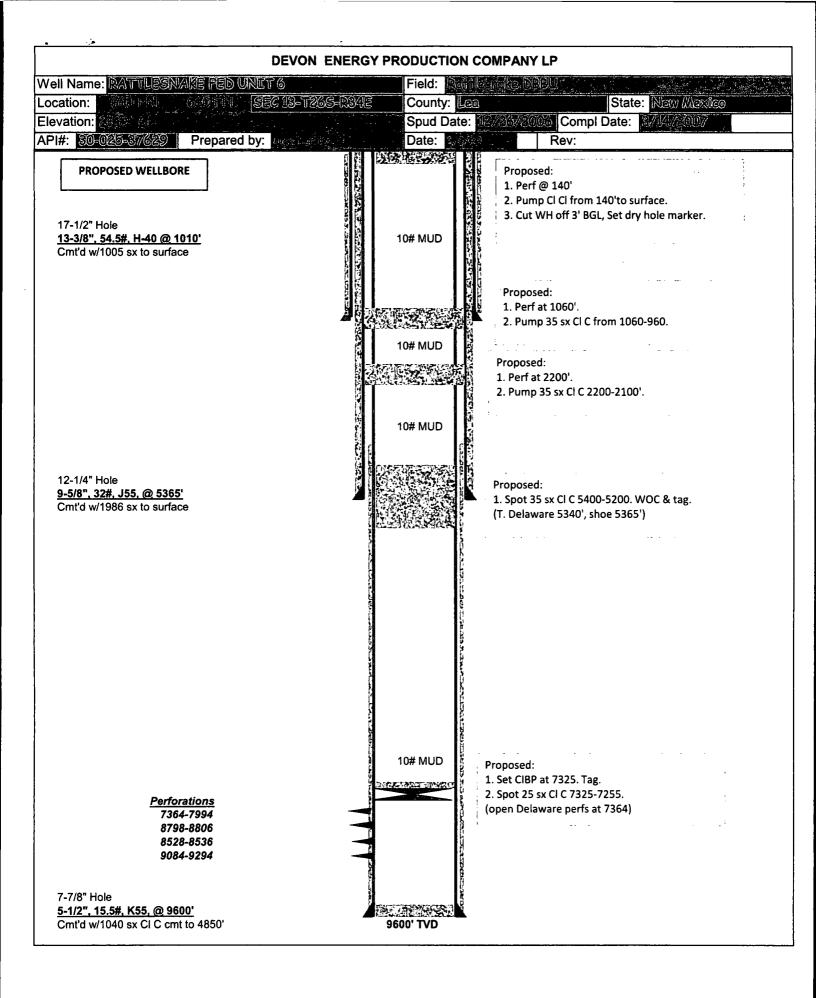

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval (LPC Habitat)

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

- 2. <u>Notification</u>: Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.
- 3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of **brine** water. Minimum nine (9) pounds per gallon.
- 5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. Below Ground Level Cap (Lesser Prairie-Chicken Habitat): All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off. Upon the plugging and subsequent abandonment of wells that are located in lesser prairie-chicken habitat, the casings shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The well bore shall then be covered with a metal plate at least ¼ inch thick and welded in place. A weep hole shall be left in the plate and/or casing.

NMOCD also requires the operator to notify NMOCD when this type of dry hole marker is used. This can be done on the subsequent report of abandonment which is submitted to the BLM after the well is plugged. State that a below ground cap was installed as required in the COA's from the BLM.

- 7. <u>Subsequent Plugging Reporting:</u> Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date well was plugged.**
- 8. <u>Trash:</u> All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.

<u>Timing Limitation Stipulation/ Condition of Approval for Lesser Prairie-Chicken:</u>
From March 1st through June 15th annually, abandonment activities will be allowed except between the hours from 3:00 am and 9:00 am. Normal vehicle use on existing roads will not be restricted