

	UNITED STATES PARTMENT OF THE INTERIOR EAU OF LAND MANAGEMENT				FORM APPROVED DMB No. 1004-0137 Expires: July 31, 2010		
SUNDRY N Do not use this a abandoned well.	6. If Indian, Allottee	or Tribe Name					
SUBMI	T IN TRIPLICATE - Other instructions	on page AOB	BS O	7. If Unit of CA/Agr	eement, Name and/or No.		
1. Type of Well		-	1120	Well Name and No MEAN GREEN 26	o. FED1H		
2. Name of Operator DEVON ENERGY PRODUCTION COMPANY, LP				10-07-041246			
3a. Address 333 West Sheridan Avenue, Oklahoma City, Ol	o. (include area sou 25	re)	10. Field and Pool or Exploratory Area JABALINA				
4. Location of Well (Footage, Sec., T., Sec 126 T26S R34E 25FNL 330FEL			11. Country or Parish LEA, NM	ı, State			
12. CHECK THE APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT OR OTHER DATA							
TYPE OF SUBMISSION	TYPE OF ACTION						
Notice of Intent	Alter Casing	epen cture Treat	=	action (Start/Resume) mation	Water Shut-Off Well Integrity		
Subsequent Report	Change Plans	w Construction g and Abandon	Temp	mplete corarily Abandon	Other	······	
Final Abandonment Notice	Convert to Injection Plue peration: Clearly state all pertinent details,	g Back		r Disposal			
determined that the site is ready for 1. MIRU P&A unit. 2. Pull ESP and 2-7/8" production to 3. Set CIBP at <del>92001</del> . Tag. Spot 25 = 4. Spot 40 sx Cl C 5400-5200. WOG 5. Perf at 2200 <sup>1</sup> . Pump 35 sx Cl C 2 6. Perf at 1125 <sup>1</sup> . Pump 35 sx Cl C fr 7. Perf @ 140 <sup>1</sup> . Pump 35 sx Cl C in/ 8. Cut wellhead off 3 <sup>1</sup> BGL. Set dry	ubing assembly from ~8613'. Jeri sx Cl H <del>9200-9100'</del> . (open Delaware pe C & tag. (T. Delaware 5340', shoe 5303 200- <del>2100'. (</del> No more than 3000' betwee om 1125-1025. (shoe 1074') woc T out to surface.	25, 121 arfs at 9254') 84 (') en plugs) Ald	500 (7   plug   Cr	σρ curve+/. (T/self) nt to 12	), cmt from Acrte 1350 250. 2006 7	\$300 - \$300 \$62	
		SEE ATTACHED FOR					
	CONDITIONS OF APPROVAL						
Below ground level dry hole marker required 14. I hereby certify that the foregoing is true and correct. Name (Printed/Typed) Max Lubitz the							
M. D	1-6	1/2/					
Signature /// UX // UAT Date //9/20/9							
THIS SPACE FOR FEDERAL OR STATE OFFICE USE							
that the applicant holds legal or equitable t entitle the applicant to conduct operations		would Office	SPE LFD		Date 2-21-7		
Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fiotitious or fraudulent statements or representations as to any matter within its jurisdiction.							
(Instructions on page 2)		XZ	NI	m o C D	3-22-19		

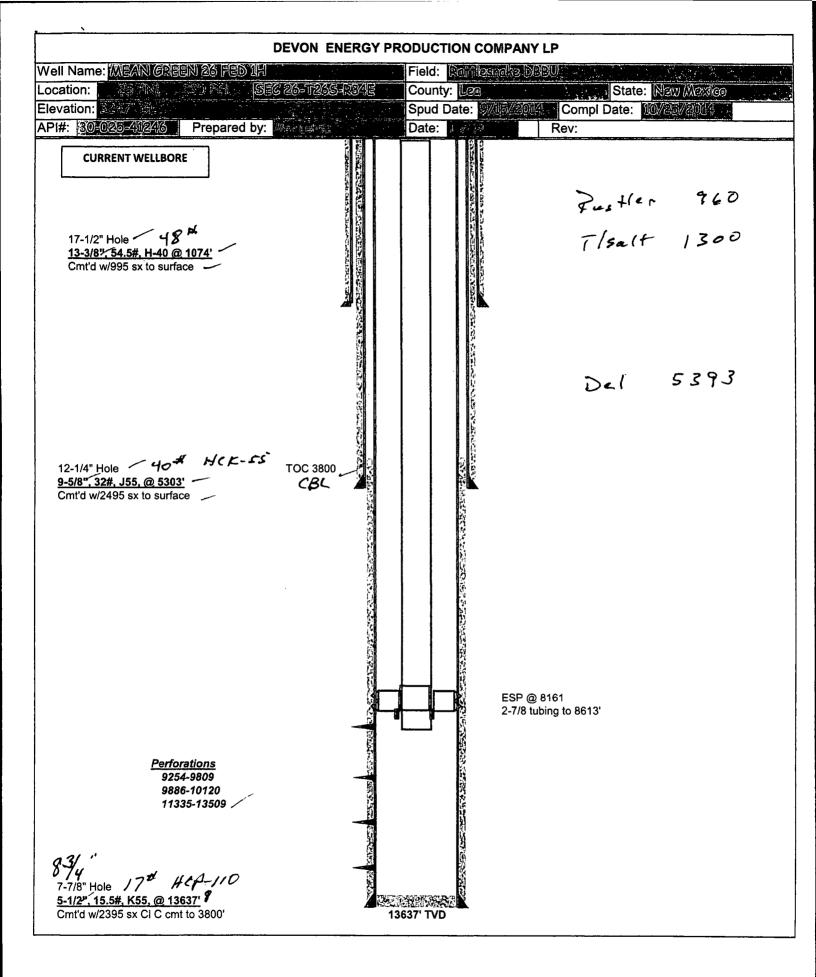

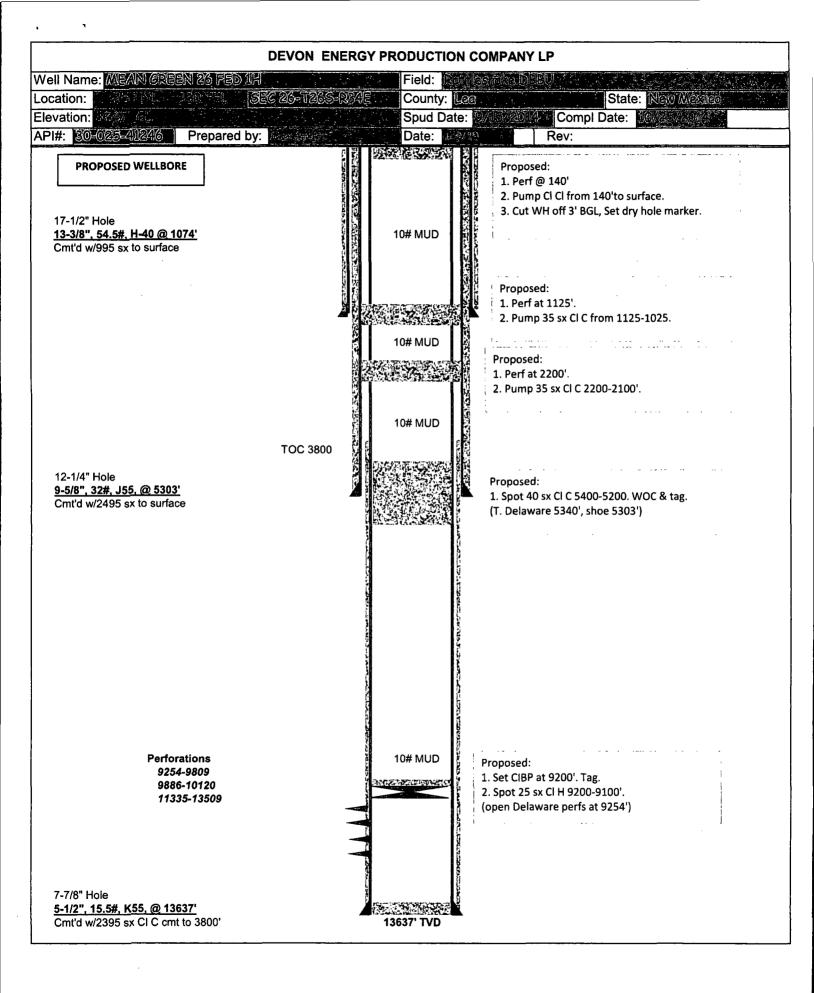

## BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

## Permanent Abandonment of Federal Wells Conditions of Approval (LPC Habitat)

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90<sup>th</sup> day provide this office, prior to the 90<sup>th</sup> day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

2. <u>Notification</u>: Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.

3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.

4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of **brine** water. Minimum nine (9) pounds per gallon.

5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

• , , •

6. <u>Below Ground Level Cap (Lesser Prairie-Chicken Habitat)</u>: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10<sup>th</sup> day, the BLM is to be contacted with justification to receive an extension for completing the cut off. Upon the plugging and subsequent abandonment of wells that are located in lesser prairie-chicken habitat, the casings shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The well bore shall then be covered with a metal plate at least <sup>1</sup>/<sub>4</sub> inch thick and welded in place. A weep hole shall be left in the plate and/or casing.

NMOCD also requires the operator to notify NMOCD when this type of dry hole marker is used. This can be done on the subsequent report of abandonment which is submitted to the BLM after the well is plugged. State that a below ground cap was installed as required in the COA's from the BLM.

7. <u>Subsequent Plugging Reporting</u>: Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. <u>Show date well was plugged.</u>

8. <u>Trash:</u> All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.

Timing Limitation Stipulation/ Condition of Approval for Lesser Prairie-Chicken:

From March 1<sup>st</sup> through June 15<sup>th</sup> annually, abandonment activities will be allowed except between the hours from 3:00 am and 9:00 am. Normal vehicle use on existing roads will not be restricted