
B SUNDRY Do not use th	UNITED STATES EPARTMENT OF THE INT UREAU OF LAND MANAGE NOTICES AND REPORT is form for proposals to dr II. Use form 3160-3 (APD)	EMENT HO	OMB		
SUBMIT IN	TRIPLICATE - Other instru	ctions on page 2 RE	7. If Unit or CA/Agr 8910115840	eement, Name and/or No. NM 70926 X	
1. Type of Well			8. Well Name and N COOPER JAL U).	
Oil Well Gas Well Ott Ott Control Contro Control Control Cont	9. API Well No. 30-025-38330	9. API Well No. 30-025-38330-00-C1			
3a. Address3b. Phone No. (include area code)303 W WALL SUITE 1600Ph: 432-689-5200MIDLAND, TX 79702Ph: 432-689-5200			10. Field and Pool o JALMAT-TAN	10. Field and Pool or Exploratory Area JALMAT-TAN-YATES-7RVRS LANGLIE MATTIX-7RVRS-QN-GB	
4. Location of Well (Footage, Sec., T., R., M., or Survey Description) Sec 18 T24S R37E NWSW 1332FSL 1207FWL				11. County or Parish, State LEA COUNTY, NM	
12. CHECK THE A	PPROPRIATE BOX(ES) T	O INDICATE NATURE O	F NOTICE, REPORT, OR OI	THER DATA	
TYPE OF SUBMISSION		TYPE O	FACTION		
Notice of Intent		Deepen	Production (Start/Resume)	U Water Shut-Off	
	□ Alter Casing	Hydraulic Fracturing	Reclamation	Well Integrity	
Subsequent Report	Casing Repair	New Construction	Recomplete	Other	
Final Abandonment Notice	 Change Plans Convert to Injection 	Plug and Abandon Plug Back	Temporarily Abandon Water Disposal		
All plugs to be minimum 25 sa 1. MIRU. Pick up work string. 2. RIH tag cement at 3225'. 3. Circulate minimum 9.5 ppg 4. Pull up hole. Spot balanced 5. Pull up hole. Spot balanced 6. Pull up hole. Spot balanced 7. TOOH. Perforate at 140°. 8. Circulate cement from 140°	P&A mud to surface and sp 1 cement plug from 3000' to 1 cement plug from 1200' to 1 cement plug from 480' to 3 1 tempt to inject.	oot 100' of cement on top of 200 0'. 1100'. ス ら らメ <i>M</i> ^{60'.} りんて・3んて、	cement at $3225'$. 35 57 $7e_{5}$ 30 $7e_{5}$ 30 $7e_{5}$	(m'n. woc 2875	
14. I hereby certify that the foregoing i Comm Name(Printed/Typed) JOHN SA	Electronic Submission #43 For LEGACY RESE aitted to AFMSS for procession		II Information System to the Hobbs on 10/03/2018 (19DLM0011SE) ATIONS ENGINEER		
Signature (Electronic Submission) Date 10/02/2018					
	THIS SPACE FOR	R FEDERAL OR STATE	OFFICE USE		
_Approved By	es a. Conser.		IET	11-26-18 Date	
Conditions of approval, if any, are attached certify that the applicant holds legal or eq which would entitle the applicant to cond	uitable title to those rights in the su		2		
Title 18 U.S.C. Section 1001 and Title 43 States any false, fictitious or fraudulent				or agency of the United	
(Instructions on page 2) ** BLM REV	NISED ** BLM REVISED	** BLM REVISED ** BLI	FOR RECORD		


Additional data for EC transaction #438041 that would not fit on the form

32. Additional remarks, continued

9. POOH, top off casing, remove WH, set P&A marker, clean and reclaim location.

Current & proposed wellbore diagrams attached.

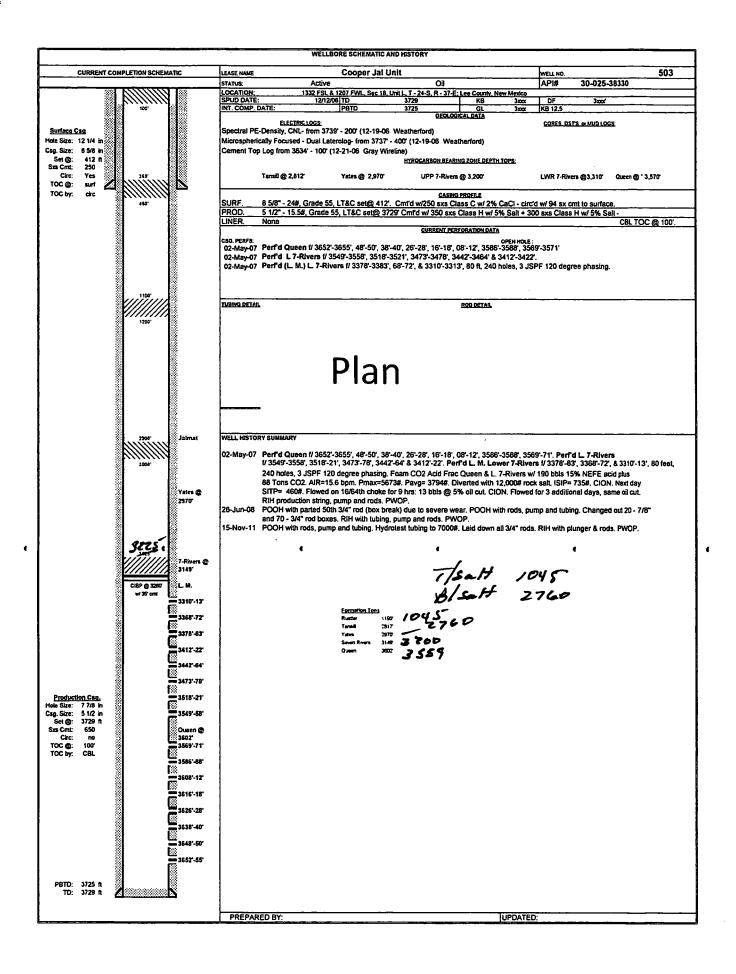

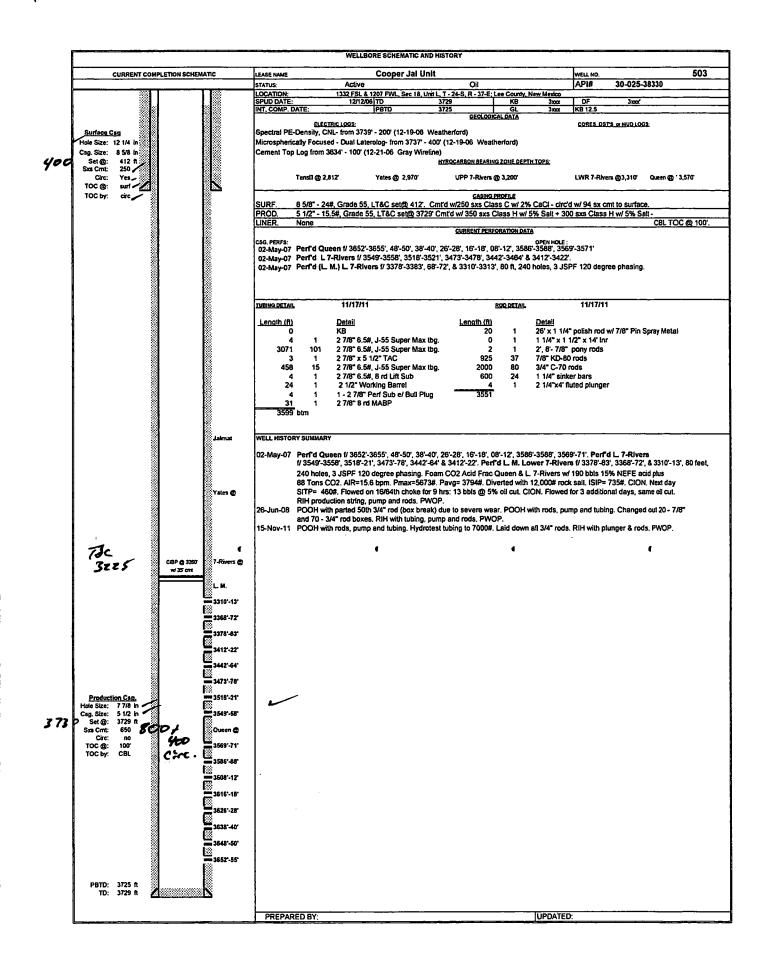

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.

3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.

4. <u>Mud Requirement</u>: Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of **brine** water. Minimum nine (9) pounds per gallon.

5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. <u>Dry Hole Marker</u>: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off.

The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement, unless otherwise noted in COA (requirements will be attached). The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds).

7. <u>Subsequent Plugging Reporting</u>: Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. <u>Show date well was plugged.</u>

8. <u>Trash</u>: All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.