

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO.	30-025-27907
5. Indicate Type of Lease	STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No.	B-1040

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"
(FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: OIL WELL <input type="checkbox"/> GAS WELL <input checked="" type="checkbox"/> OTHER <input type="checkbox"/>	7. Lease Name or Unit Agreement Name
2. Name of Operator GREAT WESTERN ONSHORE INC.	8. Well No. 1
3. Address of Operator 1111 Bagby, Suite 1700, Houston, Texas 77002-2595	9. Pool name or Wildcat Grama Ridge Morrow, East
4. Well Location Unit Letter C : 660 Feet From The North Line and 1980 Feet From The West Line Section 11 Township 22S Range 34E NMPM Lea County	10. Elevation (Show whether DF, RKB, RT, GR, etc.) 3554' GR

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>
OTHER: <input type="checkbox"/>	OTHER: <input type="checkbox"/>
PLUG AND ABANDON <input checked="" type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
CHANGE PLANS <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

See attached as follows: 1) Plugging Procedure
2) Current Wellbore Diagram
3) Proposed Plug and Abandonment Wellbore Diagram

100' cement plug @ 3500-3620
100' cement plug at 1170-1070

NOTED 24
RECEIVED
FOR THE CHOR
TO BE APPROVED

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Larry Keith TITLE Manager, Production DATE 9/23/92
TYPE OR PRINT NAME Larry Keith TELEPHONE NO. 739-8400

(This space for State Use) ORIGINAL SIGNED BY JERRY SEXTON
DISTRICT I SUPERVISOR

SEP 28 '92

APPROVED BY _____ TITLE _____ DATE _____

CONDITIONS OF APPROVAL, IF ANY:

PLUGGING PROCEDURE

**STATE NO. 1-11
LEA COUNTY, NEW MEXICO**


1. MIRU workover rig.
2. Blow well down. Load tubing with brine water. Remove tree. Install BOP's. Install 2-7/8" EUE 8rd lift joint.
3. Release RDH packer at 12,043'. POOH with tubing. Lay down packer, XA sleeve and "S" nipple.
4. Run seal assembly & 2-3/8" tubing to 12,720'.
5. Mix and pump plug No. 1, 100 sx cement to WD packer. Displace 20 sx cement below packer. Pull out of packer and spot 80 sx cement on top of packer to +/- 12,000'.
6. Pull tubing to +/- 11,800', circulate hole with unweighted fresh water mud.
7. Pull tubing to +/- 11,250'. WOC 8 hrs. Pressure test to 1000 psi.
8. Mix and pump plug No. 2, 75 sx cement from 11,250' to 10,700'.
9. POOH with tubing.
10. Run mechanical cutter and cut 7-5/8" casing at 5,300'. POOH with cutter.
11. ND BOP's and tubing head. Install 7-5/8" lift sub.
12. Pull and lay down 7-5/8" casing.
13. RIH with tubing open ended to 5,350'.
14. Mix and pump plug No. 3, 75 sx cement from 50' below top of 7-5/8" casing stub to 125' above casing stub.
15. Pull tubing to +/- 50'. Mix and pump plug No. 4, 5 sx cement from 50' to surface. POOH with tubing. RD service unit.
16. Cut off wellhead 3-4' below ground level.
17. Install dry hole marker. Dry hole marker is to be a minimum diameter of 4", it will extend 4' above ground level and will be set in cement in the 10-3/4" casing stub. The dry hole marker will have the following information welded on the upper 4' of the pipe:

**GREAT WESTERN ONSHORE INC.
STATE WELL NO. 1-11
UNIT LETTER C
NE/4 NW/4 SEC. 11-T22S-R34E
LEA COUNTY, NEW MEXICO**

18. Remove all production equipment. Cut off flowlines below ground level. Cut off deadmen below ground level or remove.
19. Clean and backfill around wellhead and all pits. Level location. Leave well P & A.

GREAT WESTERN ONSHORE INC.
GRAMMA RIDGE (EAST)
LEA COUNTY, NEW MEXICO
WELL: STATE 1-11

0 000000
12.18.81

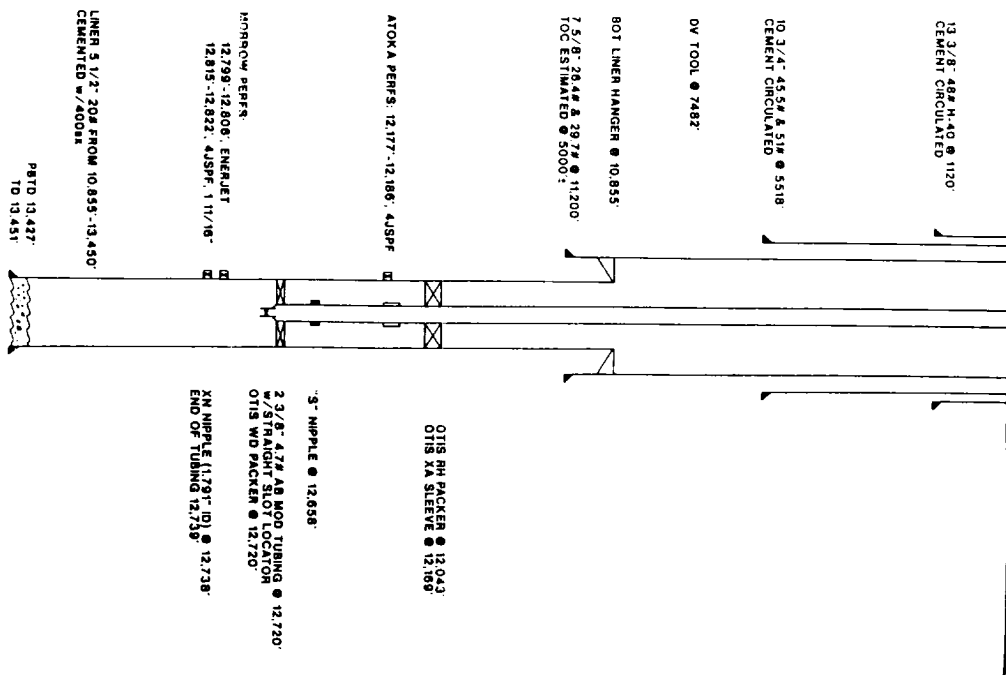

GREAT WESTERN ONSHORE INC.
GRAMMA RIDGE (EAST)
LEA COUNTY, NEW MEXICO
WELL: STATE 1-11

PROPOSED PLUG AND ABANDONMENT

0 000000
5.12.81

