
## State of New Mexico Energy, Minerals and Natural Resources Department

Revised 5-27-2004 FILE IN TRIPLICATE HOBBS OCOIL CONSERVATION DIVISION WELL API NO. DISTRICT I 1220 South St. Francis Dr. 1625 N. French Dr., Hobbs, NM 88240 30-025-05467 Santa Fe, NM 87505 DEC 17 2012 5. Indicate Type of Lease DISTRICT II 1301 W. Grand Ave, Artesia, NM 88210 STATE X FEE 6. State Oil & Gas Lease No. **DISTRICT III** RECEIVED 1000 Rio Brazos Rd, Aztec, NM 87410 SUNDRY NOTICES AND REPORTS ON WELLS 7. Lease Name or Unit Agreement Name (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A North Hobbs (G/SA) Unit DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (Form C-101) for such proposals.) Section 23 1. Type of Well: 8. Well No. 431 Oil Well Gas Well 2. Name of Operator 9. OGRID No. 157984 Occidental Permian Ltd. 3. Address of Operator 10. Pool name or Wildcat Hobbs (G/SA) HCR 1 Box 90 Denver City, TX 79323 4. Well Location Unit Letter 1 : 2310 Feet From The Line and Feet From The Line South 330 East Section County 18-S 37-E Lea 11. Elevation (Show whether DF, RKB, RT GR, etc.) 3642' KB Pit or Below-grade Tank Application or Closure Pit Type Depth of Ground Water Distance from nearest fresh water well Distance from nearest surface water Below-Grade Tank: Volume \_\_\_\_\_ bbls; Construction Material Pit Liner Thickness \_\_\_\_ Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data 12. NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF: PLUG AND ABANDON PERFORM REMEDIAL WORK REMEDIAL WORK ALTERING CASING **CHANGE PLANS** COMMENCE DRILLING OPNS. **TEMPORARILY ABANDON** PLUG & ABANDONMENT PULL OR ALTER CASING Multiple Completion CASING TEST AND CEMENT JOB OTHER: OTHER: 13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion. 1. RUPU & RU. 2. ND wellhead/NU BOP. 3. POOH w/tubing and injection packer. RIH w/bit. Tag @4277'. RU power swivel. Clean out from 4277-4364'. Circulate clean. RD power swivel. POOH w/bit. RIH w/CIBP set @4275' and CICR set @4197'. RU HES & squeeze perfs 4248-4270' with 300 sacks (71 bbl) 2% Super CBL cement. Sting out of retainer. Reverse out 1 bbl. 70 bbl in perfs. RD HES. RIH w/bit & drill collars. Tag @4197'. RU power swivel & drill on cement, CICR & CIBP from 4197'-4310'. RD power swivel. POOH w/bit & drill collars. Tag @4365'. Test squeeze. Tested OK. RU wireline & perforate casing at 4349-60', 4337-42', 4310-17', 4296-4300', 4280-88', RD wireline. RIH w/SPA packer set @4170'. Acid treat new perfs w/1600 gal of 15% NEFE acid in 3 stages. Flush w/25 bbl 10# brine. POOH w/SPA packer. \*\*\*see attached sheet for additional data\*\*\* I hereby certify that the information above is true and complete to the best of my knowledge and belief. I further certify that any pit or below-grade tank has been/will be closed according to NMOCD guidelines or an (attached) alternative OCD-approved , a general permit plan SIGNATURE TITLE Administrative Associate DATE 12/14/2012 TYPE OR PRINT NAME Mendy A E-mail address: TELEPHONE NO. hnson mendy johnson@oxy.com 806-592-6280 For State Use Only APPROVED BY TITLE

CONDITIONS OF APPROVAL IF ANY:

Form C-103

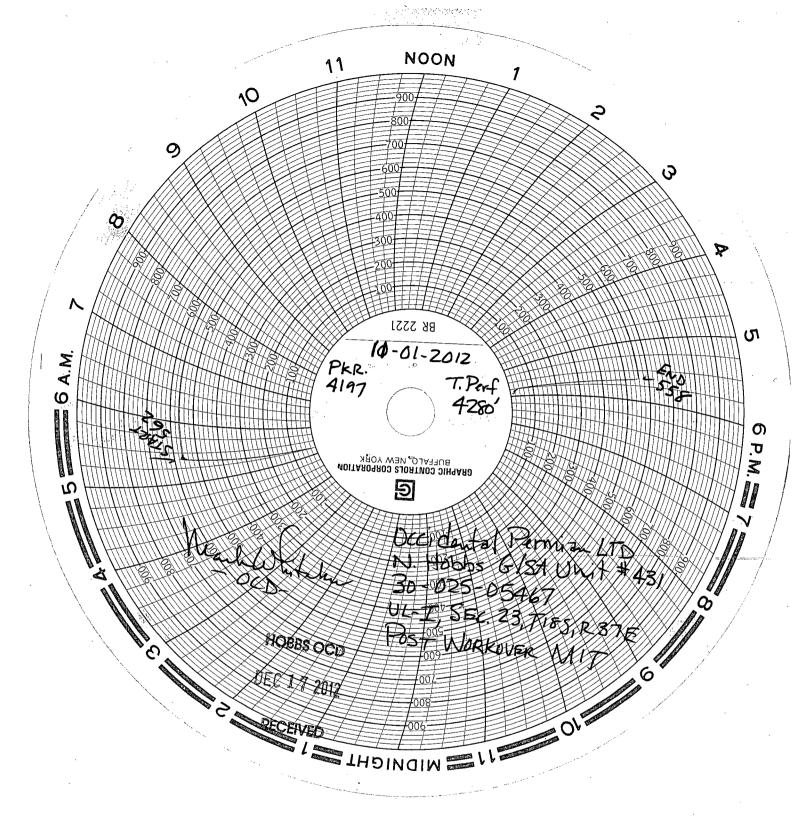


## NHU 23-431 30-025-05467

- 10. RIH w/HES G-6 packer set on 134 jts of 2-7/8" Duoline 20 tubing. Packer set @4206'
  11. Test casing to 562 PS for 30 minutes and charted for the NMOCD. Mark Whitaaker w/NMOCD on site for test.
- 12. ND BOP/NU wellhead.
- 13. RDPU & RU. Clean location and return well to injection.

RUPU 10/16/2012 RDPU 11/01/2012

## Work Plan Report for Well: NHSAU 431-23

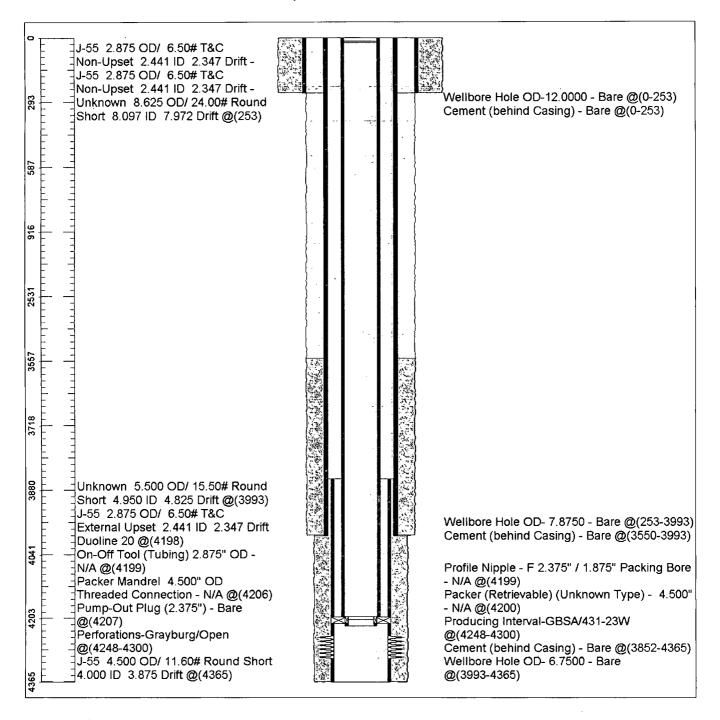

## **Survey Viewer**