a...a


State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103

Revised 5-27-2004 HOBBS OR CONSERVATION DIVISION FILE IN TRIPLICATE WELL API NO. 1220 South St. Francis Dr. DISTRICT I 1625 N. French Dr., Hobbs, NM 88240 30-025-07623 Santa Fe, NM 87505 AUG 2 8 2013 5. Indicate Type of Lease DISTRICT II STATE FEE 1301 W. Grand Ave, Artesia, NM 88210 Х 6. State Oil & Gas Lease No. DISTRICT III RECEIVED 1000 Rio Brazos Rd, Aztec, NM 87410 7. Lease Name or Unit Agreement Name SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A South Hobbs (G/SA) Unit DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (Form C-101) for such proposals.) 8. Well No. 1. Type of Well: 40 as Well Oil Well Other Injecto 9. OGRID No. 2. Name of Operator 157984 Occidental Permian Ltd. 3. Address of Operator 10. Pool name or Wildcat Hobbs (G/SA) HCR I Box 90 Denver City, TX 79323 4. Well Location Feet From The Line Unit Letter K Feet From The Line and 1980 West 1980 South NMPM Range County . Township 19-S 38-E Section Lea 11. Elevation (Show whether DF, RKB, RT GR, etc.) 3629' KB Pit or Below-grade Tank Application or Closure Distance from nearest fresh water well Distance from nearest surface water Pit Type _____ Depth of Ground Water _ Below-Grade Tank: Volume _____ bbls; Construction Material Pit Liner Thickness mil Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data 12. SUBSEQUENT REPORT OF: NOTICE OF INTENTION TO: ALTERING CASING PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK COMMENCE DRILLING OPNS. **PLUG & ABANDONMENT** CHANGE PLANS TEMPORARILY ABANDON Multiple Completion CASING TEST AND CEMENT JOB PULL OR ALTER CASING OTHER: OTHER: x Failed MIT test repair 13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion. RUPU & RU. 1. ND wellhead/NU BOP. 2. POOH and lay down tubing and injection packer. 3. 4 RIH w/RBP and set @3805'. Tested casing. Lost pressure. POOH w/RBP. RIH w/bit. Tag @3848'. NU power swivel and clean out iron sulfide to 4200'. ND power swivel. POOH w/bit. 5 RIH w/Arrowset 1-X Dbl grip packer set on 120 jts of 2-3/8" Duoline 20 tubing. Packer set @3794'. 6. Test casing to 580 PSI for 30 minutes and chart for the NMOCD. 7 ND BOP/NU wellhead. 8 9 RDPU & RU. Clean location and return well to injection. RUPU -06/25/2013 RDPU 07/05/2013 I hereby certify that the information above is true and complete to the best of my knowledge and belief. I further certify that any pit or below-grade tank has been/will be constructed or closed according to NMOCD guidelines , a general permit or an (attached) alternative OCD-approved plan SIGNATURE MAIM TITLE Administrative Associate DATE 08/26/2013 TYPE OR PRINT NAME TELEPHONE NO. Mendy E-mail address: mendy johnson@oxy.com 806-592-6280 A ohnson For State Use Only APPROVED BY DAT CONDITIONS OF APPRO ANY SEP 0 3 20

August 26, 2013

Work Plan Report for Well:SHOU-40K05

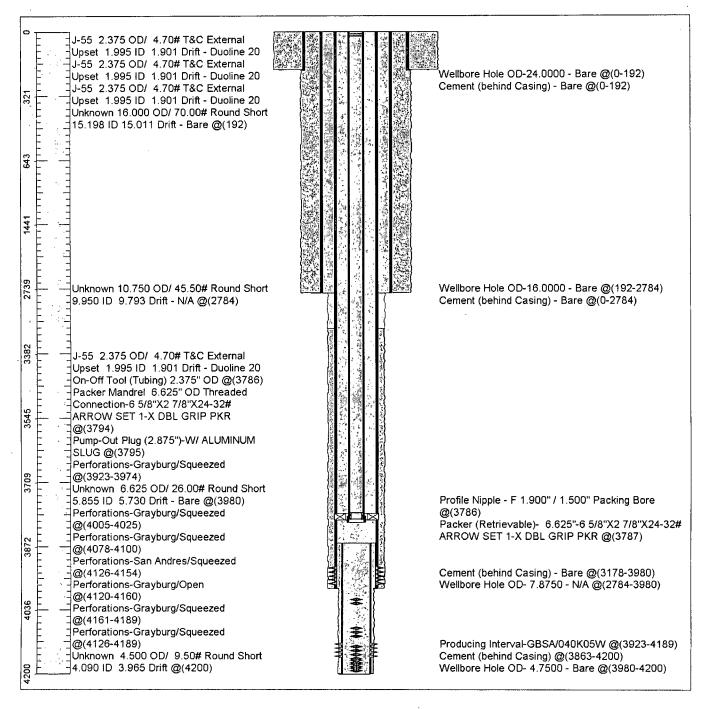

Survey Viewer

