Submit 3 Copies To Appropriate District Office	State of New Mexico Energy, Minerals and Natural Resources		Form C-103 June 19, 2008
District I , 1625 N. French Dr., Hobbs, NM 87240	Energy, Himerano and The		WELL API NO.
District II 1301 W. Grand Ave., Artesia, NM 88210	OIL CONSERVATION	ON DIVISION	30-025-22772
District_III	1220 South St. F		5. Indicate Type of Lease
1000 Rio Brazos Rd., Aztec, NM 87410 District IV	Santa Fe, NM	87505	STATE FEE x
1220 S. St. Francis Dr., Santa Fe, NM 87505			6. State Oil & Gas Lease No. 24695
(DO NOT USE THIS FORM FOR PROP DIFFERENT RESERVOIR. USE "APPLI PROPOSALS.)		N OR PLUG BACK TO A	7. Lease Name or Unit Agreement Name: Stuart Langlie Mattix Unit
1. Type of Well: Oil Well Gas Well	Other Injection	HOBBS OCD	8. Well Number
2. Name of Operator		111 11 2014	9. OGRID Number
Energen Resources Corpora 3. Address of Operator	cion /	11)1 11 2011	10. Pool name or Wildcat
· •	Ste. 100, Midland, TX 797	05	Langlie Mattix 7 RVRS Queen
4. Well Location		RECEIVED	
Unit Letter A:	100 feet from the N	orth line and	660 feet from the East line
Section 10	Township 25-8	Range 37E	NMPM County Lea
	11. Elevation (Show whether	er DR, RKB, RT, GR, et 139' KB	c.)
12. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data			
	rr r	,	
NOTICE OF INT	ENTION TO:	SUB	SEQUENT REPORT OF:
PERFORM REMEDIAL WORK	PLUG AND ABANDON 🔯	REMEDIAL WORK	☐ ALTERING CASING ☐
TEMPORARILY ABANDON	CHANGE PLANS	COMMENCE DRILL	ING OPNS. P AND A
PULL OR ALTER CASING	MULTIPLE COMPL	CASING/CEMENT J	ов 🗆
DOWNHOLE COMMINGLE .			
OTHER:		OTHER:	
13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.			
Proposed procedure to P&A SIMU #126 attached.			
Thank you.	1	04.	
	Thouky	, ,	
A			•
Spud Date:	Rig Rel	ease Date:	
I hereby certify that the information	above is true and complete to t	he best of my knowledg	e and belief.
SIGNATURE Bunda	Mastye_ TI		ory Analyst DATE 07/08/2014
Type or print name Brenda F Ratl	njen E-	brenda.rathjen@ -mail address:	PHONE <u>432-688-3323</u>
For State Use Only A			
APPROVED BY WHILE SUIT SUPERVISOR DATE 1/15/2014			
Conditions of Approval (if any).	0		JUL 1 5 2014

SLMU #126

Stuart Langlie Mattix Unit Lea County, NM 100' FNL and 660' FEL Sec 10, T25S, R37E API — 30-025-22772 Completion Date: 1968

Plug & Abandon Procedure

- 1 MIRU Well Service Unit. NDWH, NU BOP.
- 2 RIH and tag CIBP @ 3183'. Spot 35 sxs cement on CIBP. WOC & tag.
- 3 Circulate hole to mud laden fluid
 4 Perferate at 2425' and squeeze with 25 sxs cement, WOC-& tage
- 5 Perforate at 1400' and squeeze with 35 sxs cement, WOC & tag. Leave TOC +/-1200'. /100'
- 6 Perforate at 1,125' and squeeze with 25 sxs cement, WOC & tag. OMIT
- 7 Perforate at 315'. Squeeze and circulate cement to surface.
- 8 Cut off all casing strings at base of cellar or 3' below restored ground level.
- 9 Cover wellbore with metal plate welded in place or with cement cap.
- 10 Erect capped abandonment marker inscribed with well information.
- 11 Cut off dead man anchors and fill in cellar.
- 12 Clean and restore location to natural condition and fulfill any and all regulatory requirements.

Prepared by: RL Adams 2/5/2014



SLMU #126

Stuart Langlie Mattix Unit Lea County, New Mexico

100' FNL and 660' FEL Sec 10, T25S, R37E API — 30-025-22772

Spud Date:

10/17/68

KB:

3139'

TD:

3530'


Completion Date:

11/1/68

GL:

3127'

PBTD: 3183' (CIBP)

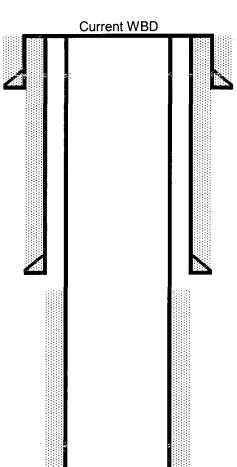

Surface Casing:

8-5/8" 24# csg @ 1299' w/200 sx

PBTD:

TD: 3530'

CIBP Set @ 3183' (05/14)

3292'-3448' 2 JSPF - (1968)

Production Casing: @ 3530' w/200 sx

TOC - 1984'

5-1/2", 14#



SLMU #126

Stuart Langlie Mattix Unit Lea County, New Mexico

100' FNL and 660' FEL Sec 10, T25S, R37E API — 30-025-22772

Spud Date: Completion Date:

10/17/68 11/1/68 KB: GL:

3139' 3127' TD: 3530'

PBTD: 3183' (CIBP)

Proposed WBD

Perf @ 315'. Squeeze and circulate cement to surface.

Perf @ 1,125' and squeeze 25 axa; WOC and tag-

Perf @ 1,400' and squeeze 25 sxs, WOC and tag. Leave TOC +/4200'

Surface Casing:

8-5/8" 24# csg @ 1299' w/200 sx

SPOT

Perf-@-2,425' and squeeze 25 sxs, WOC-and-tag...

Cap CIBP w/35 sx. WOC & tag CIBP Set @ 3183' (05/14) 3292'-3448' 2 JSPF - (1968)

Production Casing:

5-1/2", 14#

@ 3530' w/200 sx

TOC - 1984'

PBTD: TD: 3530'