Form 3160-5 (August 2007)

UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

FORM APPROVED OMB NO. 1004-0135 Expires: July 31, 2010

5.	Lease Serial No.
	NMNM112940

SUNDRY Do not use the abandoned we		Lease Serial No. NMNM112940 If Indian, Allottee or Tribe Name			
abandoned we	Ose form o roo-o (Ar b)	Tor such proposals.		The Contract of the State of th	
SUBMIT IN TRI	7. If Unit or CA/Ag	greement, Name and/or No.			
1. Type of Well ☐ Gas Well ☑ Off 2. Name of Operator	8. Well Name and N BRININSTOOL	lo. 25 FEDERAL 1 ✓			
Name of Operator OWL SWD OPERATING, LLC	9. API Well No. 30-025-37582	9. API Well No. 30-025-37582			
3a. Address 8214 WESTCHESTER DRIVE DALLAS, TX 75255	SUITE 850	Bb. Phone No. (include area code Ph: 432-234-0427 HOBBS C	SWD; BELL C	10. Field and Pool, or Exploratory SWD; BELL CNYN-CHRRY CNYN	
4. Location of Well (Footage, Sec., T	., R., M., or Survey Description)		11. County or Paris	h, and State	
Sec 25 T23S R33E Mer NMP	1980FNL 660FEL	MAY 0 5 20	16 LEA COUNTY	/, NM	
12. CHECK APPI	ROPRIATE BOX(ES) TO I	NDICATE AFTER OF	NOTICE, REPORT, OR OTH	ER DATA	
TYPE OF SUBMISSION	OF ACTION				
= Nation of Interes	☐ Acidize	☐ Deepen	☐ Production (Start/Resume)	☐ Water Shut-Off	
■ Notice of Intent	☐ Alter Casing	☐ Fracture Treat	☐ Reclamation	■ Well Integrity	
☐ Subsequent Report	Casing Repair	■ New Construction	☐ Recomplete	⊠ Other	
☐ Final Abandonment Notice	☐ Change Plans	☐ Plug and Abandon	□ Temporarily Abandon	Workover Operations	
	☐ Convert to Injection	☐ Plug Back	■ Water Disposal		
Days 1 - 2? Begin Operations Meetings. Day 3? RIH w/ 6-1/8? bit and Days 4? 28? Drill out & clean several trips for bit/mill change Days 29? 30? Spot 50 sx cer Day 31? Set 4-1/2? CIBP @ 1	7? scraper. Pressure test E out junk and cement plugs eventually reaching 11,950.	BOP and continue to 7278' Mill, circulate, drill, circul 0?. Tag plug @ 11,496?.	?. ate		
14. I hereby certify that the foregoing is	Electronic Submission #315	5741 verified by the BLM We	ell Information System		
	Committed to AFMSS for pro	ocessing by JENNIFER SAN	CHEZ on 11/16/2015 ()		
Name (Printed/Typed) BEN STO	NE .	Title AGEN	T / CONSULTANT	the state of the state	
Signature (Electronic S	ubmission)	Date 09/08/2	2015 ACCEPTED E	D DECORD	
	THIS SPACE FOR	FEDERAL OR STATE	OFFICE USELI LUI	JN NEGOND	
Approved By Conditions of approval, if any, are attached ertify that the applicant holds legal or equivalent would entitle the applicant to conduction	bject lease Office	NOV 17	Date 2015		
Fitle 18 U.S.C. Section 1001 and Title 43 to States any false, fictitious or fraudulent s	U.S.C. Section 1212, make it a critatements or representations as to	ne for any person knowingly and any matter within its jurisdiction	willful y to make to AN SPAN FI	riggenes of the Chiled	
				LLU VIIIVE	

** OPERATOR-SUBMITTED ** OPERATOR-SUBMITTED **



Additional data for EC transaction #315741 that would not fit on the form

32. Additional remarks, continued

Day 32 ? Run CBL from 9,000' to 7,826'. (Pulled out large chunk of rubber in bowspring assembly.)

Day 33 ? Adjust bowspring and TIH w/ open-ended tubing to 8794?. Spot 35 sx cement at 8794?.

Day 34 ? RIH to tag ? no plug; cement failed ? circulate hole clean.

Days 35 ? 36 ? Spot 50 sx cement at 8794?; Tag at 8391?.

Days 37? 38? MIT on 4-1/2? casing stump to 500 psi for 30 mins. Perf 4 shots at 7,860' (50' below top of 4-1/2" csg stump. Spot 50 sx cement at 7873?. Circulate hole clean. Tag @ 7620?. POOH & RIH w/ PKR to 7571?.

Days 39 ? 40 ? MIT on plugged 4-1/2? at 1200 psi for 1 hour. RU & RIH and perforate 7366? to 5280? w/ total 1800 shots. RIH w/ tubing & PKR to 5222?. Swab 4 runs returning 48 bbls iron sulfide water.

Day 41? Acidized perfs w/15,000 gal 15% NEFE HCl acid + 3,000 gal gelled brine water.

Days 42 ? 44 ? Swab 10 runs FL @ 1000?. RIH w/ tubing and nickel-coated PKR set @ 5232?. MIT 500 psi for 30 mins. Rig down and release all equipment. Well ready for SWD per NMOCD SWD-1364.

FULL DAILY REPORT DETAILS AND WELLBORE DIAGRAM ARE ATTACHED.

ATTACHMENT TO BLM 3160-5 SUNDRY DATED 9/08/2015

Owl Oil and Gas, LLC Brininstool 25 Federal Well No. I API No.30-025-37582 1980' FNL & 660' FEL Section 25, Twp 23-S, Rng 33-E Lea County, New Mexico

THIS SUMMARY IS BEING PROVIDED PER INSTRUCTIONS FROM PAUL SWARTZ (BLM-CFO) VIA EMAIL (9/04/2015) TO SUBMIT FINAL/ SUBSEQUENT SUNDRY DOCUMENTING DOWNHOLE REPLUGGING AND SWD CONFIGURATION OF THE WELL.

Instruction: A Subsequent Sundry report form 3160-5 – identify all work done to the well starting from 5/27/2015. This will most likely require attachments to this sundry.

Daily Report Summary

- Days I 2 Begin Operations 5/27/2015 Prepare location and well head; install BOP. Safety Meetings.
- Day 3 RIH w/ 6-1/8" bit and 7" scraper. Pressure test BOP and continue to 7278'.
- Days 4 28 Drill out & clean out junk and cement plugs. Mill, circulate, drill, circulate several trips for bit/mill change, eventually reaching 11,950'.
- Days 29 30 Spot 50 sx cement on CIPB at 11,950'. Tag plug @ 11,496'.
- Day 31 Set 4-1/2" CIBP @ 10,993' & cap w/ 25 sx cement. (Not rgr'd to tag by BLM Hobbs.)
- Day 32 Run CBL from 9,000' to 7,826'. (Pulled out large chunk of rubber in bowspring assembly.)
- Day 33 Adjust bowspring and TIH w/ open-ended tubing to 8794'. Spot 35 sx cement at 8794'.
- Day 34 RIH to tag no plug; cement failed circulate hole clean.
- Days 35 36 Spot 50 sx cement at 8794'; Tag at 8391'.
- Days 37 38 MIT on 4-1/2" casing stump to 500 psi for 30 mins. Perf 4 shots at 7,860' (50' below top of 4-1/2" csg stump. Spot 50 sx cement at 7873'. Circulate hole clean. Tag @ 7620'. POOH & RIH w/ PKR to 7571'.
- Days 39 40 MIT on plugged 4-1/2" at 1200 psi for 1 hour. RU & RIH and perforate 7366' to 5280' w/ total 1800 shots. RIH w/ tubing & PKR to 5222'. Swab 4 runs returning 48 bbls iron sulfide water.
- Day 41 Acidized perfs w/15,000 gal 15% NEFE HCl acid + 3,000 gal gelled brine water.
- Days 42 44 Swab 10 runs FL @ 1000'. RIH w/ tubing and nickel-coated PKR set @ 5232'. MIT 500 psi for 30 mins. Rig down and release all equipment.

 Well ready for SWD per NMOCD SWD-1364.

Daily Report Detail

- Day 1, 5/27/2015 Bladed location & prepared it for pulling unit & equipment. Notified NMOCD & BLM of operation start-up.
- Day 2, 5/28/2015 Arrive location. MIRUPU-ESCO #235. RU reverse unit & H2S safety compliance package. ND tree. NU BOP. Closed blind rams & pressure tested csg to 1,100 psi for 15 minutes OK. Unloaded 2 7/8" and 2 3/8" tbg work string. SIW/SDON.
- Day 3, 5/29/2015 Arrive location. BOP was not tested to 5,000 psi by rental company. Change out BOP per BLM requirements. PU & GIH w/6 1/8" mill tooth bit, 7" csg scrapper, 6 3 1/8" DC & 1 jt 2 7/8" tbg. Tested BOP & csg to 1100 psi OK. Install riser to surface from 9 5/8" csg head & prepared riser for 13 3/8" surface csg hd. Continue TIH & PU 2 7/8" 6.5# N80 8rd EUE tbg work string to 7,278'. SIW/SDFN.
- Day 4, 5/30/2015 Arrive location. Tag cmt at 7,444'. Established reverse circulation at 3 BPM at 700 800 psi. Drill to 7,454' (10' with only 2' in last 3 hrs.). Recovering large amt of metal (steel, brass, and aluminmum) & rubber with small amount of cement. Drilling slow because bit plugging frequently with only 1 pt of WOB. TOH to inspect bit. No apparent problems with bit or scraper. SIW/SD till Monday
- Day 5, 6/02/2015 Arrive location. Well is dead. TIH with bit, csg scraper, DC's and tbg. Started drilling with 3 BPM at 850 psi and tbg string would plug off. Lowered pump rate to 2.2 BPM at 550 psi, unplugged tbg string and then drilled CIBP at 7460' with 2.2 2.5 BPM and 350 550 psi. Bit fell thru at 7465'. Washed, rotated, & pushed junk down to 7,730'. Tbg continued to try to plug off. Rec metal, rubber, and cement. Circ hole clean. Left bit swinging at 7,720'. SIW/SDON.
- Day 6, 6/03/2015 Arrive location. Well was dead. Resume drilling & cleaning hole from 7,730' to 4 1/2" csg stub at 7810'. Circ clean. TOH. LD bit/csg scraper. Visually inspect DC's. Found a piece of metal wedged inside. PU 3 7/8" bit, x-over, 5 x 3-1/8" DC, & ~4,000! 2-3/8" 4.7# N80 8rd EUE tbg on 2-7/8" tbg work string. TIH to 3,000'. SIW/SDON
- Day 7, 6/04/2015 Arrive location. Well dead. TIH. Tag junk at top of 4 1/2" csg stub. Drill up junk. Rec small pieces of metal. Bit fell thru & went down to 7,825'. PU I jt & LD swivel. Could not get back inside 4-1/2" csg. Drld/pushed junk downhole. TIH & stack out wt at 8,150'. Drld/pushed junk down to 8,210'. Rec several large chunks of rubber & some metal cuttings. TIH to 8,276' & tag. SIW/SDON
- **Day 8, 6/05/2015** Arrive location. Start drilling/pushing junk downhole to 8,277'. Recovered tip of bit cone. Circ clean. TOH. Bit missing 2 cones. GIH w/3-3/4" plug muncher mill on work string to 1,000'. SIW/SDON.
- Day 9, 6/06/2015 Arrive location. Well ead. TIH with mill. Had problems re-entering 4-1/2" csg stump. Work mill about 1 hr before finally getting into stub. (Top of stub has given us problems on several trip. This was worst probably due to mill geometry not being as forgiving as roller cone bit on working into stub Stub may be "boogered up". We may have to dress off stub with a pilot/string mill if this continues to be a problem or gets worse.) TIH to 8,277'. Mill on bit cones & other junk to 8,305'. Rec pieces of bit cones & small metal cuttings. Mill quit making hole. Circ hole clean. TOH. About 1/3 out of hole pulled out with partially split it of tbg (crack/split immediately below tbg collar.) Decided it

- was not prudent to pick up on tbg & potentially have tbg fail & drop in hole. SD & order slip type elevators to pick up on split jt. SIW/SDON.
- Day 10, 6/07/2015 Arrive location. Well dead. PU slip type elevators & LD 1 bad jt tbg, PU regular elevators & continue TOH. LD mill worn out and all 4 jets partially plugged. GIH w/new plug muncher mill. Stop at 4-1/2" csg stump. Worked/rotated for 5 minutes before able to re-enter sump. TIH to 8,305'. Mill to 8,335'. Rec metal cuttings (small pieces of previous mill and bit cones) & rubber. Circ clean. SIW/SDON.
- **Day 11, 6/08/2015** Arrive location. Well dead. Resumed milling at 8,335'. Mill quit drilling at 8,347'. TOH. Worn out mill had pieces of metal stuck in jets one piece was an allen head cap screw. SIW/SION.
- Day 12, 6/09/2015 Arrive location. Well dead. GIH w/new 3-3/4" concave mill on work string. (Prev mill was plugged with large pieces of metal, cap screw, and 1/8" dia ball bearings). Mill from 8,347' to 8,376' (rec small metal cuttings.) Lost partial string wt. TOH with 43 jts 2 7/8" tbg, and the collar from jt #44. (TOF is at 1370' with 2 7/8" upset with clean break looking up). SIW/SDON. Note: Suspect junk is TAC (tbg anchor) left in hole when plugged. May have add'l jt of tbg below. We have had two incidents with rental tbg & suspect it is bad. We will lay down & replace after recovering fish.
- **Day 13, 6/10/2015** Arrive location. Well dead. PU 4-11/16" overshot w/5-3/4" cutlip (3-1/16" grapple). TIH. Latch onto fish. TOH. LD parted jt of tbg & fishing tools. Continue TOH & LD all rental tbg string. Left DC in hole. Load out & return 2-3/8" & 2-7/8" rental tbg to Iron Gate. SIW/SDON.
- Day 14, 6/11/2015 Arrive location. Well dead. TOH with DC's & mill. Unload & tally 2 3/8" and 2 7/8" PH6 tbg. TIH with 3-3/4" metal muncher mill, 5 x 3-1/8" DCs, ~4,000' 2-3/8" 4.7# P110 PH6 tbg, & 585' 2-7/8" 6.5# P110 PH6 tbg. Left mill swinging at 4,585'. SIW/SDON.
- Day 15, 6/12/2015 Arrive location. Well dead. Continue PU 2-7/8" tbg & TIH. Work thru 4 1/2" csg stub. TIH. Tag at 8,379'. Set 10 pts wt on junk but would not push down. Mill from 8,379' to 8,580'. (Continue having problems with mill plugging. Recovering lots of metal & some rubber.) Circ hole. SIW/SDON.
- Day 16, 6/13/2015 Arrive location. Well is dead. Continued milling on junk from 8580'. Rec metal cuttings, a 1/4" brass washer, 1/8" roller bearing and some cement. Drld cement with slight amount of metal in returns from 8725' 8892'. Rec I large o-ring and 4" x 6" piece of rubber. Still had problems with mill trying to plug off. PU to 8880' and SIW/SD until Monday.
- Day 17, 6/16/2015 Arrive location. Well dead. Continue milling from 8,892' to 9,108'. Rec cmt and metal cuttings. Try to push down with 5 pts wt would not go down. Mill plugging continuing to be a problem. Mill quit. TOH to 7,800'. SIW/SDON.
- Day 18, 6/17/2015 Arrive location. Well dead. Continued TOH. LD mill (2 of the 3 jet openings were plugged solid with metal cuttings). PU new metal muncher mill (mill #4). TIH with tbg. Worked mill thru top of 4 1/2" csg stub with pipe wrenches. Continued TIH to 9,008'. SIW/SDON.
- Day 19, 6/18/2015 Arrive location. Well dead. Resume milling from 9,108' to 9,305'. Started torquing up & plugging mill. Push down/mill to 9,368' (push junk down 5' -10' & mill for 2'- 5'). Rec metal and a small amount of rubber several pieces of TAC slips. Made 260' total for day. SIW/SDON.

- Day 20, 6/19/2015 Arrive location. Well dead. Mill to 9,370'. Power swivel quit. Circ & troubleshoot swivel. Unable to repair. Push junk down to 9,390' with 4 5 pts weight. Rig down waiting for replacement swivel (truck bringing replacement swivel involved in an accident. Will arrive in morning.) SIW/SDON.
- Day 21, 6/20/2015 Arrive location. Well dead. Chg out power swivel. Resume milling on junk. Milled/pushed/spudded on junk from 9,390' to 9,415'. Mill plugging. Recovering very few cuttings which were small in size. Mill appears to be spinning on junk with an occasional bite of torque. TOH to change mill. SIW/SDON.
- Day 22, 6/21/2015 Arrive location. Well dead. Finish TOH. LD mill. PU 3 3/4" shoe, 120' washpipe, jars, & bumper sub on work string. TIH. Tag top of junk at 9,413'. SIW/SDON. (Crew performed repairs on hydromatic after SDON).
- Day 23, 6/22/2015 Arrive location. Well dead. Wash over junk from 9,413' to 9,540' with 1,000 psi torque no WOB. At 9540', tbg string would fall freely. TIH to 10,669' stopping every 4-5 jts to circ btms up. SIW/SDON.
- Day 24, 6/23/2015 Arrive location. Well dead. Tag at 10,732' & plugged tbg. Unplug tbg. Wash down to 10,930' & mill from 10,930' 10,969'. Rec cmt/small amount metal. POH to 5,320'. SIW/SDON.
- Day 25, 6/24/2015 Arrive location. Well dead. Continue TOH. Rec small piece of 4 1/2" jet cutter bottom plug wedged in washpipe. GIH w/new shoe & washpipe to 7,600'. SIW/SDON.
- **Day 26, 6/25/2015** Arrive location. Well dead. Finish TIH. Washed/milled/pushed from 10,955' to 11,170'. Rec several large chunks of rubber and some cmt. Returns had very small amount of condensate with good gas blow. Rev circ 9 ppg CBW to control gas. SIW/SDON.
- Day 27, 6/26/2015 Arrive location. Well dead. Mill/wash/clean out hole from 11,170' to 11,957'. Tag solid on CIBP. Circ hole clean. TOH. SIW/SDON.
- Day 28, 6/27/2015 Arrive location. Well dead. LD DC's & wash pipe. No junk in wash pipe. TIH open-ended. Tag CIBP 11,950'. PU 5' & reverse hole clean. SIW/SD til Monday. (Note: We cannot set cmt plug or proceed with work because BLM does not work P&A's on weekend. Notified BLM Jim McCormick at 12 Noon 6/26/15 of intention to set first cmt plug on Monday morning.)
- Day 29, 6/30/2015 Arrive location. Circ gas off csg till well is dead. Mix 100 sx salt gel in 400 bbl 9.0 ppg CBW. RU Trans Tex Cementers. Mix & spot 50 sx Class H cmt (16.4 ppg, 1.06 cu ft/sx) on CIBP @ 11,950'. Pull tbg to 11,490'. Reversed out cmt. WOC. SIW/SDON. (Cmt plug witnessed by BLM-lack Johnson.)
- Day 30, 7/01/2015 Arrive location. Well dead. Tag TOC plug at 11,496' (Witnessed by Jack Johnson -BLM.) Displace hole w/9 ppg viscosified mud. TOH. GIH w/4 1/2" CIBP on tbg to 5,100'. SIW/SDON.
- Day 31, 7/02/2015 Arrive location. Bled off gas. Well dead. TIH. Set CIBP at 10,993'. Tag BP w/10 pts (Witnessed by Jack Johnson BLM.) RU Tran Tex cmt. Mix & spot 25 sx Class H cmt (16.4 ppg, 1.06 yld.) Pull tbg 280' & reverse clean. (Note: BLM-Jack Johnson & Hobbs office is not requiring us to tag TOC on this plug, only tag BP.) TOH. SIW/SDON.

- Day 32, 7/03/2015 Arrive location. Well dead. RU Capitan WLU & RIH with GR/CCL/CBL tool. Could not get inside 4 1/2" csg. Log from csg stub to 7,450'. POH. Found large chunk of rubber in bowspring (1" thick x 4" x 6"). Adjust bowspring to smaller OD. RIH. Log from 9,000' to 7,826' (top of 4 1/2" csg.) POH. RD WLU. TIH with tbg open ended to 4,100'. SIW/SD until Monday. (Note: Sent BLM-Paul Swartz a copy of combined CBL from 9,000' to surface per COA.)
- Day 33, 7/07/2015 Arrive location. Well dead. Finish TIH to 8,794'. RU Trans Tex. Mix & spot 35 sx Cl H cmt (16.4 ppg, 1.06 yld.) Pull tbg to 8,606'. Rev clean. Cmit spot witnessed by BLM Jack Johnson. WOC. SIW/SDON.
- Day 34, 7/08/2015 Arrive location. Well dead. TIH & tag cmt at 10770'. (Jack Johnson with BLM witnessed). Cmt plug from 8,606' to 8,794' was not found. Cmt failed to set? TOH to 8,606'. Rev well clean. SIW/SDON.
- Day 35, 7/09/2015 Arrive location. Well is dead. TIH to 8794'. No tag. RU Trans Tex cmtrs. Mix & spot 50 sx Class H cmt (16.4 ppg, 1.06 yld). Witnessed by BLM-Jack Johnson. TOH to 8,325'. Reverse clean. Pull to 8,262'. WOC. SIW/SDON.
- Day 36, 7/10/2015 Arrive location. Well dead. Tag cmt at 8,391'. (BLM-Jack Johnson witnessed.) TOH & LD 2 3/8" tbg. GIH w/7"x2-7/8" Arrowset AS-IX pkr, SN, x-over on 2 7/8" tbg to 7,754'. SIW/SDON.
- Day 37, 7/11/2015 Arrive location. Well dead. Set pkr at 7,759'. RU kill trk & chart recorder. Perform MIT of 4 1/2" csg stub at 500 psi -30 min. All annulus valves open. Witnessed by BLM-Jack Johnson & NMOCD-Bill Sonnamaker. Rlse pkr. TOH. RU Capitan WLU. Perf 4 shots at 7,860' (50' below top of 4-1/2" csg stump. RD WLU. TIH open-ended with 3 jts 2 3/8" tbg + 2 7/8" tbg to 7,873'. RU Trans Tex cementers. Mix & spot 50 sx Cl "H" cmt (16.4 ppg, 1.06 yld). Witnessed by BLM-Jack Johnson. TOH to 7,591'. Reverse clean. TOH to 7,466', WOC. SIW/SD for weekend.
- Day 38, 7/14/2015 Arrive location. Well dead. Tag cmt at 7,620'. Witnessed BLM-Jack Johnson. Pull up to 7,615'. Rev clean w/3% KCl wtr. TOH. TIH w/pkr to 7,571'. SIW/SDON..
- Day 39, 7/15/2015 Arrive location. Well dead. RU kill truck. Set pkr at 7571'. Performed MIT at 1200 psi- I hour on csg below pkr. Witnessed by BLM Jack Johnson. (NMOCD notified but declined to witness). Release pkr. POH. RU Capitan WLU. RIH with 3 1/8" slick carrier gun. Perforate 7366' 56', 7216' 7196', 6768' 58', 6664' 54', 6620' 10', 6585' 65', 6404' 6394', 10', and 6370' 60' (720 shots. .4 EHD, 6 SPF 120° phasing). SIW/SDON.
- Day 40, 7/16/2015 Arrive location. Well dead. Capitan WLU continued perf with 3 1/8" slick carrier gun. IFL at 450' FS. Perforate 6280' 60', 6205' 6195', 6160' 40', 6035' 25', 5940' 30', 5872' 62', 5740' 30', 5702' 5692', 5590' 70', 5640' 30', 5440' 30', 5396' 86', 5370' 60', 5300' 5280' (1080 shots. .4 EHD, 6 SPF 120° phasing). Total perforations 1800 shots and 300' net height. FFL at 300' FS. RD WLU. GIH w/pkr & SN on tbg. Set pkr at 5,222'. RU swab. IFL-surface. Made 4 swab runs in 1 hr 20 min. FFL 2,800'. Rec 48 Bbls iron sulfide water. BLM Jack Johnson witnessed & approved proceeding with acidizing perfs. SIW/SDON.
- Day 41, 7/17/2015 Arrive location. SITP 75 psi. Bled off tbg until well dead. RU ProPetro. Pickled tbg w/300 gal 15% HCl acid. Closed pkr bypass. Pressure annulus to 600 psi. Acidized down tbg w/15,000 gal 15% NEFE HCl acid + 3,000 gal gelled brine water. MTP 1,520 psi. Min TP 892 psi. ATP 1,206 psi at AIR 4.6 BPM. Flush w/112 bbls 3% KCl wtr. ISIP 695 psi. 5 min SIP 677 psi. 10 min SIP 646 psi. 15 min SIP 643 psi. Total Load 538 Bbls. SI I hour & RD acid equip. Flow tbg to frac tank at FTP

30 - 50 psi & 140 - 40 BPH. Recover 125 Bbls (TLTBR - 413 bbls.) SIW/SDON.

Day 42, 7/18/2015 - Arrive location. SITP 100 psi. Bled off. Well dead. RU swab. IFL 300'. Made 10 runs total. FFL 1000'. RD swab. Rlse pkr & TOH. LD tbg workstring. Load & remove tbg from location. SIW/SD til Monday.

Day 43, 7/21/2015 - Arrive location. Well dead. Chg out pipe rams to 4.5". Unload & tally 131 jts 4 1/2" 13.5# 8rd LTC poly lined tbg. RU Smith Csg Service. GIH w/7" x 3-1/2" Nickel plated ASTX pkr, on/off tool, profile nipples, & 125 jts 4 1/2" tbg. Set pkr at 5,232'. RIse on/off tool. Circ pkr fluid (+Corr inhibitor & biocide) down csg.. Latch back. Pressure annulus to 500 psi - OK. SIW/SDON. Note: Notified BLM & NMOCD for MIT on Tuesday morning.

Day 44, 7/22/2015 - Arrive location. Attempt MIT - Chart recorder not working. WO another chart recorder. Performed MIT at 500 psi -30 minutes - OK. Witnessed by BLM - Jack Johnson. NMOCD notified but did not witness. RDPU and release all equipment.




WELL SCHEMATIC - CURRENT Brininstool 25 Federal No.1 SWD

API 30-025-37582

1980' FNL & 660' FEL, SEC. 25-T23S-R33E LEA COUNTY, NEW MEXICO Pool: 96802; SWD; Bell Canyon-Cherry Canyon

Spud Date: 1/29/2006 Re-entry Dt: 5/27/2015 TA Date: 2/11/2015 SWD Ready Dt: 7/22/2015

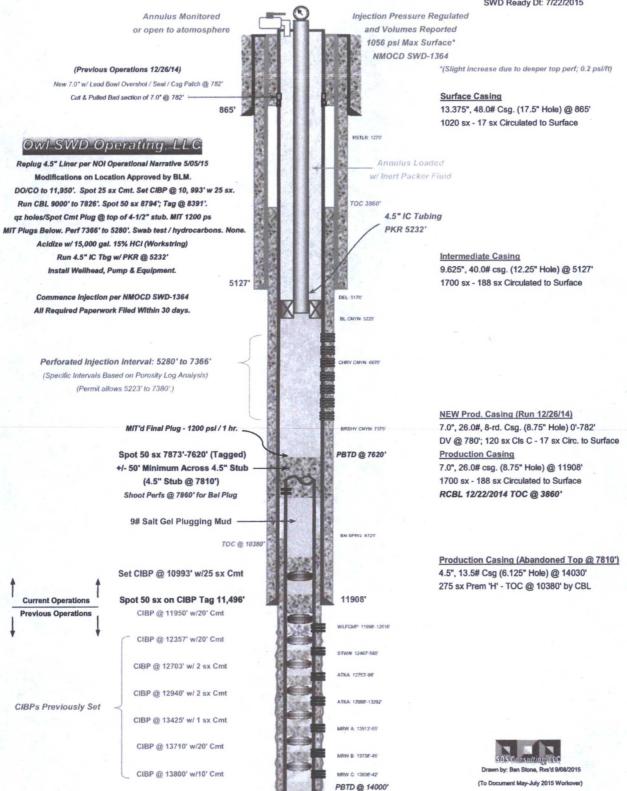

DTD @ 14030'