
Submit I Copy To Appropriate District Office	State of New Mexico	Form C-103
District I - (575) 393-6161	Energy, Minerals and Natural Resourc	Revised July 18, 2013
1625 N. French Dr., Hobbs, NM 88240 <u>District II</u> - (575) 748-1283	acn.	WELL API NO. 30-025-0524
811 S. First St., Artesia, NM 88210	OHOBBEROGION DIVISION	5. Indicate Type of Lease
<u>District III</u> - (505) 334-6178 1000 Rio Brazos Rd., Aztec, NM 87410	1220 South St. Francis Dr.	STATE S FEE
<u>District IV</u> – (505) 476-3460 1220 S. St. Francis Dr., Santa Fe, NM	SESANTE PAINM 87505	6. State Oil & Gas Lease No. E-2504-4
87505 SUNDRY NOTICE	S AND PORCEINED IS	7. Lease Name or Unit Agreement Name
	S TO DRILL OR TO DEEPEN OR PLUG BACK TO A	
	ION FOR PERMIT" (FORM C-101) FOR SUCH	8. Well Number 2
PROPOSALS.)  1. Type of Well: Oil Well   Ga	s Well Other	}
2. Name of Operator		9. OGRID Number 236378
Wishbone Texas Operating Compa	ny LLC /	376256
3. Address of Operator		10. Pool name or Wildcat
10613 W. Sam Houston Pkwy N#	400, Houston, Texas 77064	Denton Devonian
4. Well Location		
Unit LetterH: 2210 feet from the North line and 990 feet from the East line		
Section 2	Township 15S Range	37E NMPM County Lea
	1. Elevation (Show whether DR, RKB, RT, G	R, etc.)
Electric Commercial and the 3	604 GL	Entra Manual Anna Anna Anna Anna Anna Anna Anna An
12 61 1 4	' . D . I !' . M . CM	B . O.I B .
12. Check App	propriate Box to Indicate Nature of No	otice, Report or Other Data
NOTICE OF INTE	NTION TO:	SUBSEQUENT REPORT OF:
	LUG AND ABANDON   REMEDIAL	
		CE DRILLING OPNS. P AND A
PULL OR ALTER CASING M	MULTIPLE COMPL   CASING/CE	EMENT JOB
DOWNHOLE COMMINGLE		
CLOSED-LOOP SYSTEM		
OTHER:	OTHER:	
13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of		
proposed completion or recomp		one completions. Attach welloofe diagram of
proposed completion of recomp		
Please note. This work was performed by the previous Operator from 10/05/07 to 10/09/07. However, it does not appear		
the paperwork was never submitted. I have attached a copy of the daily report with this submission.		
(1) MIRU Pulling Unit. (2) POOH w/ Equipment (3) RI WI TH w/ 5-1/2" CIBP. Set CIBP @ 9090'		
(1) MIRU Pulling Unit. (2) POOH w/ Equipment		
(3) RU WL. TIH w/ 5-1/2" CIBP. Set CIBP @ 9090'		
(4) RU Dump Bailer. Dump 35' on CIBP.		
(5) RD WL. Tested Casing to 560	# for 30 minute	DE 9/16/2011
	AS	. Or
	TAI	3 WELL STATUS Should
	Be Zone Emp on	to be - Evoiced T/A
	PLINSTA	TO DE CAPITACI //V.
Sand Date:	Rig Release Date:	MILE
Spud Date:	Rig Release Date.	1.40
I hereby certify that the information above	ve is true and complete to the best of my kno	wledge and belief.
. nerecy cermy man me meeting e	, , , , , , , , , , , , , , , , , , , ,	
SIGNATURE / Jw m	TITLE Engineering Cons	sultant DATE 09/05/2017
Time or print name Tim Well Time	il addrace: twall@wichhonaan aom BHONE	832-807-2215
Type or print name Tim Wall E-mail address: twall@wishboneep.com PHONE: 832-807-2215  For State Use Only		
For State Use Only  Accepted for Record Only		
APPROVED BY: DATE DATE		
Conditions of Approval (if any):		
The part		

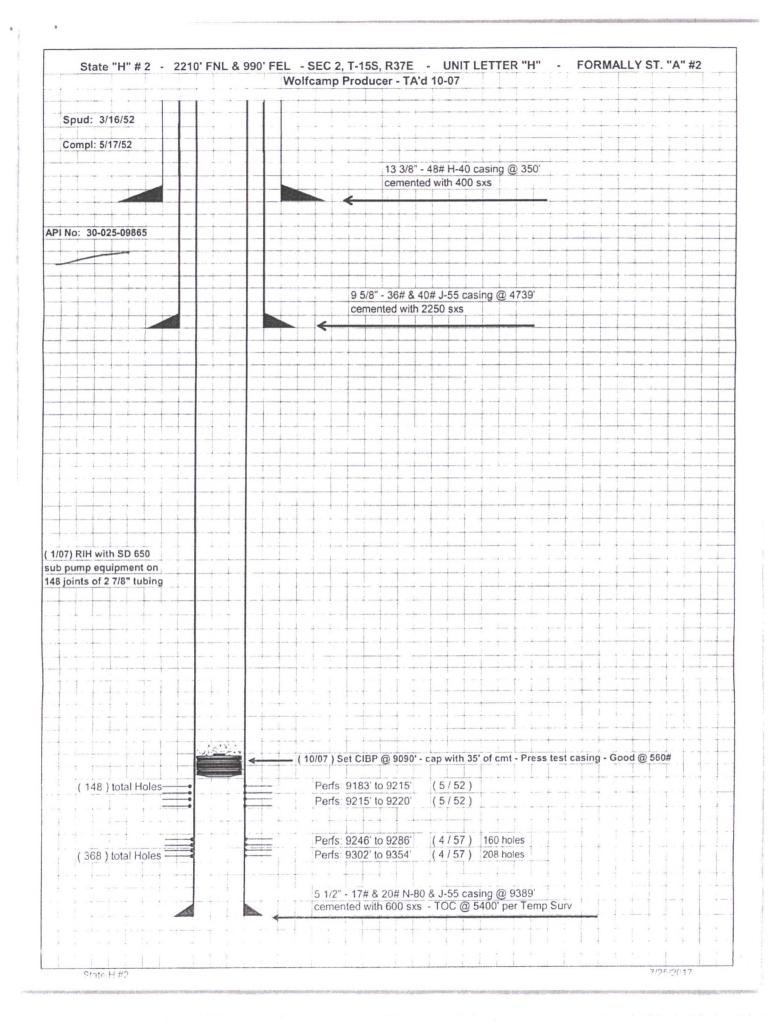

## CELERO ENERGY II, LP Daily Report State H #2 Lea County, NM

## 10/5/07

Day #1. Arrive on location: MIRU Basic Services #1250 PU. Well flowing water. RU Vacuum truck. ND flowlines and master valve. NU BOP. RU SOS Spooler, LD donut Jt. POH with a total of 148 jnts of 2-7/8" 6.5# L80 8rd tbg, 2-7/8" SN, x/o, (1) SD 650 pump – 171 stages, 1 RGS Gas Separator, (2) 66L seals, (1) 40hp/880v/29amp motors rerated to 50hp/952v/34amp, 1 A-well sensor. SI well and SDFWE. NOTES: Send sub pump and switchboard to SOS.

DWC: CWC:

## 10/8/07

Day #2. Arrive on location: RU Rotary Wireline. RIH with a 5-1/2" CIBP, locate collars at 9035', 9067', 9095' & 9126'. Attempt to set CIBP at 9110'. Did not set, POH with setting tool, CIBP had been shot off but did not set. RIH with a 4.375 gauge ring. Tag at 9350', POH with gauge ring. RIH with a 2<sup>nd</sup> CIBP, location collar at 9095'. Set CIBP at 9090'. Immediately well quit flowing water. POH with setting tool. RU dump bailer, RIH and dump 35' cmt on CIBP. RD Rotary Wireline. ND BOP. NU Seaboard WH, RU Key Pump Truck. Pressure casing obtain 30 minutes test at 560 psi. SI well and SDFN.

DWC: \$ CWC: \$

## 10/9/07

Day #3. Arrive on location: RDPU, move off location.

DWC: S CWC: