Form 3160-5 (June 2015)

UNITED STATES DEPARTMENT OF THE INTERIOR **BUREAU OF LAND MANAGEMENT**

FORM APPROVED OMB NO. 1004-0137 Expires: January 31, 2018

Do not use this form for proposals to drill or to re-enter and BBS abandoned well. Use form 3160-3 (APD) for such proposals

į	Leas eas	e s	епаі	NO.
	DIM	NIA.	10/19	264
	PAIN!	IAIA	1240	504

abandoned wei	II. Use form 3160-3 (AP	D) for such proposals.	- 4 4 201	1	in Tribe Name
SUBMIT IN T	TRIPLICATE - Other ins	tructions on page 2 M	AM: LE		ement, Name and/or No.
Type of Well	ner	R	ECEIV	Well Name and No. EL ZORRO FREM	MONT FEDERAL 01
Name of Operator EOG Y RESOURCES INC		JEREMY HAASS ass@eogresources.com		9. API Well No. 30-025-33147-00-S1	
3a. Address 104 SOUTH 4TH STREET ARTESIA, NM 88210	3b. Phone No. (include area code) Ph: 575-748-4311		10. Field and Pool or Exploratory Area ALLISON		
4. Location of Well (Footage, Sec., T			11. County or Parish, State		
Sec 1 T9S R36E SENE 2080F	FNL 510FEL			LEA COUNTY,	NM
12. CHECK THE AI	PROPRIATE BOX(ES)	TO INDICATE NATURE	OF NOTICE,	REPORT, OR OTI	HER DATA
TYPE OF SUBMISSION	TYPE OF ACTION				
Notice of Intent ☐ Subsequent Report	☐ Acidize	Deepen	☐ Product	ion (Start/Resume)	☐ Water Shut-Off
	☐ Alter Casing	☐ Hydraulic Fracturing	g 🗖 Reclama	☐ Reclamation ☐ Well	
	☐ Casing Repair	□ New Construction	☐ Recomp	☐ Recomplete ☐ Oth	
☐ Final Abandonment Notice	☐ Change Plans	📐 🛭 Plug and Abandon	☐ Tempor	arily Abandon	
	☐ Convert to Injection	☐ Plug Back	☐ Water D	☐ Water Disposal	
13. Describe Proposed or Completed Op If the proposal is to deepen directions Attach the Bond under which the wor following completion of the involved testing has been completed. Final At determined that the site is ready for fi	ally or recomplete horizontally, rk will be performed or provide operations. If the operation re bandonment Notices must be fil	give subsurface locations and means the Bond No. on file with BLM/B sults in a multiple completion or re-	sured and true ve IA. Required sub ecompletion in a r	rtical depths of all perting sequent reports must be new interval, a Form 316	nent markers and zones. c filed within 30 days 50-4 must be filed once
1. JSA 2. MIRU WOR 3. NU Rod BOP 4. TOOH w/ Rod String and poly 5. ND Tree/NU BOPs. 6. POOH with tubing			ATTACHE D I DITIONS OF		
7. Run Casing scraper, Gauge	e ring with Junk Basket to	top perf			
Plug from Bottom to Top:					
? Set CIBP at 12288 ft with 35 hole and Woodford.	SX of CLS H on top to 1	2052. WOC and Tag. This v	vill plug the op	en .	

14. I hereby certify that the foregoing is true and correct.

Electronic Submission #454055 verified by the BLM Well Information System
For EOG Y RESOURCES INC, sent to the Hobbs
Committed to AFMSS for processing by DEBORAH MCKINNEY on 02/12/2019 (19DLM0249SE) Name (Printed/Typed) JEREMY HAASS Title REGULATORY SPECIALIST

02/11/2019 (Electronic Submission) Signature

THIS SPACE FOR FEDERAL OR STATE OFFICE USE

Date Title Approved By

Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon.

Office

Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

** BLM REVISED ** BLM REVISED ** BLM REVISED ** BLM REVISED **

For secord only K7 NMOCD 3-22-19

Additional data for EC transaction #454055 that would not fit on the form

32. Additional remarks, continued

11352

? Spot a 87 SX (686 ft) CLS H cement plug 41474 - 11924 ft. WOC & Tag Plug. This will plug the Mississippian, Morrow, & Atoka.
? Spot a 25 SX (213 ft) CLS H cement plug 9437 ft - 9650 ft. WOC & Tag Plug. This will plug the

Bouah "C"

? Spot a 25 SX (213 ft) CLS H cement plug 8767 ft - 8980 ft. WOC & Tag Plug. This will plug the Wolfcamp.

? Spot a 25 SX (213 ft) CLS H cement plug 7507 ft - 7720 ft. WOC & Tag Plug. This will plug the

Abo.
? Perforate at 4237 ft. Attempt to establish Circulation. Spot a 72 SX (253 ft) CLS C cement plug 3984 ft - 4237 ft. WOC & Tag Plug. This will plug the 8.625 inch casing shoe and San Anders.
? Spot a 35 SX (122 ft) CLS C cement plug 2148 ft - 2270 ft. WOC & Tag Plug. This will plug the Anhydrite. ? Spot a 10 SX (35 ft) CLS C cement plug 0 ft - 35 ft. WOC & Tag Plug. This will plug the Top.


8. RDMO Workover Rig


9. PXA Marker

9.1. Cut off wellhead and weld on dry hole marker. Clean location as per regulation.

Records show 5/2 eirc. Perf(?)

Spoil 25 SX plag

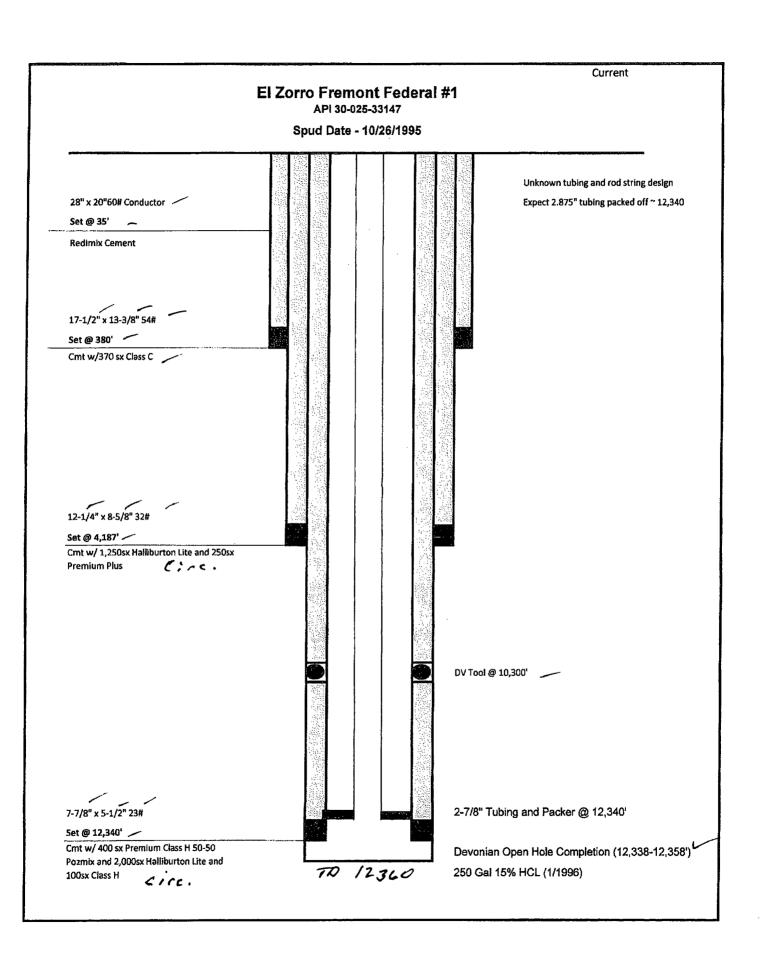

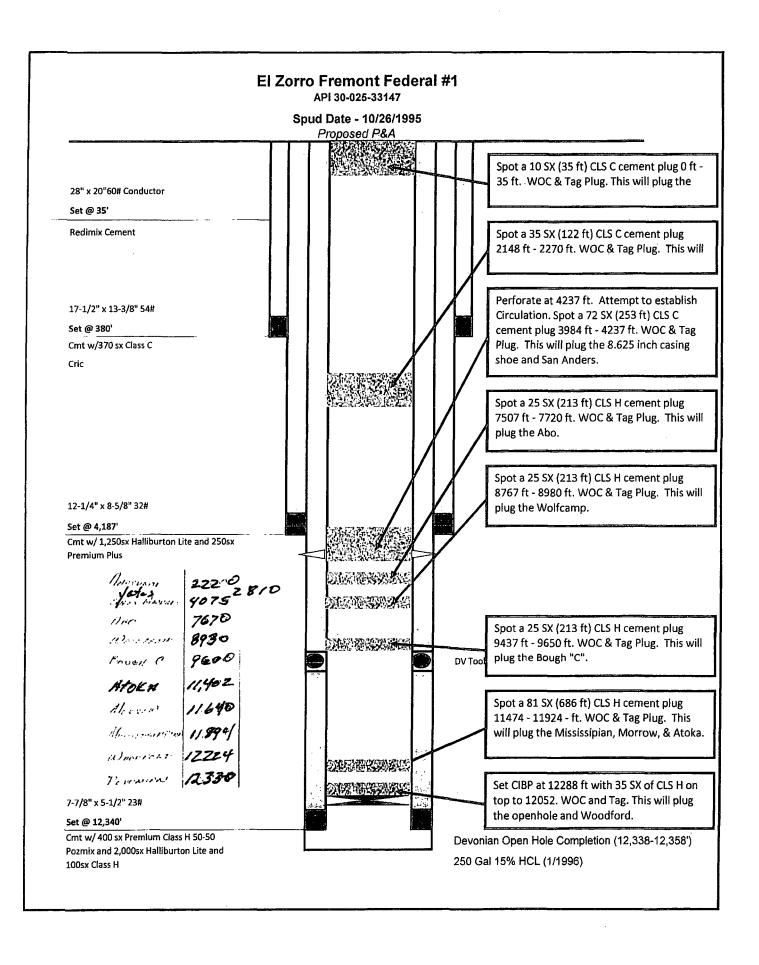

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval (LPC Habitat)

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

- 2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.
- 3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of **brine** water. Minimum nine (9) pounds per gallon.
- 5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. Below Ground Level Cap (Lesser Prairie-Chicken Habitat): All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off. Upon the plugging and subsequent abandonment of wells that are located in lesser prairie-chicken habitat, the casings shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The well bore shall then be covered with a metal plate at least ¼ inch thick and welded in place. A weep hole shall be left in the plate and/or casing.

NMOCD also requires the operator to notify NMOCD when this type of dry hole marker is used. This can be done on the subsequent report of abandonment which is submitted to the BLM after the well is plugged. State that a below ground cap was installed as required in the COA's from the BLM.

- 7. <u>Subsequent Plugging Reporting:</u> Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date well was plugged.**
- 8. <u>Trash</u>: All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.

<u>Timing Limitation Stipulation/ Condition of Approval for Lesser Prairie-Chicken:</u>
From March 1st through June 15th annually, abandonment activities will be allowed except between the hours from 3:00 am and 9:00 am. Normal vehicle use on existing roads will not be restricted