
Submit 1 Copy To Appropriate District State of New Mexico	Form C-103
Office France Minarals and Natural Passaurass	Revised August 1, 2011
District I – (575) 393-6161 Energy, Witherars and Natural Resources 1625 N. French Dr., Hobbs, NM 88240	WELL API NO.
District II - (575) 748-1283	
811 S. First St., Artesia, NM 88210  District III – (505) 334-6178  1220 South St. Francis Dro	30-025-24762
1000 Rio Brazos Rd., Aztec, NM 87410 District IV - (505) 476-3460 Santa Fe, NM, 87, 95	5. Indicate Type of Lease
District IV - (505) 476-3460 1220 S. St. Francis Dr., Santa Fe, NM	STATE X FEE
SUNDRY NOTICES AND REPORTS ON WELL BOOK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH	6. State Oil & Gas Lease No.
SUNDRY NOTICES AND REPORTS ON WELL	7. Lease Name or Unit Agreement Name
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A	3
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	State BK
1. Type of Well: Oil Well Gas Well Other	8. Well Number 001
2. Name of Operator	9. OGRID Number
J&J Services, Inc.	11095
3. Address of Operator	10. Pool name or Wildcat
PO Box 324, Lovington, NM 88260	Tres Papalotes
4. Well Location	010 Cat Care the Part No.
Unit Letter P 660 feet from the South line and	810 feet from the East line
Section 29 Township 14S Range 34E	NMPM Lea County
11. Elevation (Show whether DR, RKB, RT, GR, etc.	
	······································
12. Check Appropriate Box to Indicate Nature of Notice	Report or Other Data
1 - 20	report of other Dam
	SSEQUENT REPORT OF:
PERFORM REMEDIAL WORK PLUG AND ABANDON X REMEDIAL WOR	<u>=</u>
	ILLING OPNS. P AND A
PULL OR ALTER CASING	IT JOB 📙
DOWNHOLE COMMINGLE	
OTHER: OTHER:	
13. Describe proposed or completed operations. (Clearly state all pertinent details, at	
of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of	
proposed completion or recompletion.	empletions: Attach wellbore diagram of
	empletions: Attach wellbore diagram of
	empletions: Attach wellbore diagram of
proposed completion or recompletion.	empletions: Attach wellbore diagram of
	empletions: Attach wellbore diagram of
proposed completion or recompletion.	empletions: Attach wellbore diagram of
proposed completion or recompletion.	empletions: Attach wellbore diagram of
proposed completion or recompletion.	mpletions: Attach wellbore diagram of
proposed completion or recompletion.  SEE ATTACHED	Conditions of Approval
proposed completion or recompletion.	Conditions of Approval
SEE ATTACHED  I hereby certify that the information above is true and complete to the best of my knowled.	Conditions of Approval
proposed completion or recompletion.  SEE ATTACHED	Conditions of Approval
SEE ATTACHED  I hereby certify that the information above is true and complete to the best of my knowled SIGNATURE  TITLE  Agent	Conditions of Attached of Approval  ge and belief.  DATE8/5/2019
SEE ATTACHED  I hereby certify that the information above is true and complete to the best of my knowled.  SIGNATURE	Conditions of Attach wellbore diagram of  Conditions of Approval  ge and belief.  DATE8/5/2019
SEE ATTACHED  I hereby certify that the information above is true and complete to the best of my knowled.  SIGNATURE	Conditions of Attach wellbore diagram of  Conditions of Approval  ge and belief.  DATE8/5/2019  Eyashoo.com PHONE:575-760-2484
SEE ATTACHED  I hereby certify that the information above is true and complete to the best of my knowled.  SIGNATURE	Conditions of Attached of Approval  ge and belief.  DATE8/5/2019

J&J Services Inc State BK #1 30-025-24762 UL – P, Sec 28, T14S, R34E 660' FSL & 810' FEL

13 3/8" 48# csg @ 377' w/ 360 sx 9 5/8" 36 & 40 # csg @ 4505' w/ 400 sx 5 ½" 17# csg @ 10,535' w/ 300 sx Perfs 10,428' – 10,435' TD 10,535' PBTD 10,504'

- 1. Set CIBP at 10,328'.
- 2. Circulate mud laden fluid. Pressure test casing to 500 psi.\*
- 3. Spot 25 sx cmt on CIBP.
- 4. Spot 25 sx cmt 7328'. Spacer Plug.
- 5. Perf at 4555'. Sqz w/ 35 sx cmt. WOC & Tag. Shoe Plug.
- 6. Perf at 2850'. Sqz w/ 65 sx cmt. WOC & Tag. Base Salt Plug.
- 7. Perf at 1850'. Sqz w/ 65 sx cmt. WOC & Tag. Top Salt Plug.
- 8. Perf at 427'. Pump sufficient Class C cmt to circulate cmt to surface. (Fill 13 3/8" x 9 5/8" annulus, 9 5/8" x 5 ½"annulus, and 5 ½" csg) Surface Shoe Plug.
- 9. Cut off wellhead 3' below ground level. Verify cement to surface all strings. Install dry hole marker.
- If casing does not test, notify OCD.

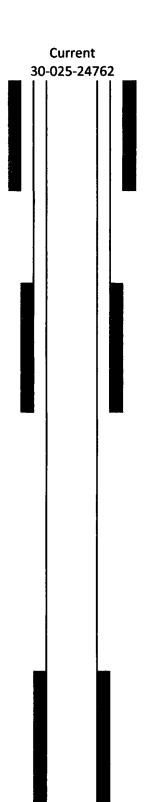

13 3/8" 48# csg @ 377' w/ 360 sx (circ) Drill out with 12" bit

9 5/8" 36 & 40# csg @ 4505' w/ 400 sx Drill out with 7 7/8" bit CTOC 3000'


Rustler	1843'
Yates	2920'
Queen	3713'
San Andres	4485'
Abo	8120'
Wolfcamp	9715'

Perfs 10,428' - 10,435' (KB 12')

5 1/2" 17# csg @ 10,535' w/300 sx

PBTD 10,504' TD 10,535'

## J and J Service Inc State BK No. 1

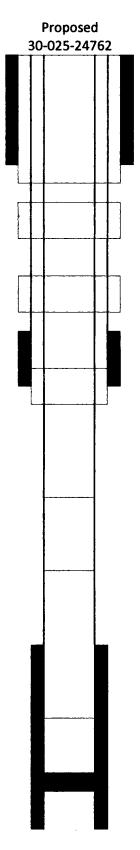

**INSTALL P&A MARKER CUT OFF WELLHEAD & VERIFY CEMENT** PUMP SUFFICIENT CMT TO CIRCULATE TO **SURFACE OUT ALL STRINGS** PERF AT 427' (SHOE PLUG)

13 3/8" 48# csg @ 377' w/ 360 sx (circ) Drill out with 12" bit

> **WOC & TAG SQUEEZE WITH 65 SX CLASS C CMT** PERF AT 1850' (TOP SALT PLUG) **WOC & TAG SQUEEZE WITH 65 SX CLASS C CMT** PERF AT 2850' (BASE SALT PLUG) **WOC & TAG SQUEEZE WITH 35 SX CLASS C CMT** PERF AT 4555' (SHOE PLUG)

9 5/8" 36 & 40# csg @ 4505' w/ 400 sx Drill out with 7 7/8" bit CTOC 3000'

SPOT 25 SX AT 7328' (SPACER PLUG)

**SPOT 25 SX CLASS H CMT ON CIBP PRESSURE TEST CASING CIRC HOLE WITH MLF** 

Perfs 10,428' - 10,435' (KB 12') SET CIBP @ 10,328'

5 1/2" 17# csg @ 10,535' w/300 sx

PBTD 10,504' TD 10,535'

## **GENERAL CONDITIONS OF APPROVAL:**

- 1) Insure all bradenheads have been exposed, identified, and valves are operational prior to rigging up on well.
- 2) Contact the appropriate NMOCD District Office no later than 24 hours prior to moving in and rigging up.
- 3) A copy of the approved C103 intent to P&A should be distributed to the onsite company and plugging representatives. <u>Approved procedures are good for a period of one year from approved date, unless otherwise specified on the C103 intent</u>. Approvals past this date will require the submission and approval of a new C103 intent.
- 4) A company representative is required to be present to witness all operations including setting CIBP's, circulation of mud laden fluids, perforating, squeezing or spotting cement plugs, tags, or any other operations approved on the C103 intent to P&A. Company representative should contact the NMOCD and report all operations.
- 5) Any changes that may be required during plugging operations should be approved by the NMOCD before proceeding.
- 6) A closed loop system is to be used for all plugging operations. Contents of the steel pits to be hauled to a NMOCD permitted disposal facility.
- 7) Mud laden fluids must be placed between all cement plugs mixed at 25 sacks of salt gel per 100 barrels of brine.
- 8) All cement plugs will be 100' or 25 sacks cement, whichever is greater. Class 'C' cement will be used above 7500' and Class 'H' below 7500'. Plugs should be no more than 3000' apart
- 9) Site remediation due within one year of well plugging completion.