Office	AM State of New Mexico	Form C-103 ^{1 of 8}
District I – (575) 393-6161	Energy, Minerals and Natural Resourc	es Revised July 18, 2013
1625 N. French Dr., Hobbs, NM 88240		WELL API NO. 20 015 10907
<u>District II</u> – (575) 748-1283 811 S. First St., Artesia, NM 88210	OIL CONSERVATION DIVISION	30-015-10807 5. Indicate Type of Lease
<u>District III</u> – (505) 334-6178 1000 Rio Brazos Rd., Aztec, NM 87410	1220 South St. Francis Dr.	STATE STATE
District IV - (505) 476-3460	Santa Fe, NM 87505	6. State Oil & Gas Lease No.
1220 S. St. Francis Dr., Santa Fe, NM 87505		
	CES AND REPORTS ON WELLS	7. Lease Name or Unit Agreement Name
	ALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A ATION FOR PERMIT" (FORM C-101) FOR SUCH	
PROPOSALS.)		GJ WEST COOP UNIT 8. Well Number
1. Type of Well: Oil Well 2. Name of Operator	Gas Well 🛛 Other	9. OGRID Number 29
SPUR E	NERGY PARTNERS LLC	328947
3. Address of Operator		10. Pool name or Wildcat
	7, SUITE 500, HOUSTON, TX 77024	GJ; 7RVS-QN-GB-GLORIETA-YESO
4. Well Location		
Unit Letteri:_		nd <u>660</u> feet from the <u>EAST</u> line
Section 21	Township 17S Range 29E 11. Elevation (Show whether DR, RKB, RT, G	NMPM EDDY County
	3550' GR	K , <i>etc.</i>)
12. Check A	ppropriate Box to Indicate Nature of No.	otice, Report or Other Data
NOTICE OF IN		SUBSEQUENT REPORT OF:
	PLUG AND ABANDON 🕅 REMEDIAL	
	~	CE DRILLING OPNS. P AND A
PULL OR ALTER CASING	MULTIPLE COMPL CASING/C	
		Notify OCD 24 hrs. prior to any work
CLOSED-LOOP SYSTEM	□ OTHER:	done
13. Describe proposed or compl	eted operations. (Clearly state all pertinent deta	ils, and give pertinent dates, including estimated date
	rk). SEE RULE 19.15.7.14 NMAC. For Multip	ple Completions: Attach wellbore diagram of
proposed completion or reco	Run CBL to surface.	
Poviced D&A precedu		
Revised P&A procedu	re below:	existing plug @ 2455' - WOC & tag
	re below.	
1. Set 4-1/2" CIBP @ 2. Perf at 1769' and so	re below: 2200' 2 15 3'. Pressure test csg. Spot 25 sx of cn Iz 35 sx of cmt from 1769'-1669'. WOC &	nt from 2153'-2053'. Circ MLF <mark>Bubble test casing</mark> Tag. (T/Queen)
1. Set 4-1/2" CIBP @ 2. Perf at 1769' and so 3. Perf at 1366' and so	re below: 2200' 2 153 '. Pressure test csg. Spot 25 sx of cm pz 35 sx of cmt from 1769'-1669'. WOC & pz 35 sx of cmt from 1316' to 1216'. (TOC	nt from 2153'-2053'. Circ MLF <mark>Bubble test casing</mark> Tag. (T/Queen) behind 4-1/2")
1. Set 4-1/2" CIBP @ 2. Perf at 1769' and so 3. Perf at 1366' and so 4. Perf at 886' and so	re below: 2200' 2153'. Pressure test csg. Spot 25 sx of cm 1z 35 sx of cmt from 1769'-1669'. WOC & 1z 35 sx of cmt from 1316' to 1216'. (TOC 35 sx of cmt from 886'-786'. WOC & Tag	nt from 2153'-2053'. Circ MLF <mark>Bubble test casing</mark> Tag. (T/Queen) behind 4-1/2") g. (T/Yates)
1. Set 4-1/2" CIBP @ 2. Perf at 1769' and so 3. Perf at 1366' and so 4. Perf at 886' and so 5. Perf at 412' and so	Dump bail 35' cmt on 2200' 2453'. Pressure test csg. Spot 25 sx of cm Iz 35 sx of cmt from 1769'-1669'. WOC & Iz 35 sx of cmt from 1316' to 1216'. (TOC Iz 35 sx of cmt from 886'-786'. WOC & Tag Iz 30 sx of cmt from 412' to 312'. (8-5/8" SI	nt from 2153'-2053'. Circ MLF (<mark>Bubble test casing)</mark> Tag. (T/Queen) behind 4-1/2") g. (T/Yates)
1. Set 4-1/2" CIBP @ 2. Perf at 1769' and so 3. Perf at 1366' and so 4. Perf at 886' and so 5. Perf at 412' and so 6 . Perf at 100' and so	re below: 2200' 2153'. Pressure test csg. Spot 25 sx of cm 1z 35 sx of cmt from 1769'-1669'. WOC & 1z 35 sx of cmt from 1316' to 1216'. (TOC 35 sx of cmt from 886'-786'. WOC & Tag	nt from 2153'-2053'. Circ MLF Bubble test casing Tag. (T/Queen) behind 4-1/2") g. (T/Yates) noe) Cement to surface inside & out
1. Set 4-1/2" CIBP @ 2. Perf at 1769' and so 3. Perf at 1366' and so 4. Perf at 886' and so 5. Perf at 412' and so 6 . Perf at 100' and so	Image: Pressure test csg. Dump bail 35' cmt on 2200' 2153'. Pressure test csg. Spot 25 sx of cm 12 35 sx of cmt from 1769'-1669'. WOC & 1216'. (TOC & 1315' to 1216'. (TOC & 35 sx of cmt from 886'-786'. 13 35 sx of cmt from 412' to 312'. (8-5/8" State to 312'. (8-5/8" State to 50 sx of omt from 100' to surface.	nt from 2153'-2053'. Circ MLF Bubble test casing Tag. (T/Queen) behind 4-1/2") g. (T/Yates) noe) Cement to surface inside & out
1. Set 4-1/2" CIBP @ 2. Perf at 1769' and so 3. Perf at 1366' and so 4. Perf at 886' and so 5. Perf at 412' and so 6 . Perf at 100' and so 7. Verify cmt to surfact	Image: Pressure test csg. Dump bail 35' cmt on 2200' 2153'. Pressure test csg. Spot 25 sx of cm 12 35 sx of cmt from 1769'-1669'. WOC & 1216'. (TOC & 1315' to 1216'. (TOC & 35 sx of cmt from 886'-786'. 13 35 sx of cmt from 412' to 312'. (8-5/8" State to 312'. (8-5/8" State to 50 sx of omt from 100' to surface.	nt from 2153'-2053'. Circ MLF Bubble test casing Tag. (T/Queen) behind 4-1/2") g. (T/Yates) noe) Cement to surface inside & out
1. Set 4-1/2" CIBP @ 2. Perf at 1769' and so 3. Perf at 1366' and so 4. Perf at 886' and so 5. Perf at 412' and so 6 . Perf at 100' and so 7. Verify cmt to surfact	Dump bail 35' cmt on 2000' 2153'. Pressure test csg. Spot 25 sx of cmt iz 35 sx of cmt from 1769'-1669'. WOC & iz 35 sx of cmt from 1316' to 1216'. (TOC 35 sx of cmt from 886'-786'. WOC & Tag 30 sx of cmt from 412' to 312'. (8-5/8" St 50 ox of cmt from 100' to ourface. e, cutoff well head, weld on dry hole mark	nt from 2153'-2053'. Circ MLF Bubble test casing Tag. (T/Queen) behind 4-1/2") g. (T/Yates) noe) Cement to surface inside & out
1. Set 4-1/2" CIBP @ 2. Perf at 1769' and so 3. Perf at 1366' and so 4. Perf at 886' and so 5. Perf at 412' and so 6 . Perf at 100' and so 7 . Verify cmt to surfact Bubble test cas	Dump bail 35' cmt on 200' 2153'. Pressure test csg. Spot 25 sx of cm 1769'-1669'. WOC & 1735 sx of cmt from 1316' to 1216'. (TOC 35 sx of cmt from 886'-786'. WOC & Tag 30 sx of cmt from 412' to 312'. (8-5/8" St 50 ox of cmt from 100' to ourface. e, cutoff well head, weld on dry hole mark	nt from 2153'-2053'. Circ MLF Bubble test casing Tag. (T/Queen) behind 4-1/2") g. (T/Yates) noe) Cement to surface inside & out
1. Set 4-1/2" CIBP @2. Perf at 1769' and so3. Perf at 1366' and so4. Perf at 886' and so5. Perf at 412' and so6. Perf at 100' and ogz7. Verify cmt to surfaceBubble test casSpud Date:05/08/1966	Dump bail 35' cmt on 2200' 2153'. Pressure test csg. Spot 25 sx of cmt from 1769'-1669'. WOC & la 235 sx of cmt from 1316' to 1216'. (TOC 35 sx of cmt from 886'-786'. WOC & Tage 30 sx of cmt from 412' to 312'. (8-5/8" Step 30 sx of cmt from 100' to surface. 230 sx of cmt from 412' to 312'. (8-5/8" Step 30 sx of cmt from 100' to surface. 2453 state 254 state 254 state 254 state 254 state 254 state 254 state 255 state 254 state 255 state 256 state 257 state 258 state 259 state 250 state 251 state 252 state 254 state 255 state 255 state 256 state 257 state 258 state <td< td=""><td>nt from 2153'-2053'. Circ MLF Bubble test casing Tag. (T/Queen) behind 4-1/2") g. (T/Yates) noe) Cement to surface inside & out rer.</td></td<>	nt from 2153'-2053'. Circ MLF Bubble test casing Tag. (T/Queen) behind 4-1/2") g. (T/Yates) noe) Cement to surface inside & out rer.
1. Set 4-1/2" CIBP @ 2. Perf at 1769' and so 3. Perf at 1366' and so 4. Perf at 886' and so 5. Perf at 412' and so 6 . Perf at 100' and so 7 . Verify cmt to surfact Bubble test cas Spud Date: 05/08/1966	Dump bail 35' cmt on 2200' 2453'. Pressure test csg. Spot 25 sx of cmt from 1769'-1669'. WOC & grass of cmt from 1316' to 1216'. (TOC ar 35 sx of cmt from 886'-786'. WOC & Tage and sx of cmt from 412' to 312'. (8-5/8" Stepse of smt from 100' to surface. a 30 sx of cmt from 130' to 312'. (8-5/8" Stepse of smt from 100' to surface. b a construction of the surface of the surface. c a construction of the surface of the surface. c a construction of the surface. c a construction of the surface of the surface. c a construction of the surface of the surface. c a construction of the surface of the surface of the surface. c a construction of the surface of	nt from 2153'-2053'. Circ MLF Bubble test casing Tag. (T/Queen) behind 4-1/2") g. (T/Yates) noe) Cement to surface inside & out cer.
1. Set 4-1/2" CIBP @ 2. Perf at 1769' and so 3. Perf at 1366' and so 4. Perf at 886' and so 5. Perf at 412' and so 6 . Perf at 100' and so 7 . Verify cmt to surfact Bubble test cas Spud Date: 05/08/1966	Dump bail 35' cmt on 2200' 2153'. Pressure test csg. Spot 25 sx of cmt from 1769'-1669'. WOC & la 235 sx of cmt from 1316' to 1216'. (TOC 35 sx of cmt from 886'-786'. WOC & Tage 30 sx of cmt from 412' to 312'. (8-5/8" Step 30 sx of cmt from 100' to surface. 230 sx of cmt from 412' to 312'. (8-5/8" Step 30 sx of cmt from 100' to surface. 2453 state 254 state 254 state 254 state 254 state 254 state 254 state 255 state 254 state 255 state 256 state 257 state 258 state 259 state 250 state 251 state 252 state 254 state 255 state 255 state 256 state 257 state 258 state <td< td=""><td>nt from 2153'-2053'. Circ MLF Bubble test casing Tag. (T/Queen) behind 4-1/2") g. (T/Yates) noe) Cement to surface inside & out cer.</td></td<>	nt from 2153'-2053'. Circ MLF Bubble test casing Tag. (T/Queen) behind 4-1/2") g. (T/Yates) noe) Cement to surface inside & out cer.
1. Set 4-1/2" CIBP @ 2. Perf at 1769' and so 3. Perf at 1366' and so 4. Perf at 886' and so 5. Perf at 412' and so 6. Perf at 100' and equ 7. Verify cmt to surfact Bubble test cas Spud Date: 05/08/1966 ****SEE ATTACHED CO/ I hereby certify that the information a	Image: Pressure test csg. Dump bail 35' cmt on 2200' 2453'. Pressure test csg. Spot 25 sx of cmt grom 1769'-1669'. WOC & 32 35 sx of cmt from 1316' to 1216'. (TOC & 35 sx of cmt from 886'-786'. WOC & Tage 30 sx of cmt from 412' to 312'. (8-5/8" Stepson structure from 100' to curface. e, cutoff well head, weld on dry hole mark ing after perforating and cementing Rig Release Date: Ns**** Must be above is true and complete to the best of my known	nt from 2153'-2053'. Circ MLF Bubble test casing Tag. (T/Queen) behind 4-1/2") g. (T/Yates) noe) Cement to surface inside & out ter.
1. Set 4-1/2" CIBP @ 2. Perf at 1769' and so 3. Perf at 1366' and so 4. Perf at 886' and so 5. Perf at 412' and so 6 . Perf at 100' and so 7 . Verify cmt to surfact Bubble test cas Spud Date: 05/08/1966	Image: Pressure test csg. Dump bail 35' cmt on 2200' 2453'. Pressure test csg. Spot 25 sx of cmt grom 1769'-1669'. WOC & 32 35 sx of cmt from 1316' to 1216'. (TOC & 35 sx of cmt from 886'-786'. WOC & Tage 30 sx of cmt from 412' to 312'. (8-5/8" Stepson structure from 100' to curface. e, cutoff well head, weld on dry hole mark ing after perforating and cementing Rig Release Date: Ns**** Must be above is true and complete to the best of my known	nt from 2153'-2053'. Circ MLF Bubble test casing Tag. (T/Queen) behind 4-1/2") g. (T/Yates) noe) Cement to surface inside & out ter.
1. Set 4-1/2" CIBP @. 2. Perf at 1769' and so 3. Perf at 1366' and so 4. Perf at 886' and so 5. Perf at 412' and so 6. Perf at 412' and so 7. Verify cmt to surface Bubble test cas Spud Date: 05/08/1966 ****SEE ATTACHED CO/ I hereby certify that the information at signature	Image: Pressure test csg. Dump bail 35' cmt on 2200' 2453'. Pressure test csg. Spot 25 sx of cmt grom 1769'-1669'. WOC & 32 35 sx of cmt from 1316' to 1216'. (TOC 2: 35 sx of cmt from 486'-786'. WOC & Tage 2: 30 sx of cmt from 412' to 312'. (8-5/8" Strends of structure from 100' to surface. 2: 30 sx of cmt from 412' to 312'. (8-5/8" Strends of structure from 100' to surface. 2: 50 sx of cmt from 400' to surface. 2: 50 sx of cmt from 100' to surface. 2: 50 sx of cmt from 100' to surface. 2: 50 sx of cmt from 100' to surface. 2: 50 sx of cmt from 100' to surface. 2: 50 sx of cmt from 100' to surface. 2: 50 sx of cmt from 100' to surface. 2: 50 sx of cmt from 100' to surface. 2: 6, cutoff well head, weld on dry hole mark Ing after perforating and cementing Must be subove is true and complete to the best of my known TITLE REGULATORY I	nt from 2153'-2053'. Circ MLF Bubble test casing Tag. (T/Queen) behind 4-1/2") g. (T/Yates) noe) Cement to surface inside & out ter. plugged by 5/2/2023 owledge and belief. DIRECTOR DATE 04/28/2022
1. Set 4-1/2" CIBP @ 2. Perf at 1769' and so 3. Perf at 1366' and so 4. Perf at 886' and so 5. Perf at 412' and so 6. Perf at 100' and equ 7. Verify cmt to surfact Bubble test cas Spud Date: 05/08/1966 ****SEE ATTACHED CO/ I hereby certify that the information a	Image: Pressure test csg. Dump bail 35' cmt on 2200' 2453'. Pressure test csg. Spot 25 sx of cmt grom 1769'-1669'. WOC & 32 35 sx of cmt from 1316' to 1216'. (TOC 2: 35 sx of cmt from 486'-786'. WOC & Tage 2: 30 sx of cmt from 412' to 312'. (8-5/8" Strends of structure from 100' to surface. 2: 30 sx of cmt from 412' to 312'. (8-5/8" Strends of structure from 100' to surface. 2: 50 sx of cmt from 400' to surface. 2: 50 sx of cmt from 100' to surface. 2: 50 sx of cmt from 100' to surface. 2: 50 sx of cmt from 100' to surface. 2: 50 sx of cmt from 100' to surface. 2: 50 sx of cmt from 100' to surface. 2: 50 sx of cmt from 100' to surface. 2: 50 sx of cmt from 100' to surface. 2: 6, cutoff well head, weld on dry hole mark Ing after perforating and cementing Must be subove is true and complete to the best of my known TITLE REGULATORY I	nt from 2153'-2053'. Circ MLF Bubble test casing Tag. (T/Queen) behind 4-1/2") g. (T/Yates) noe) Cement to surface inside & out ter.
1. Set 4-1/2" CIBP @ 2. Perf at 1769' and so 3. Perf at 1366' and so 4. Perf at 886' and so 5. Perf at 412' and so 6. Perf at 100' and equ 7. Verify cmt to surface Bubble test cas Spud Date: 05/08/1966 ****SEE ATTACHED CO/ I hereby certify that the information and SIGNATURE Sarah Char Type or print name SARAH CHAR For State Use Only	Dump bail 35' cmt on 2200' 2453'. Pressure test csg. Spot 25 sx of cmt iz 35 sx of cmt from 1769'-1669'. WOC & iz 35 sx of cmt from 1316' to 1216'. (TOC 35 sx of cmt from 886'-786'. WOC & Tag 30 sx of cmt from 412' to 312'. (8-5/8" St 50 ox of omt from 100' to ourface. e, cutoff well head, weld on dry hole mark ing after perforating and cementing Rig Release Date: Ns**** Must be above is true and complete to the best of my known PMAN E-mail address: SCHAPMAN	nt from 2153'-2053'. Circ MLF Bubble test casing Tag. (T/Queen) behind 4-1/2") g. (T/Yates) noe) Cement to surface inside & out ter. plugged by 5/2/2023 owledge and belief. DIRECTOR DATE 04/28/2022 @SPURENERGY.COM PHONE: 832-930-8613
1. Set 4-1/2" CIBP @ 2. Perf at 1769' and so 3. Perf at 1366' and so 4. Perf at 886' and so 5. Perf at 412' and so 6. Perf at 100' and ogz 7. Verify cmt to surface Bubble test cas Spud Date: 05/08/1966 ****SEE ATTACHED CO/ I hereby certify that the information a SIGNATURE SARAH CHAR	Dump bail 35' cmt on 2200' 2453'. Pressure test csg. Spot 25 sx of cmt iz 35 sx of cmt from 1769'-1669'. WOC & iz 35 sx of cmt from 1316' to 1216'. (TOC 35 sx of cmt from 886'-786'. WOC & Tag 30 sx of cmt from 412' to 312'. (8-5/8" St 50 ox of omt from 100' to ourface. e, cutoff well head, weld on dry hole mark ing after perforating and cementing Rig Release Date: Ns**** Must be above is true and complete to the best of my known PMAN E-mail address: SCHAPMAN	nt from 2153'-2053'. Circ MLF Bubble test casing Tag. (T/Queen) behind 4-1/2") g. (T/Yates) noe) Cement to surface inside & out ter. plugged by 5/2/2023 owledge and belief. DIRECTOR DATE 04/28/2022

Released	to	Imaging:	5/13/2022	12:50:08 PM
nereusen	w	11118118.		

CONDITIONS FOR PLUGGING AND ABANDONMENT

OCD - Southern District

The following is a guide or checklist in preparation of a plugging program, this is not all inclusive and care must be exercised in establishing special plugging programs in unique and unusual cases, Notify NMOCD District Office II at (575)-748-1283 at least 24 hours before beginning work. After MIRU rig will remain on well until it is plugged to surface. OCD is to be notified before rig down. Company representative will be on location during plugging procedures.

- 1. A notice of intent to plug and abandon a wellbore is required to be approved before plugging operations are conducted. A cement evaluation tool is required in order to ensure isolation of producing formations, protection of water and correlative rights. A cement bond log or other accepted cement evaluation tool is to be provided to the division for evaluation if one has not been previously run or if the well did not have cement circulated to surface during the original casing cementing job or subsequent cementing jobs. Insure all bradenheads have been exposed, identified and valves are operational prior to rig up.
- 2. Closed loop system is to be used for entire plugging operation. Upon completion, contents of steel pits are to be hauled to a permitted disposal location.
- 3. Trucking companies being used to haul oilfield waste fluids to a disposal commercial or private shall have an approved NMOCD C-133 permit. A copy of this permit shall be available in each truck used to haul waste products. It is the responsibility of the operator as well as the contractor, to verify that this permit is in place prior to performing work. Drivers shall be able to produce a copy upon request of an NMOCD Field inspector.
- 4. Filing a subsequent C-103 will serve as notification that the well has been plugged.
- 5. A final C-103 shall be filed (and a site inspection by NMOCD Inspector to determine if the location is satisfactorily cleaned, all equipment, electric poles and trash has been removed to Meet NMOCD standards) before bonding can be released.
- 6. If work has not begun within 1 Year of the approval of this procedure, an extension request must be file stating the reason the well has not been plugged.
- 7. Squeeze pressures are not to exceed 500 psi, unless approval is given by NMOCD.
- 8. Produced water will not be used during any part of the plugging operation.
- 9. Mud laden fluids must be placed between all cement plugs mixed at 25 sacks per 100 bbls of water.
- 10. All cement plugs will be a minimum of 100' in length or a minimum of 25 sacks of cement, whichever is greater. 50' of calculated cement excess required for inside casing plugs and 100% calculated cement excess required on outside casing plugs.
- 11. Class 'C' cement will be used above 7500 feet.
- 12. Class 'H' cement will be used below 7500 feet.
- 13. A cement plug is required to be set 50' above and 50' below, casing stubs, DV tools, attempted casing cut offs, cement tops outside casing, salt sections and anywhere the casing is perforated, these plugs require a 4 hour WOC and then will be tagged
- 14. All Casing Shoes Will Be Perforated 50' below shoe depth and Attempted to be Squeezed, cement needs to be 50' above and 50' Below Casing Shoe inside the Production Casing.

- 16. When setting the top out cement plug in production, intermediate and surface casing, wellbores should remain full at least 30 minutes after plugs are set
- 17. A CIBP is to be set within 100' of production perforations, capped with 100' of cement, WOC 4 hours and tag.
- 18. A CIBP with 35' of cement may be used in lieu of the 100' plug if set with a bailer. This plug will be placed within 100' of the top perforation, (WOC 4 hrs and tag).
- 19. No more than 3000' is allowed between cement plugs in cased hole and 2000' in open hole.
- 20. Some of the Formations to be isolated with cement plugs are: These plugs to be set to isolate formation tops
 - A) Fusselman
 - B) Devonian
 - C) Morrow
 - D) Wolfcamp
 - E)Bone Springs
 - F) Delaware
 - G) Any salt sections
 - H) Abo
 - I) Glorieta
 - J) Yates.
 - K)Potash---(In the R-111-P Area (Page 3 & 4), a solid cement plug must be set across the salt section. Fluid used to mix the cement shall be saturated with the salts that are common to the section penetrated and in suitable proportions, not more than 3% calcium chloride (by weight of cement) will be considered the desired mixture whenever possible, WOC 4 hours and tag, this plug will be 50' below the bottom and 50' above the top of the Formation.
- 21. If cement does not exist behind casing strings at recommended formation depths, the casing can be cut and pulled with plugs set at recommended depths. If casing is not pulled, perforations will be shot and cement squeezed behind casing, WOC and tagged. These plugs will be set 50' below formation bottom to 50' above formation top inside the casing

DRY HOLE MARKER REQUIRMENTS

The operator shall mark the exact location of the plugged and abandoned well with a steel marker not less than four inches in diameter, 3' below ground level with a plate of at least ¼" welded to the top of the casing and the dry hole marker welded on the plate with the following information welded on the dry hole marker:

1. Operator name2. Lease and Well Number3. API Number4. Unit Letter5. QuarterSection (feet from the North, South, East or West)6. Section, Township and Range7. Plugging Date8. County(SPECIAL CASES)------AGRICULTURE OR PRARIE CHICKEN BREEDING AREAS

In these areas, a below ground marker is required with all pertinent information mentioned above on a plate, set 3' below ground level, a picture of the plate will be supplied to NMOCD for record, the exact location of the marker (longitude and latitude by GPS) will be provided to NMOCD (We typically require a current survey to verify the GPS)

SITE REMEDIATION DUE WITHIN ONE YEAR OF WELL PLUGGING COMPLETION

R-111-P Area

T 18S – R 30E

Sec 10 Unit P. Sec 11 Unit M,N. Sec 13 Unit L,M,N. Sec 14 Unit C -P. Sec 15 Unit A G,H,I,J,K,N,O,P. Sec 22 Unit All except for M. Sec 23, Sec 24 Unit C,D,E,L, Sec 26 Unit A-G, Sec 27 Unit A,B,C

T 19S – R 29E

Sec 11 Unit P. Sec 12 Unit H-P. Sec 13. Sec 14 Unit A,B,F-P. Sec 15 Unit P. Sec 22 Unit A,B,C,F,G,H,I,J K,N,O,P. Sec 23. Sec 24. Sec 25 Unit D. Sec 26 Unit A- F. Sec 27 Unit A,B,C,F,G,H.

T 19S – R 30E

Sec 2 Unit K,L,M,N. Sec 3 Unit I,L,M,N,O,P. Sec 4 Unit C,D,E,F,G,I-P. Sec 5 Unit A,B,C,E-P. Sec 6 Unit I,O,P. Sec 7 – Sec 10. Sec 11 Unit D, G—P. Sec 12 Unit A,B,E-P. Sec 13 Unit A-O. Sec 14-Sec 18. Sec 19 Unit A-L, P. Sec 20 – Sec 23. Sec 24 Unit C,D,E,F,L,M,N. Sec 25 Unit D. Sec 26 Unit A-G, I-P. Sec 27, Sec 28, Sec 29 Unit A,B,C,D,F,G,H,I,J,O,P. Sec 32 Unit A,B,G,H,I,J,N,O,P. Sec 33. Sec 34. Sec 35. Sec 36 Unit D,E,F,I-P.

T 19S – R 31E

Sec 7 Unit C,D,E,F,L. Sec 18 Unit C,D,E,F,G,K,L. Sec 31 Unit M. Sec 34 Unit P. Sec 35 Unit M,N,O. Sec 36 Unit O,P.

T 20S – R 29E

Sec 1 Unit H,I,P. Sec 13 Unit E,L,M,N. Sec 14 Unit B-P. Sec 15 Unit A,H,I,J,N,O,P. Sec 22 Unit A,B,C,F,G,H,I,J,O,P. Sec 23. Sec 24 Unit C,D,E,F,G,J-P. Sec 25 Unit A-O. Sec 26. Sec 27 Unit A,B,G,H,I,J,O,P. Sec 34 Unit A,B,G,H. Sec 35 Unit A-H. Sec 36 Unit B-G.

T 20S – R 30E

Sec 1 – Sec 4. Sec 5 Unit A,B,C,E-P. Sec 6 Unit E,G-P. Sec 7 Unit A-H,I,J,O,P. Sec 8 – 17. Sec 18 Unit A,B,G,H,I,J,O,P. Sec 19 Unit A,B,G,H,I,J,O,P. Sec 20 – 29. Sec 30 Unit A-L,N,O,P. Sec 31 Unit A,B,G,H,I,P. Sec 32 – Sec 36.

T 20S – R 31E

Sec 1 Unit A,B,C,E-P. Sec 2. Sec 3 Unit A,B,G,H,I,J,O,P. Sec 6 Unit D,E,F,J-P. Sec 7. Sec 8 Unit E-P. Sec 9 Unit E,F,J-P. Sec 10 Unit A,B,G-P. Sec 11 – Sec 36.

T 21S – R 29E

Sec 1 – Sec 3. Sec 4 Unit L1 – L16,I,J,K,O,P. Sec 5 Unit L1. Sec 10 Unit A,B,H,P. Sec 11 – Sec 14. Sec 15 Unit A,H,I. Sec 23 Unit A,B. Sec 24 Unit A,B,C,D,F,G,H,I,J,O,P. Sec 25 Unit A,O,P. Sec 35 Unit G,H,I,J,K,N,O,P. Sec 36 A,B,C,F – P.

T 21S – R 30E

Sec 1 – Sec 36

T 21S – R 31E

Sec 1 – Sec 36

T 22S – R 28E

Sec 36 Unit A,H,I,P.

T 22S – R 29E

Sec 1. Sec2. Sec 3 Unit I,J,N,O,P. Sec 9 Unit G – P. Sec 10 – Sec 16. Sec 19 Unit H,I,J. Sec 20 – Sec 28. Sec 29 Unit A,B,C,D,G,H,I,J,O,P. Sec 30 Unit A. Section 31 Unit C – P. Sec 32 – Sec 36

T 22S – R 30E

Sec 1 – Sec 36

T 22S – R 31E

Sec 1 – Sec 11. Sec 12 Unit B,C,D,E,F,L. Sec 13 Unit E,F,K,L,M,N. Sec 14 – Sec 23. Sec 24 Unit C,D,E,F,K,L,M,N. Sec 25 Unit A,B,C,D. Sec 26 Unit A,BC,D,G,H. Sec 27 – Sec 34.

T 23S – R 28E

Sec 1 Unit A

T 23S – R 29E

Sec 1 – Sec 5. Sec 6 Unit A – I, N,O,P. Sec 7 Unit A,B,C,G,H,I,P. Sec 8 Unit A – L, N,O,P. Sec 9 – Sec 16. Sec 17 Unit A,B,G,H,I,P. Sec 21 – Sec 23. Sec 24 Unit A – N. Sec 25 Unit D,E,L. Sec 26. Sec 27. Sec 28 Unit A – J, N,O,P. Sec 33 Unit A,B,C. Sec 34 Unit A,B,C,D,F,G,H. Sec 35. Sec 36 Unit B,C,D,E,F,G,K,L.

T 23S – R 30E

Sec 1 – Sec 18. Sec 19 Unit A – I,N,O,P. Sec 20, Sec 21. Sec 22 Unit A – N, P. Sec 23, Sec 24, Sec 25. Sec 26 Unit A,B,F-P. Sec 27 Unit C,D,E,I,N,O,P. Sec 28 Unit A – H, K,L,M,N. Sec 29 Unit A – J, O,P. Sec 30 Unit A,B. Sec 32 A,B. Sec 33 Unit C,D,H,I,O,P. Sec 34, Sec 35, Sec 36.

T 23S – R 31E

Sec 2 Unit D,E,J,O. Sec 3 – Sec 7. Sec 8 Unit A – G, K – N. Sec 9 Unit A,B,C,D. Sec 10 Unit D,P. Sec 11 Unit G,H,I,J,M,N,O,P. Sec 12 Unit E,L,K,M,N. Sec 13 Unit C,D,E,F,G,J,K,L,M,N,O. Sec 14. Sec 15 Unit A,B,E – P. Sec 16 Unit I, K – P. Sec 17 Unit B,C,D,E, I – P. Sec 18 – Sec 23. Sec 24 Unit B – G, K,L,M,N. Sec 25 Unit B – G, J,K,L. Sec 26 – Sec 34. Sec 35 Unit C,D,E.

T 24S – R 29E

Sec 2 Unit A, B, C, D. Sec 3 Unit A

T 24S – R 30E


Sec 1 Unit A – H, J – N. Sec 2, Sec 3. Sec 4 Unit A,B,F – K, M,N,O,P. Sec 9 Unit A – L. Sec 10 Unit A – L, O,P. Sec 11. Sec 12 Unit D,E,L. Sec 14 Unit B – G. Sec 15 Unit A,B,G,H.

T 24S – R 31E


Sec 3 Unit B – G, J – O. Sec 4. Sec 5 Unit A – L, P. Sec 6 Unit A – L. Sec 9 Unit A – J, O,P. Sec 10 Unit B – G, K – N. Sec 35 Unit E – P. Sec 36 Unit E,K,L,M,N.

T 25S – R 31E

Sec 1 Unit C,D,E,F. Sec 2 Unit A – H.

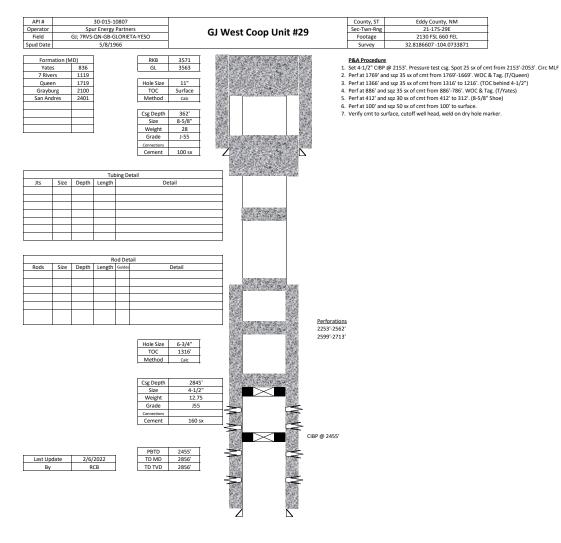

Eddy County, NM 21-17S-29E 2130 FSL 660 FEL

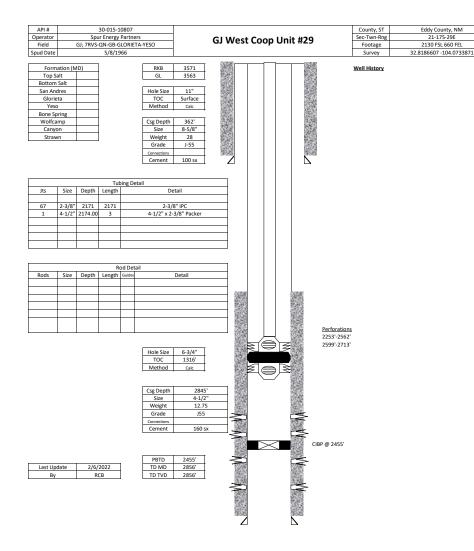

District I 1625 N. French Dr., Hobbs, NM 88240 Phone:(575) 393-6161 Fax:(575) 393-0720 District II

811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720

District III

1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

District IV 1220 S. St Francis Dr., Santa Fe, NM 87505 Phone: (505) 476-3470 Fax: (505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. Santa Fe, NM 87505

CONDITIONS

Operator:	OGRID:
Spur Energy Partners LLC	328947
9655 Katy Freeway	Action Number:
Houston, TX 77024	102301
	Action Type:
	[C-103] NOI Plug & Abandon (C-103F)

CONDITIONS

Created By		Condition Date
gcordero	None	5/2/2022

Page 8 of 8

.

Action 102301