UNITED STATES

DEPARTMENT OF THE INTERIOR

ζĘ	CE	IV	Ξ	D
	Ē,	‡.≟ ! .		/

	-	
Sundry Notices and Reports on Wells 1.	J	
070 FASIL 650A, M	5.	Lease Number SF-078464
. Type of Well	6.	If Indian, All. or Tribe Name
GAS		
Name of Operator	7.	Unit Agreement Nam
MERIDIAN OIL	8.	Well Name & Number
3. Address & Phone No. of Operator		Federal A #1
PO Box 4289, Farmington, NM 87499 (505) 326-9700	9.	API Well No. 30-045-10290
. Location of Well, Footage, Sec., T, R, M	10.	Field and Pool
1600'FSL, 1740'FWL, Sec.25, T-31-N, R-13-W, NMPM		Basin Dakota
K	11.	County and State San Juan Co, NM
12. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT Type of Submission Type of Action	OTHER	DATA
Change	e of Pla	ans
X Notice of Intent Abandonment Change Recompletion New Co		
Subsequent Report Plugging Back Non-Ro	outine	Fracturing
Subsequent Report Plugging Back Non-Ro Casing Repair Water	outine : Shut o	Fracturing ff
Subsequent Report Plugging Back Non-Ro	outine : Shut o	Fracturing ff
Subsequent Report Plugging Back Non-Ro Casing Repair Water Final Abandonment Altering Casing Conver	outine : Shut o	Fracturing ff
Subsequent Report Plugging Back Non-Ro Casing Repair Water Final Abandonment Altering Casing Convert X Other - Pay add	Shut o	Fracturing ff o Injection
Subsequent Report Plugging Back Non-Recasing Repair Water Final Abandonment Altering Casing Convert X Other - Pay add 13. Describe Proposed or Completed Operations It is intended to add pay to the Dakota formation of the to the attached procedure and wellbore diagram.	Shut o	Fracturing ff o Injection t well according
Subsequent Report Plugging Back Non-Recasing Repair Water Final Abandonment Altering Casing Convert X Other - Pay add 13. Describe Proposed or Completed Operations It is intended to add pay to the Dakota formation of the to the attached procedure and wellbore diagram.	Shut o Shut o rsion t	Fracturing ff o Injection t well according
Subsequent Report Plugging Back Non-Recasing Repair Water Final Abandonment Altering Casing Convert X Other - Pay add 13. Describe Proposed or Completed Operations It is intended to add pay to the Dakota formation of the to the attached procedure and wellbore diagram.	Shut o Shut o rsion t	Fracturing ff o Injection t well according
Subsequent Report Plugging Back Non-Recasing Repair Water Final Abandonment Altering Casing Convert X Other - Pay add 13. Describe Proposed or Completed Operations It is intended to add pay to the Dakota formation of the to the attached procedure and wellbore diagram.	Shut o Shut o rsion t	Fracturing ff o Injection t well according
Subsequent Report Plugging Back Non-Recasing Repair Water Final Abandonment Altering Casing Convert X Other - Pay add 13. Describe Proposed or Completed Operations It is intended to add pay to the Dakota formation of the to the attached procedure and wellbore diagram.	subjec	Fracturing ff o Injection t well according UL 0 3 1896
Subsequent Report Plugging Back Water Casing Repair Water Altering Casing Convert X Other - Pay add 13. Describe Proposed or Completed Operations It is intended to add pay to the Dakota formation of the to the attached procedure and wellbore diagram.	subjec	Fracturing ff o Injection t well according
Subsequent Report Plugging Back Water Casing Repair Water Final Abandonment Altering Casing Convert X Other - Pay add 13. Describe Proposed or Completed Operations It is intended to add pay to the Dakota formation of the to the attached procedure and wellbore diagram. I hereby certify that the foregoing is true and correct.	subjec	Fracturing ff o Injection t well according GOM, DOM, DOM, DOM, 3
Subsequent Report Plugging Back Water Casing Repair Water Final Abandonment Altering Casing Converge Other - Pay add 13. Describe Proposed or Completed Operations It is intended to add pay to the Dakota formation of the to the attached procedure and wellbore diagram. 14 I hereby certify that the foregoing is true and correct. Signed May Madh (JAS4) Title Regulatory Admin	subjec	Fracturing ff o Injection t well according GOM, DOM, DOM, DOM, 3
Subsequent Report Plugging Back Water Casing Repair Water Final Abandonment Altering Casing Convert X Other - Pay add 13. Describe Proposed or Completed Operations It is intended to add pay to the Dakota formation of the to the attached procedure and wellbore diagram. I hereby certify that the foregoing is true and correct.	subjec	Fracturing ff o Injection t well according GOM, DOM, DOM, DOM, 3

COMPLETION PROCEDURE

FEDERAL A #1 (DAKOTA)

SW/4, Section 25, T31N, R13W

Lat. 36.867996, Long. -107.158142 by PDG 27 77 2: 15

San Juan County, NM DAKOTA PAYADD

070 Edward Od, MA

Tubular Requirements:

Workstring

+/- 7000' 2-3/8" 4.7# workstring

Fracstring

+/- 400' 2-3/8" N-80 4.7# tubing,

Baker Safety Joint connection (2-3/8")

+/- 6400' 2-7/8" N-80 6.5# buttress fracstring

Additional Production Tubing

2 joints of 1-1/2" 2.75#, EUE tubing

Check gas line pressure in area, if 200 psi or greater, use drill gas unit, if not rig up air package, 2 compressors, 1 mist pump and 1, 2-stage booster, min requirements 1000 scfm, 10 gpm mist, 300 psi stand pipe pressure. Make all efforts to use gas if possible. History of Dakota wells in this area show that Iron Oxide may form if air is used during the workover.

- Comply w/ all BLM, MOI and NMOCD rules and regulations. MOL and RU. Place fire and safety equipment in strategic locations. Obtain base pitot gauge and record on morning report. NU BOP and test operation of rams. Lay flow lines and stake down.
- 2. Spot 2 400 bbl frac tanks, 1 400 bbl rig tank and fill w/ 2% KCL water.
- 3. TOOH w 1-1/2" tubing set @ 6686'. Remove perforated joint on bottom. Do not rerun.
- 4. PU and TIH w/ 3-7/8" bit/mill, 4-1/2" 10.5# csg scraper on 2-3/8" work string. Clean out to PBTD @ 6886'. TOOH and LD bit and csg. scraper.
- 5. TIH w/ 4-1/2" 10.5 # full bore packer on 2-3/8" workstring. Set packer @ 6600' and pressure test backside to 500 psi for 15 minutes. Release packer. TIH and set packer @ 7255'. Pressure test casing below perforations with 2% KCL to 3800 psi for 15 minutes. Release pkr & TOOH to 4000' and unload hole with gas. TIH to 6886' and unload hole. Spot 200 gal of double inhibited mud acid (3% HF & 12% HCL acid) w/ 2/1000 gal surfactant, 6/1000gal corrosion inhibitor, 1/1000 surface tension reducer, 1/1000 clay control. If tubing appeared to have appreciable scale when TOOH in Step 3, pump 100 gallons of 15% HCL ahead of mud acid. TOOH and LD pkr.
- 6. RU wireline and lubricator. Perforate Oak Canyon and Encinal Canyon underbalanced with a 3-1/8" HSC, 12 gram, 0.33" hole, 14" DP @ 4 SPF. Inspect guns to ensure all shots fired. RD wireline.

6812'-6824' (12') 6864'-6876' (12')

96 holes

- 7. TIH w/ 1 joint 2-3/8" N-80 4.7# tubing, 4-1/2" isolation FH packer, 4 joints 2-3/8", N-80, 4.7# tubing with a safety joint connection in the middle, PU second isolation FH packer, 8 joints 2-3/8" stinger and remaining 2-7/8" buttress fracstring. Set packers @ 6640 (+/-10") and 6764' (+/-10"). Pressure up to 500 psi on backside and hold during frac.
- 8. RU immediate flowback line and 1/4" choke.

 HOLD SAFETY MEETING WITH ALL PERSONNEL BEFORE PRESSURE TESTING

 Pressure test stimulation lines to 8000 psi (1000 psi over maximum treating pressure but less than the working pressure of the lines). Pressure test immediate flowback line to 1000 psi.

Approvals:

VENDORS:

NW Basin Team Leader

- 9. Max allowable surface treating pressure is 7000 psi @ 20 BPM. Stimulate the Dakota interval @ +/- 20 BPM w/ 30# linear gel, 5000 SCF/M N2 and 20/40 Super DC resin coated. Sand will not be tagged. Stage flush when sand concentration drops to 3-1/2 #/gal. Quick flush w/ 2% KCL water and N2. Cut flush rate in half (to 10 BPM) when half of flush is away. Note rate and pressure and underflush by a minimum of 10%.
- 10. Immediately flow back well upon completion of flush. Flowback well through a 1/4" positive choke. RD frac company.
- 11. Flow back until well dies or sand production is negligible. Pump 50 bbl 2% KCL water on backside. Release isolation packers and TOOH.
- 12. PU 3-7/8" mill/bit on 2-3/8 tbg and TIH. CO to PBTD @ 6886' and obtain pitot gauge. When sand and water has diminished to acceptable levels, obtain pitot gauge & TOOH.
- 13. TIH with one joint of 1-1/2", 2.75#, J-55, EUE tubing w/ expendable check, an F-nipple, then the remaining 1-1/2" production tubing. Land tubing near bottom DK perforation @ 6740' as removed from well originally, plus 2 extra joints.
- 14. ND BOP's. NU WH. Pump off expendable check. Make swab run to ensure tubing is clear. Obtain final pitot gauge. RD and MOL.

<u>Engineers -</u>		Frac Consultants	
James A. Smith	Mary Ellen Lutey	Mark Byars	Mike Martinez
Office - (326-9713)	Office - (599-4052)	Pager - (327-8470)	Pager - (599-7429)
Home - (327-3061)	Home - (325-9387)	Mobile - (320-0349)	Mob - (860-7518)
Pager - (324-2420)	Pager - (324-2671)	Home - (327-0096)	Home - (326-4861)

Drilling Supervisor

 WIRELINE:
 Petro
 326-6669


 STIMULATION:
 HES
 325-3575

 PACKERS
 Baker
 325-0216

FEDERAL A #1

AS OF 4/24/1996

BASIN DAKOTA
1600' FSL, 1740' FWL
SEC 25, T31N, R13W, SAN JUAN COUNTY, NM

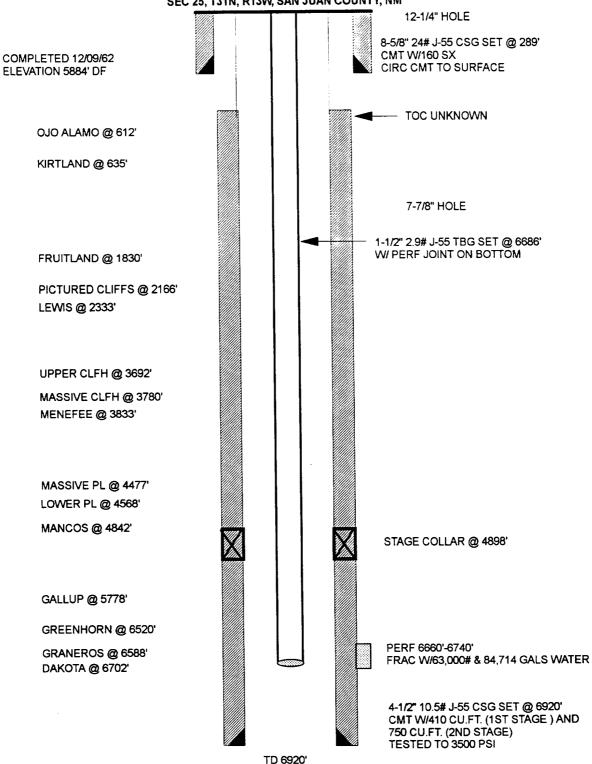

PBTD 6886'

Pertinent Data Sheet

FEDERAL A #1

Location: Unit K NE/4 SW/4, Section 25, T31N, R13W, 1600' FSL, 1740' FWL,

Lat. 36.867996, Long. -107.158142 by TDG

San Juan County, NM

Field: Basin Dakota <u>Elevation:</u> 5884' DF

KB: N/A

TD: 6920' PBTD: 6886'

750 c.f.

Spud Date: 11-17-62 **Completed:** 12-09-62

DP No: 32323A **Prop. No:** 071220200

Casing/Liner Record:

Hole Size	Csg. Size	Wt. & Grade	Depth Set	<u>Cement</u>	Top/Cement
121/4"	8 5/8"	24# J-55	289'	160 sx	to surface
7 7/8"	41/2"	10.5# J-55	6920'	410 c.f.	
				(1st stage)	
				410 c.f.	
		Stag	e Collar @ 4898'	(2nd stage)	TOC unknown

Tubing Record: 1½" 2.9# J-55 tubing set @ 6686' w/perf joint on bottom.

Logging Record: Acoustic, E.S. Induction, CBL

Formation Tops:

Ojo Alamo:	612'
Kirtland:	635'
Fruitland:	1830'
Pictured Cliffs:	2166'
Lewis:	2333'
Upper Cliffhouse:	3692'
Massive Cliffhouse:	3780'
Menefee:	3833'
Massive Point Lookout:	4477'
Lower Point Lookout:	4568'
Mancos:	4842'
Gallup:	5778'
Greenhorn:	6520'
Graneros:	6588'
Dakota:	6702'

Perforation and Stimulation: Perf 6660'-6740', frac with 63,000# and 84,714 gallons of water

& 320 cu.ft. CO2/Bbl. 6660'-6674' 2 SPF 6704'-6710' 2 SPF 6725'-6740' 2 SPF

6/26/96 N. Keeler