

District I
1625 N. French Dr., Hobbs, NM 88240
District II
811 S. First St., Artesia, NM 88210
District III
1000 Rio Brazos Road, Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy Minerals and Natural Resources
Oil Conservation Division
1220 South St. Francis Dr.
Santa Fe, NM 87505

NM OIL CONSERVATION
ARTESIA DISTRICT

Form C-141
Revised April 3, 2017

JAN 30 2018

Submit 1 Copy to appropriate District Office in
accordance with 19.15.29 NMAC.

RECEIVED

Release Notification and Corrective Action

NAB1808054013

OPERATOR

☒ Initial Report ☐ Final Report

Name of Company	Devon Energy Production Company <u>6137</u>	Contact	Wesley Ryan
Address	6488 Seven Rivers Hwy Artesia, NM 88210	Telephone No.	575-390-5436
Facility Name	Mizar 11 Fed Com 1H	Facility Type	Oil

Surface Owner	Federal	Mineral Owner	Federal	API No.	30-015-41964
---------------	---------	---------------	---------	---------	--------------

LOCATION OF RELEASE

Unit Letter	Section	Township	Range	Feet from the	North/South Line	Feet from the	East/West Line	County
D	11	19S	31E					Eddy

Latitude 32.68198 Longitude 103.84817 NAD83

NATURE OF RELEASE

Type of Release	Oil	Volume of Release	5.6 BBLS	Volume Recovered	5.6 BBLS
Source of Release	Oil tank	Date and Hour of Occurrence	January 16, 2018 12:30 PM MST	Date and Hour of Discovery	January 16, 2018 12:30 PM MST
Was Immediate Notice Given?	<input checked="" type="checkbox"/> Yes <input type="checkbox"/> No <input type="checkbox"/> Not Required	If YES, To Whom?	BLM- Shelly Tucker & OCD-Mike Bratcher, Crystal Weaver		
By Whom?	Mike Shoemaker	Date and Hour	January 17, 2018 10:23 AM MST		
Was a Watercourse Reached?	<input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	If YES, Volume Impacting the Watercourse.	N/A		

If a Watercourse was Impacted, Describe Fully.*
N/A

Describe Cause of Problem and Remedial Action Taken.*

The battery was in lease kill and the lease operator did not arrive in time and the water tank was running over with oil into the lined SPCC containment ring because a valve on the FWKO was closed. The valve was opened and the pump was reset to begin transferring fluids.

Describe Area Affected and Cleanup Action Taken.*

Approximately 5.6 BBLS of Oil was released from the water tank. A vacuum truck was dispatched and recovered approximately 5.6 BBLS of Oil from the lined SPCC containment ring. All released fluid remained on pad and inside the lined containment. Once fluids were removed the liner was visually inspected by Devon field staff for any pinholes or punctures and none were found. Based on this inspection there is no evidence that the spill fluids left containment.

I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to NMOCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the NMOCD marked as "Final Report" does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to ground water, surface water, human health or the environment. In addition, NMOCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations.

Signature: <u>Jennifer Reyna</u>		OIL CONSERVATION DIVISION	
Printed Name: Jennifer Reyna		Approved by Environmental Specialist <u>[Signature]</u>	
Title: Field Admin Support		Approval Date: <u>1/30/18</u>	Expiration Date: <u>N/A</u>
E-mail Address: Jennifer.Reyna@dv.com		Conditions of Approval: <u>See attached</u>	
Date: <u>1/18/2018</u>	Phone: <u>575.746.5588</u>	Attached <input type="checkbox"/> <u>2RP-4592</u>	

* Attach Additional Sheets If Necessary

Operator/Responsible Party,

The OCD has received the form C-141 you provided on 1/30/2018 regarding an unauthorized release. The information contained on that form has been entered into our incident database and remediation case number ARP-4592 has been assigned. **Please refer to this case number in all future correspondence.**

It is the Division's obligation under both the Oil & Gas Act and Water Quality Act to provide for the protection of public health and the environment. Our regulations (19.15.29.11 NMAC) state the following,

The responsible person shall complete division-approved corrective action for releases that endanger public health or the environment. The responsible person shall address releases in accordance with a remediation plan submitted to and approved by the division or with an abatement plan submitted in accordance with 19.15.30 NMAC. [emphasis added]

Release characterization is the first phase of corrective action unless the release is ongoing or is of limited volume and all impacts can be immediately addressed. Proper and cost-effective remediation typically cannot occur without adequate characterization of the impacts of any release. Furthermore, the Division has the ability to impose reasonable conditions upon the efforts it oversees. **As such, the Division is requiring a workplan for the characterization of impacts associated with this release be submitted to the OCD District 2 office in ARTESIA on or before 3/2/2018. If and when the release characterization workplan is approved, there will be an associated deadline for submittal of the resultant investigation report. Modest extensions of time to these deadlines may be granted, but only with acceptable justification.**

The goals of a characterization effort are: 1) determination of the lateral and vertical extents along with the magnitude of soil contamination. 2) determine if groundwater or surface waters have been impacted. 3) If groundwater or surface waters have been impacted, what are the extents and magnitude of that impact. 4) The characterization of any other adverse impacts that may have occurred (examples: impacts on vegetation, impacts on wildlife, air quality, loss of use of property, etc.). To meet these goals as quickly as possible, the following items must, at a minimum, be addressed in the release characterization workplan and subsequent reporting:

- Horizontal delineation of soil impacts in each of the four cardinal compass directions. Adsorbed soil contamination must be characterized for the following constituents using the associated laboratory methods: benzene, toluene, ethylbenzene, and total xylenes by either Method 8260 or 8021, total petroleum hydrocarbons by Method 8015 extended range (GRO+DRO+MRO; C₆ thru C₃₆), and for chloride by Method 300. This is not an exclusive list of potential contaminants. Analyzed parameters should be modified based on the nature of the released substance(s). Soil sampling must be both within the impacted area and beyond.
- Vertical delineation of soil impacts. Adsorbed soil contamination must be characterized for the following constituents using the associated laboratory methods: benzene, toluene, ethylbenzene, and total xylenes by either Method 8260 or 8021, total petroleum hydrocarbons by Method 8015 extended range (GRO+DRO+MRO; C₆ thru C₃₆), and for chloride by Method 300. As above, this is not an exclusive list of potential contaminants and can be modified. Vertical characterization samples should be taken at depth intervals no greater than five feet apart. Lithologic description of encountered soils must also be provided. At least ten vertical feet of soils with contaminant concentrations at or below these values must be demonstrated as existing above the water table.
- Nominal detection limits for field and laboratory analyses must be provided.
- Composite sampling is not generally allowed.
- Field screening and assessment techniques are acceptable (headspace, titration, EC [include algorithm for validation purposes], EM, etc.), but the sampling and assay procedures must be clearly defined. Copies of field notes are highly desirable. A statistically significant set of split samples must be submitted for confirmatory laboratory analysis, including the laterally farthest and vertically deepest sets of soil samples. Make sure there are at least two soil samples submitted

for laboratory analysis from each borehole or test pit (highest observed contamination and deepest depth investigated). Copies of the actual laboratory results must be provided including chain of custody documentation.

- Probable depth to shallowest protectable groundwater and lateral distance to nearest surface water. If there is an estimate of groundwater depth, the information used to arrive at that estimate must be provided. If there is a reasonable assumption that the depth to protectable water is 50 feet or less, the responsible party should anticipate the need for at least one groundwater monitoring well to be installed in the area of likely maximum contamination.

- If groundwater contamination is encountered, an additional investigation workplan may be required to determine the extents of that contamination. Groundwater and/or surface water samples, if any, must be analyzed by a competent laboratory for volatile organic hydrocarbons (typically Method 8260 full list), total dissolved solids, pH, major anions and cations including chloride and sulfate, dissolved iron, and dissolved manganese. The investigation workplan must provide the groundwater sampling method(s) and sample handling protocols. To the fullest extent possible, aqueous analyses must be undertaken using nominal method detection limits. As with the soil analyses, copies of the actual laboratory results must be provided including chain of custody documentation.

- Accurately scaled and well-drafted site maps must be provided providing the location of borings, test pits, monitoring wells, potentially impacted areas, and significant surface features including roads and site infrastructure that might limit either the release characterization or remedial efforts. Field sketches may be included in subsequent reporting, but should not be considered stand-alone documentation of the site's layout. Digital photographic documentation of the location and fieldwork is recommended, especially if unusual circumstances are encountered.

Nothing herein should be interpreted to preclude emergency response actions or to imply immediate remediation by removal cannot proceed as warranted. Nonetheless, characterization of impacts and confirmation of the effectiveness of remedial efforts must still be provided to the OCD before any release incident will be closed.

Jim Griswold
OCD Environmental Bureau Chief
1220 South St. Francis Drive
Santa Fe, New Mexico 87505
505-476-3465
jim.griswold@state.nm.us

Bratcher, Mike, EMNRD

From: Reyna, Jennifer <Jennifer.Reyna@dvn.com>
Sent: Tuesday, January 30, 2018 7:18 AM
To: Bratcher, Mike, EMNRD; Weaver, Crystal, EMNRD; 'Shelly Tucker (stucker@blm.gov)'
Cc: Fulks, Brett; Shoemaker, Mike
Subject: Mizar 11 Fed Com 1_5.6 bbls oil_1.16.18
Attachments: Mizar 11 Fed Com 1_5.6 bbls oil_1.16.18 GIS Image.pdf; Mizar 11 Fed Com 1_5.6 bbls oil_1.16.18 initial C-141.doc

Good Morning,

Attached please find the Initial C-141 and GIS Image for the 5.6 bbls of oil release at the Mizar 11 Fed Com 1 on 1.16.18.

If you have any questions please feel free to contact me.

Thank you,

Jennifer Reyna

Field Admin Support
Production
B-Schedule

Devon Energy Corporation
P.O. Box 250
Artesia, NM 88211
575 746 5588

Confidentiality Warning: This message and any attachments are intended only for the use of the intended recipient(s), are confidential, and may be privileged. If you are not the intended recipient, you are hereby notified that any review, retransmission, conversion to hard copy, copying, circulation or other use of all or any portion of this message and any attachments is strictly prohibited. If you are not the intended recipient, please notify the sender immediately by return e-mail, and delete this message and any attachments from your system.

Mizar 11 Fed Com 1

5.6 bbls Oil



This map is for illustrative purposes only and is neither a legally recorded map nor survey and is not intended to be used as one. Devon makes no warranty, representation, or guarantee of any kind regarding this map.

WGS_1984_Web_Mercator_Audliary_Sphere
Prepared by: Jennifer Reyna
Map is current as of: 18-Jan-2018



Miles
0 0.00 0.01 0.02 1:889

- Surface Hole (ACT-DVN/OBO)
 - Other
 - Deviated Surface
 - Oil Producing Well
 - Gas Producing Well
 - Oil and Gas Producing Well
 - Drilling or Completing
 - Injection Well
 - Salt Water Disposal Well
- Surface Hole (PRP-DVN/OBO)
 - Vertical
 - Deviated

S11-T19S-R31E

5.6 BBLS OIL

MIZAR 11 FEDERAL COM 1H-P
(DVN)



Bratcher, Mike, EMNRD

From: Shoemaker, Mike <Mike.Shoemaker@dvn.com>
Sent: Wednesday, January 17, 2018 10:23 AM
To: Bratcher, Mike, EMNRD; Weaver, Crystal, EMNRD; Shelly Tucker (stucker@blm.gov)
Subject: Mizar 11 Fed Com 1 (API #30-015-41964)

Good Morning,

Devon had the following release occur at 12:30 PM MST on 01/16/18. The incident is described below.


1. Mizar 11 Fed Com 1 (API #30-015-41964)
 - a. The battery was in lease kill and the lease operator did not arrive in time and the water tank was running over with oil into the lined SPCC containment ring because a valve on the FWKO was closed. The valve was opened and the pump was reset to begin transferring fluids. Approximately 5.6 bbls was released with approximately 5.6 bbls recovered.

A C-141 will be prepared and submitted with GPS coordinates of the area affected.

Thanks,

Mike Shoemaker
EHS Representative

Devon Energy Corporation
6488 Seven Rivers Highway
Artesia, New Mexico 88210
575-746-5566 Office
575-513-5035 Mobile

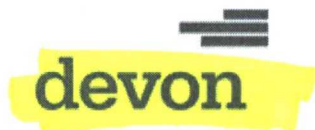

Confidentiality Warning: This message and any attachments are intended only for the use of the intended recipient(s), are confidential, and may be privileged. If you are not the intended recipient, you are hereby notified that any review, retransmission, conversion to hard copy, copying, circulation or other use of all or any portion of this message and any attachments is strictly prohibited. If you are not the intended recipient, please notify the sender immediately by return e-mail, and delete this message and any attachments from your system.