

Submit 1 Copy To Appropriate District
Office
District I - (575) 393-6161
1625 N. French Dr., Hobbs, NM 88240
District II - (575) 748-1283
811 S. First St., Artesia, NM 88210
District III - (505) 334-6178
1000 Rio Brazos Rd., Aztec, NM 87410
District IV - (505) 476-3460
1220 S. St. Francis Dr., Santa Fe, NM
87505

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103
Revised July 18, 2013

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)		WELL API NO. 30-015-02722
1. Type of Well: Oil Well <input checked="" type="checkbox"/> Gas Well <input type="checkbox"/> Other <input type="checkbox"/>		5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
2. Name of Operator LEGACY RESERVES OPERATING LP		6. State Oil & Gas Lease No.
3. Address of Operator PO BOX 10848, MIDLAND, TX 79702		7. Lease Name or Unit Agreement Name HIGH LONESOME PENROSE UNIT
4. Well Location Unit Letter <u>H</u> : <u>1980</u> feet from the <u>NORTH</u> line and <u>660</u> feet from the <u>EAST</u> line Section <u>15</u> Township <u>16S</u> Range <u>29E</u> NMPM County <u>EDDY</u>		8. Well Number <u>8</u>
11. Elevation (Show whether DR, RKB, RT, GR, etc.) 3704' GL		9. OGRID Number 240974
		10. Pool name or Wildcat HIGH LONESOME; QUEEN

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐ MULTIPLE COMPL ☐
DOWNHOLE COMMINGLE ☐
CLOSED-LOOP SYSTEM ☒
OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ P AND A ☐
CASING/CEMENT JOB ☐
OTHER: ☐

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

---SEE ATTACHED P&A PROCEDURE ALONG WITH CURRENT AND PROPOSED WELLBORE DIAGRAMS---

Approved for plugging of well bore only.
Liability under bond is retained pending receipt
of C-103 (Subsequent Report of Well Plugging)
which may be found at OCD Web Page under
Forms, www.emnrd.state.nm.us/oed.

Plugging must be
completed by 4/23/2016

NM OIL CONSERVATION
ARTESIA DISTRICT
APR 23 2015

Spud Date:

Rig Release Date:

RECEIVED

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Kent Williams TITLE SENIOR ENGINEER DATE 04/21/2015

Type or print name KENT WILLIAMS E-mail address: kwilliams@legacylp.com PHONE: 432-689-5200

For State Use Only

APPROVED BY: R. Daele TITLE Dist. R. Spewer DATE 4/23/2015

Conditions of Approval (if any):

* See Attached COA's

PLUG AND ABANDONMENT PROCEDURE-PROPOSED

High Lonesome Penrose Unit #8

Field/Pool: High Lonesome (Queen)

Eddy Co., NM

API: 30-015-02722

Date: 4/16/2015

Engineer: Kent Williams

Company: Legacy Reserves Operating, LP

Purpose Of Procedure: Plug and abandon. Will perform turn-key PXA with approved vendor.

Pre-Job:

- Check location for required dirtwork
- Test pulling unit anchors if necessary

Procedure:


1. MIRU plugging company. NU 2000# minimum rated BOP.
2. Plug #1 (Perforation Plug) RIH w/ tubing and 5 ½" CIBP. Set CIBP at 1900' (12' KB). Circulate hole w/ 46 bbls mud laden fluid. Spot 25 sxs cmt from 1900'-1650' (250'). WOC. No tag required.
3. Plug #2 (Csg Plug) Perforate csg at 850'. Squeeze 25 sxs and displace cement to 700' in 5 ½" csg to establish plug 850'-700' (150'). WOC. No tag required.
4. Plug #3 (Csg Shoe Plug) Perforate csg at 474'. Squeeze 45 sxs cmt and displace cement to 324' in 8 5/8" csg to establish plug from 474'-324' (150'). WOC. Tag plug.
5. Plug #4 (Surface Plug) Perforate csg at 60'. Circulate 16 sxs cmt from 60'-0' (60')
6. Cut off well head. Weld on dry hole marker. Backfill cellar as necessary. Clean location. RDMO.

Note:

- Use Class "C" Neat Cement , 1.32 ft³/sx cmt yield
- Use 9.5 PPG mud laden fluid (25 sxs @ 50 # gel/sx in 100 bbls brine).
- Notify NMOCD office (Hobbs,, NM) at (575) 393-6161 at least 24 hrs prior to initiating plugging.


WELLBORE SCHEMATIC

Well Name & No.:	High Lonesome Penrose Unit #8		
Field:	High Lonesome (Queen)		
Location:	1980' FNL , 660' FEL, Sec. 15, T-16-S, R-29-E		
County:	Eddy	State: NM	API # 30-015-02722
GR Elev:	3692	Spud Date:	04/14/59
KB Correction:	12	ginal Operator:	Western Development Co
KB Elev:	3704	Original Well N	Southern Union State #1

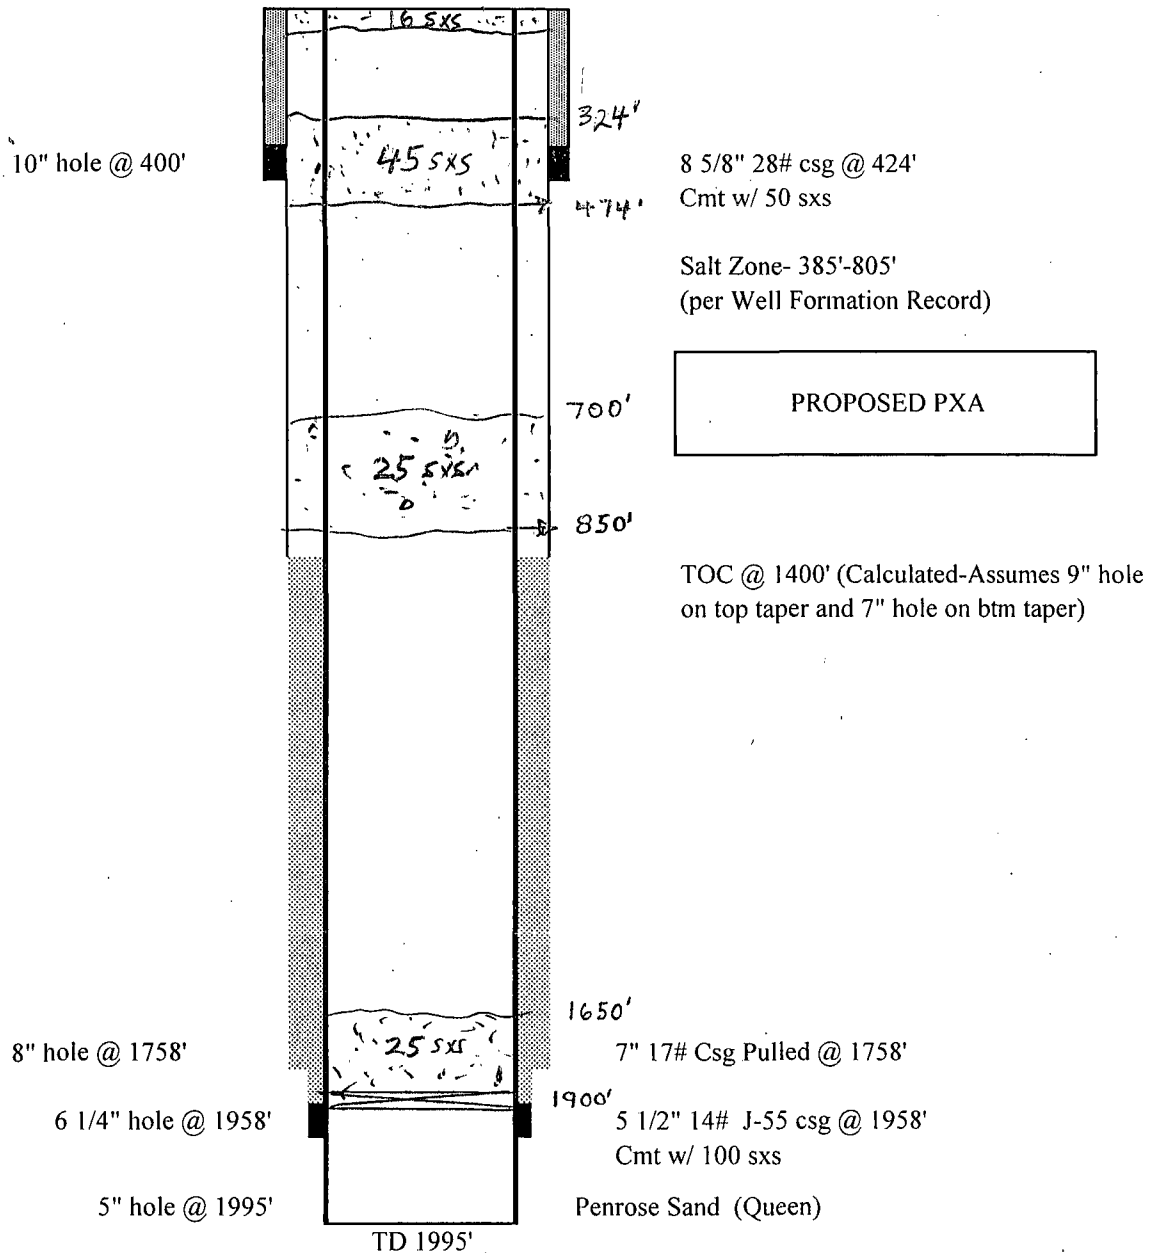

WELLBORE SCHEMATIC

Well Name & No.:	High Lonesome Penrose Unit #8		
Field:	High Lonesome (Queen)		
Location:	1980' FNL , 660' FEL, Sec. 15, T-16-S, R-29-E		
County:	Eddy	State: NM	API # 30-015-02722
GR Elev:	3692	Spud Date:	04/14/59
KB Correction:	12	ginal Operator:	Western Development Co
KB Elev:	3704	Original Well N	Southern Union State #1

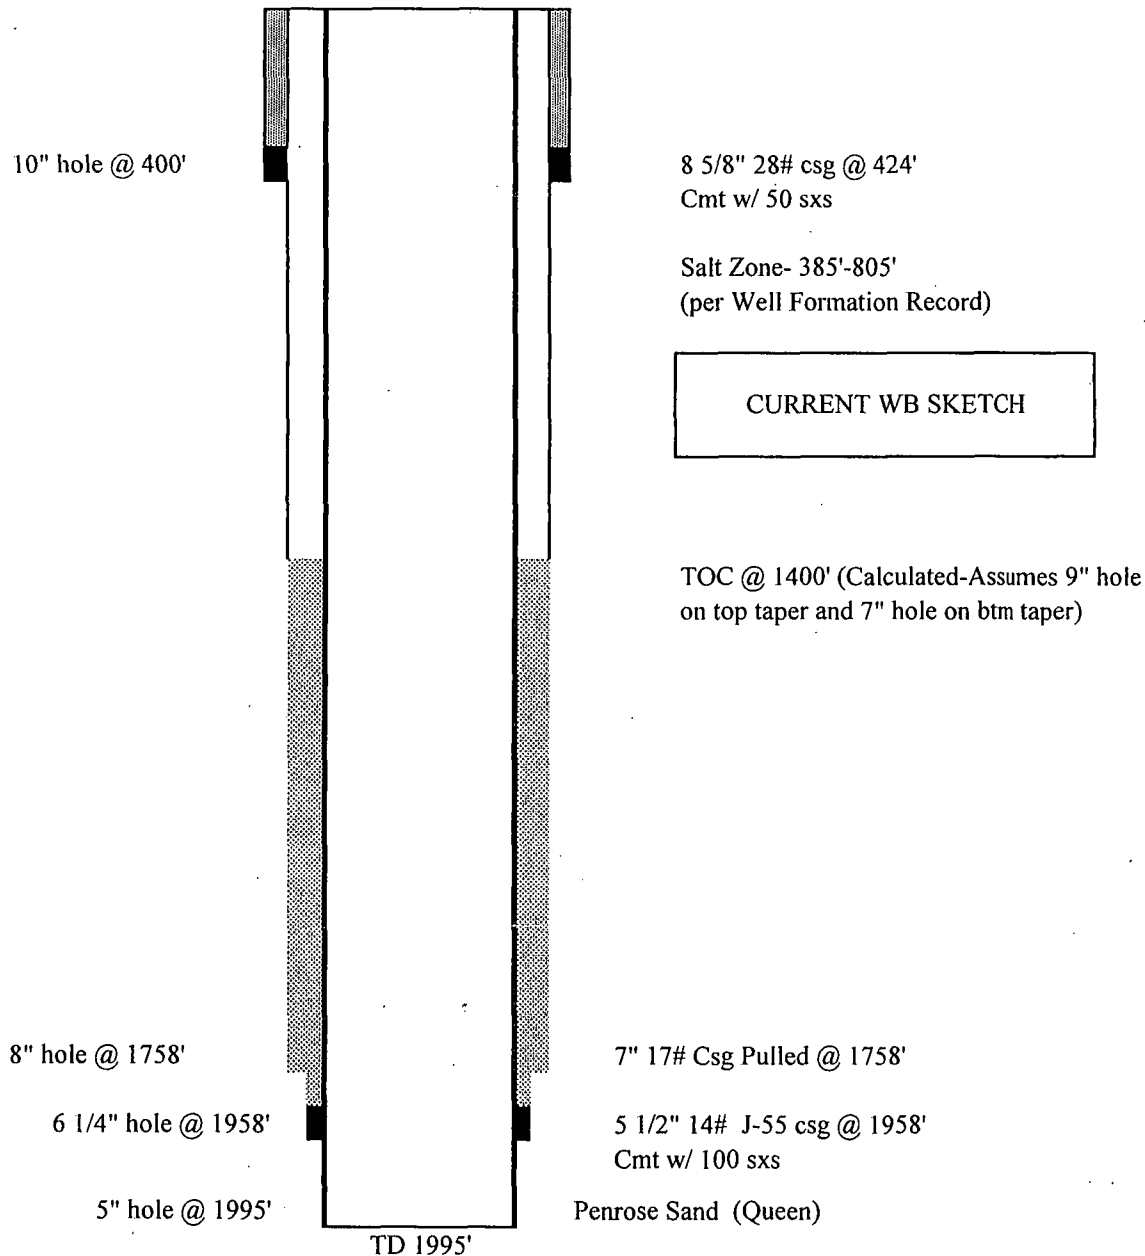

NEW MEXICO OIL CONSERVATION DIVISION
DISTRICT 2 OFFICE
811 S. FIRST STREET
ARTESIA, NM 88210
(575)748-1283

CONDITIONS OF APPROVAL FOR PLUGGING & ABANDONMENT

Operator: Legacy

Well Name & Number: High Lonesome Penrose Unit 8

API #: 30-015-02722

1. Produced water **will not** be used during any part of the plugging & abandonment operation.
2. Notify NMOCD Dist. 2 office at least 24 hrs before beginning work.
3. Closed Loop System is to be used for entire plugging operation. Upon completion, contents of steel pit are to be hauled to a permitted disposal location.
4. Trucking companies being used to haul oilfield waste fluids to a disposal – commercial or private – shall have an approved NMOCD C-133 permit. A copy of this permit shall be available in each truck used to haul waste products. It is the responsibility of the operator, as well as the contractor, to verify that this permit is place prior to performing work. Drivers shall produce a copy upon request of NMOCD Field Inspectors.
5. A subsequent C-103 will serve as notification that the well bore has been plugged **ONLY**. A C-103 FINAL shall be filed before any bonding can be released on the well. Upon receipt of the Final, an inspection will be performed to verify that the location has been satisfactorily cleaned to NMOCD standards.
6. If work has not begun within 90 days of the approval of this procedure, an extension request must be filed, stating reason that well has not been plugged.
7. Every attempt must be made to clean the well bore out to below the perfs, before any plugs can be set, by whatever means possible.
8. **Cement Retainers may not be used.**
9. **Squeeze pressures are not to exceed 500 PSI, unless approval is given by NMOCD.**
10. **Plugs may be combined after consulting with and getting approval from NMOCD.**
11. **Minimum WOC time for tag plugs will be 4 Hrs.**

DATE: 4/23/2015

APPROVED BY:

ASD

GUIDELINES FOR PLUGGING AND ABANDONMENT

DISTRICT II / ARTESIA

- All cement plugs will be a minimum of 100' in length or a minimum of 25 sacks of cement, whichever is greater.
- Mud laden fluids must be placed between all cement plugs.
- Mud laden fluids must be mixed at 25 sacks of gel per 100 bbls of water.
- A cement plug is required to be set 50' below and 50' above all casing shoes and casing stub plugs. These plugs must be tagged.
- A CIBP with 35' of cement on top may be set in lieu of 100' cement plug.
- A plug as indicated above must be placed within 100' of top perforation. This plug must be tagged.
- Plugs set below and above salt zones must be tagged.
- No more than 2000' is to be allowed between cement plugs in open hole and no more than 3000' in cased hole.
- DV tools are required to have a 100' cement plug set 50' above and below the tool and must be tagged.
- Formations to be isolated with plugs placed at the top of each formation are:
 - Fusselman
 - Devonian
 - Morrow
 - Wolfcamp
 - Bone Spring
 - Delaware
 - Any Salt Section (Plug at top and bottom)
 - Abo
 - Glorieta
 - Yates (this plug is usually at base of salt section)
- If cement does not exist behind casing strings at recommended formation depths, the casing must be cut and pulled with plugs set at these depths or casing must be perforated and cement squeezed behind casing at the formation depths.
- In the R-111-P area (Potash Mine area) a solid cement plug must be set across the salt section. Fluid used to mix the cement shall be saturated with the salts common to the section penetrated and in suitable proportions, but not more than a 3% calcium chloride by weight of cement will be considered the desired mixture whenever possible (50' below and 50' above).