FORM APPROVED UNITED STATES (August 2007) OMB NO. 1004-0135 DEPARTMENT OF THE INTERIOR Expires: July 31, 2010 . **OCD Artesia BUREAU OF LAND MANAGEMENT** 5. Lease Serial No. NMNM27642 SUNDRY NOTICES AND REPORTS ON WELLS Do not use this form for proposals to drill or to re-enter an 6. If Indian, Allottee or Tribe Name abandoned well. Use form 3160-3 (APD) for such proposals. 7. If Unit or CA/Agreement, Name and/or No. SUBMIT IN TRIPLICATE - Other instructions on reverse side. NM061P3586C337 8. Well Name and No. MCMILLAN FED 1 1. Type of Well ☑ Oil Well ☐ Gas Well ☐ Other 2. Name of Operator API Well No. LEGACY RESERVES OPERATING LPE-Mail: jsaenz@legacylp.com 30-015-22384-00-\$1 3a. Address 3b. Phone No. (include area code) 10. Field and Pool, or Exploratory Ph: 432-689-5200 **BURTON FLAT** MIDLAND, TX 79702 4. Location of Well (Footage, Sec., T., R., M., or Survey Description) 11. County or Parish, and State Sec 14 T20S R27E NWSE EDDY COUNTY, NM 12. CHECK APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA TYPE OF SUBMISSION TYPE OF ACTION ☐ Production (Start/Resume) ☐ Acidize □ Deepen ■ Water Shut-Off ■ Notice of Intent ☐ Alter Casing ☐ Fracture Treat □ Reclamation ☐ Well Integrity □ Subsequent Report Other □ Casing Repair ■ New Construction ☐ Recomplete ☐ Final Abandonment Notice ☐ Change Plans ☑ Plug and Abandon. □ Temporarily Abandon Convert to Injection ☐ Plug Back □ Water Disposal 13. Describe Proposed or Completed Operation (clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recomplete horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports shall be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompletion in a new interval, a Form 3160-4 shall be filed once testing has been completed. Final Abandonment Notices shall be filed only after all requirements, including reclamation, have been completed, and the operator has determined that the site is ready for final inspection.) Proposed P&A Procedure attached. Note: All plugs to be minimum 25 sacks of cement. SEE ATTACHED FOR Current and proposed wellbore diagrams attached. CONDITIONS OF APPROVAL NM OIL CONSERVATION ARTESIA DISTRICT NOV 1 4 2016 See Changes Electronic Submission #351897 verified by 14. I hereby certify that the foregoing is true and correct. Electronic Submission #351897 verified by the BLM Well Information System For LEGACY RESERVES OPERATING LP, sent to the Carlsbad Committed to AFMSS for processing by PRISCILLA PEREZ on 10/03/2016 (17PP0008SE) JOHN SAENZ Title **OPERATIONS ENGINEER** Name (Printed/Typed)

Nccepted for record Signature (Electronic Submission) 09/20/2016 THIS SPACE FOR FEDERAL OR STATE OFFICE USE Title _Approved_By Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon.

Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction

Office

McMillian Federal Com # 1 API: 30-015-22384 Eddy County, New Mexico 9/16/2016

Note: All plugs to be minimum 25 sacks of cement.


Proposed P&A Procedure


- 1. MIRU. Lay down rods. Install BOP and lay down tubing string. Pick up work string.
- 2. RIH and set 4-1/2" CIBP and set @ 8000; and spot 25 sx of cement on top of CIBP.
 - 3. Circulate minimum 9.5 ppg P&A mud to surface.
 - 4. TOOH. Perforate at 4950'.
 - 5. RIH with PKR to 4700'. Pump into perf @ 4950' w/ minimum 50 sx cement. WOC, POOH w/packer, RIH w/ opened ended tubing and tag TOC at/above 4850'. 4800'
 - 6. TOOH. Perforate at 4456. 4500 4500
 - 7. RIH with PKR to 4200'. Pump into perf @ 4450' w/ minimum 50 sx cement. WOC, POOH w/packer, RIH w/ opened ended tubing and tag TOC at/above 4350'.
 - 8. TOOH. Perforate at 2950'.
 - 9. RIH with PKR to 2700'. Pump into perf @ 2950' w/ minimum 50 sx cement. WOC, POOH w/packer, RIH w/ opened ended tubing and tag TOC at/above 2850'. **ZBZD'**
 - 10. TOOH. Perforate at 2725'.
 - 11. RIH with PKR to 2500'. Pump into perf @ 2725' w/ minimum 50 sx cement. WOC, POOH w/packer, RIH w/ opened ended tubing and tag TOC at/above 2610'.
 - 12. TOOH. Perforate at 450'.
 - 13. RIH with open ended tubing to 350'. Pump into perf @ 450' w/ minimum 50 sx. POOH, WOC RIH w/ opened ended tubing and tag TOC at/above 350'.
 - 14. TOOH. Perforate at 100'.
 - 15. Circulate cement from 100' to surface.
 - 16. Top off casing, remove WH, set P&A marker, clean and reclaim location.

John Saenz

* Minimum clean well to 8500' set CIBP and cap w/ 25 sx class "H" emt,

* Fert@ 800, SOZ cont to 7001 WOL Tag

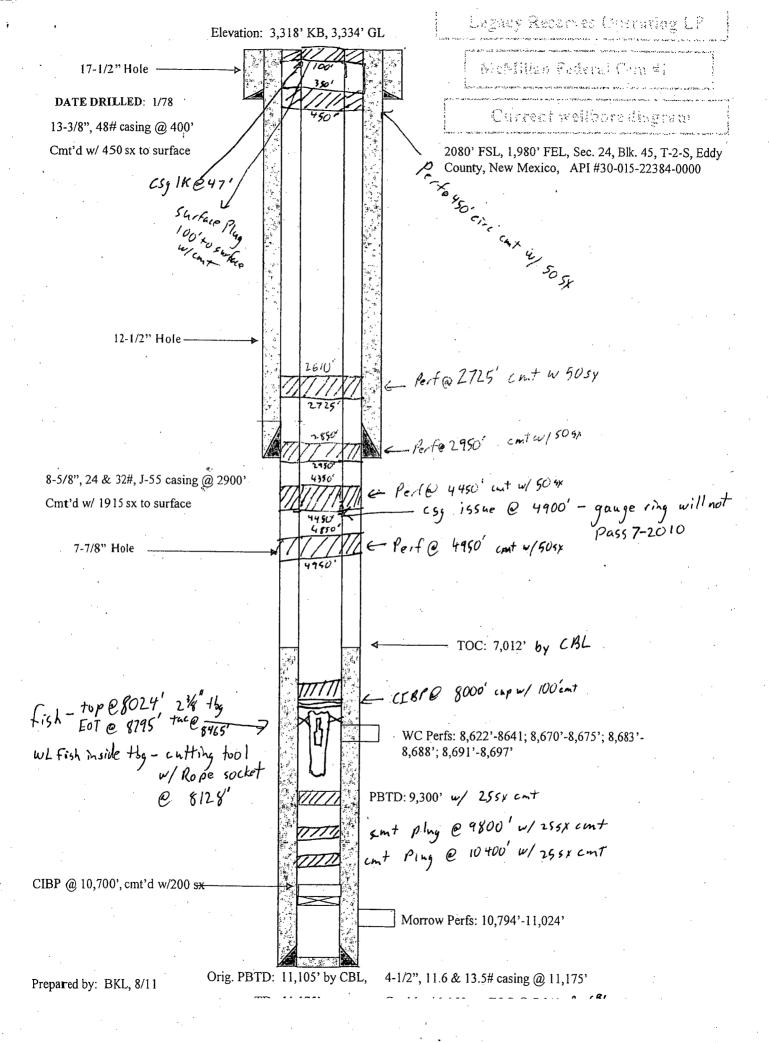

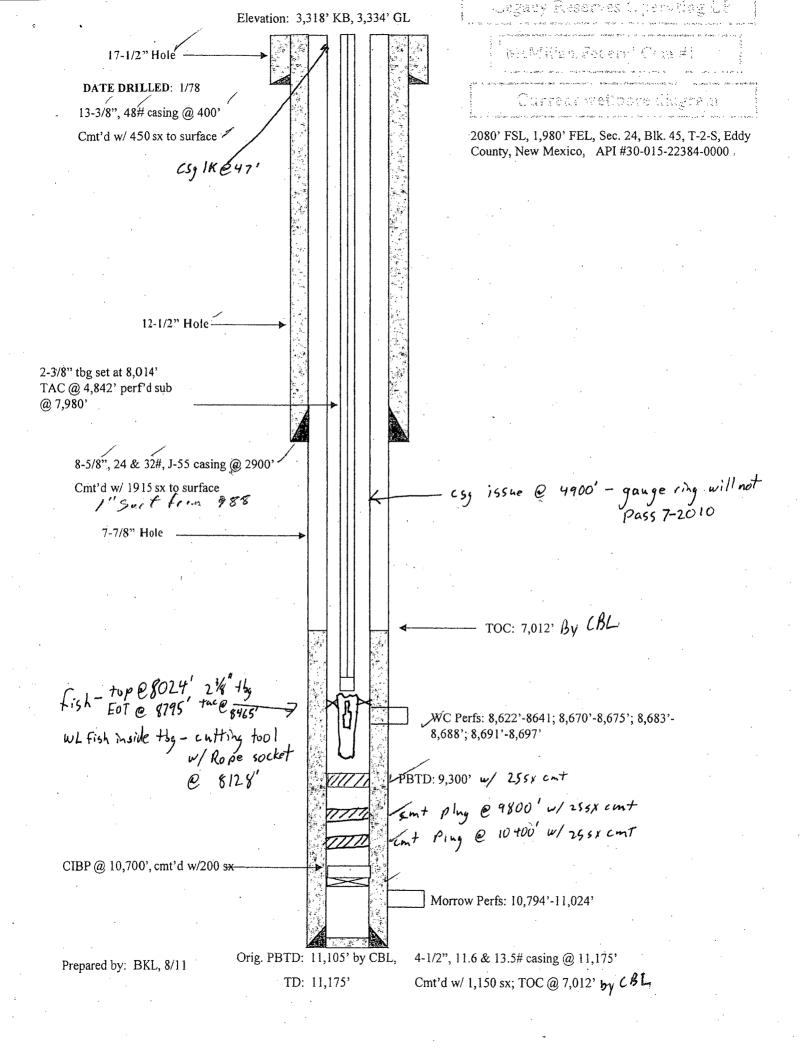

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

- 2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.
- 3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of **brine** water. Minimum nine (9) pounds per gallon.
- 5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. Dry Hole Marker: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off.

The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement, unless otherwise noted in COA (requirements will be attached). The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds).

- 7. <u>Subsequent Plugging Reporting:</u> Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date well was plugged.**
- 8. <u>Trash:</u> All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.