

Submit 3 Copies To Appropriate District  
Office  
District I  
1625 N. French Dr., Hobbs, NM 88240  
District II  
1301 W. Grand Ave., Artesia, NM 88210  
District III  
1000 Rio Brazos Rd., Aztec, NM 87410  
District IV  
1220 S. St. Francis Dr., Santa Fe, NM  
87505

State of New Mexico  
Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION  
1220 South St. Francis Dr.  
Santa Fe, NM 87505

C15F  
Form C-103  
Revised March 25, 1999

WELL API NO. 30-015-01664	
5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>	
6. State Oil & Gas Lease No.	
7. Lease Name or Unit Agreement Name: Empire Abo Unit	
8. Well No. E-28	
9. Pool name or Wildcat ABO	
10. Elevation (Show whether DR, RKB, RT, GR, etc.) KB= 12'	


**SUNDRY NOTICES AND REPORTS ON WELLS**  
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:  
Oil Well ☒ Gas Well ☐ Other ☐

2. Name of Operator  
B-P America Production Co. /

3. Address of Operator  
P.O. Box 1089 Eunice, N.M. 88231

4. Well Location  
Unit Letter A : 1160' feet from the North line and 330 feet from the East line  
Section 32 Township 17S Range 28E NMPM Eddy County

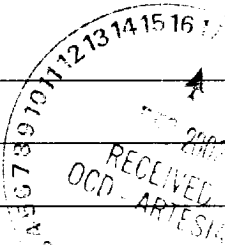

11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

- PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒
- TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
- PULL OR ALTER CASING ☐ MULTIPLE COMPLETION ☐
- OTHER: ☐

SUBSEQUENT REPORT OF:

- REMEDIAL WORK ☐ ALTERING CASING ☐
- COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐
- CASING TEST AND CEMENT JOB ☐
- OTHER: ☐

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

CIBP @ 5750'. 5 1/2 csg. T.D. 6100'. PBTD 6046'. Hole in csg. above CIBP.

Required: Press. Test CIBP @ 5750'. Locate holes in csg. above CIBP & squeeze w/cmt.

PROCEDURE TO P&A WELL:

- (1) MIRU. ND well head. NU BOP & Enviro-vat.
- (2) RIH w/pkr. & tbg. to CIBP @ 5750'. Press. Test CIBP & locate csg. leak.
- (3) POH w/tbg. & pkr. RIH w/ OET to CIBP.
- (4) Circulate hole w/9.5# salt gel mud.
- (5) Cap CIBP w/25 sxs. of cement.
- (6) POH w/tbg. to 3307' & spot 25 sx. cmt plug at 3307' to 3207'. Glorieta.
- (7) POH w/tbg. to 767' & spot 25 sx. cmt. plug @ 767' to 667'. WOC. Tag.
- (8) POH w/tbg. to 60' & spot 10 sx. cmt. plug 60' to surface.
- (9) Cut off well head & anchors 3'BGL. Clean up location & set dry hole marker.

Notify OGD 24 hrs. prior to any work done

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Kelvie D. Murrish TITLE Sr Admin. Asst. DATE 12.11.02

Type or print name Kelvie D. murrish Telephone No. 505.394.1600  
(This space for State use)

APPROVED BY [Signature] TITLE Field Rep DATE DEC 31 2002

Conditions of approval, if any: