
SEE ATTACHMENT 18. I hereby certify that the fore SIGNED J. C. Mc. (This space for Federal or Signeral control of the space for Federal control of the space for	al BOP TIT	RECEIVED JUL 27 '90 AMERICA CHECE	DATE	Jul 23 8 35 AH '90 AREA FIRST CROSS	RECEIVED	
	going is true and correct	JUL 27 '90		23 8 35 AH	m	
SEE ATTACHMENT		JUL 27 '90		23 8 35 AH	m	
SEE ATTACHMENT		JUL 27 '90		23 8 35 AH	m	
SEE ATTACHMENT		JUL 27 '90		23 8 35 AH	m	
SEE ATTACHMENT				23 8 EA FILL	m	
SEE ATTACHMENT				m P		
SEE ATTACHMENT						
17. DESCRIBE PROPOSED OR COMPLI proposed work. If well is nent to this work.) •	ETED OPERATIONS (Clearly state a directionally drilled, give subsu	Il pertineut details, and give pertinent di rface locations and mensured and true ve	ates, including es ertical depths for	timated date of a all markers and	tarting an sones perti	
REFAIR WELL (Other)	CHANGE PLANS	(Other) (Nork: Report red Completion or Rec	ompletion Report	and Log form.)		
FRACTURE TREAT SHOOT OR ACIDIZE	MULTIPLE COMPLETE ABANDON*	FRACTURE TREATMENT X SHOOTING OR ACIDIZING	l— !	ALTERING CASING ABANDONMENT	-	
TEST WATER SHUT-OFF	PULL OR ALTER CASING	WATER SHUT-OFF		REPAIRING WELL		
	eck Appropriate Box To In	dicate Nature of Notice, Report, and	or Other Data	OF:		
11. FERRITA 110.	i	whether DF, RT, QR, etc.) 65 GL	Eddy	OR PARISH 13.	NM NM	
14. PERMIT NO.			t e	8, T-17-S,		
	, 2130' FLS & 1980'	FWL	11. SEC., T	Seven Rive		
P.O. Box 730, Hob 4. LOCATION OF WELL (Report to See also space 17 below.) At Burface	bs, NM 88240 ocation clearly and in accordance	with any State requirements.		AND POOL, OR WIL		
Texaco Producing 3. ADDRESS OF OPERATOR			9. WELL N	Skelly Unit 9. WELL NO.		
2. NAME OF OPERATOR	T		8. FARM OF	y Unit		
		for such proposals.)		REEMENT NAME		
1.	APPLICATION FOR PERMIT—	or plug back to a different reservoir.	Į.			
(Do not use this form for Use "A	NOTICES AND REPORT PROPORTIES TO BE		6. IF INDIA	AN, ALLOTTEE OR S	TRIBE NAME	
SUNDRY (Do not use this form for Use ")		GEMENT ORTS ON WELLS	LC-02	29420-B		

SKELLY UNIT WELL NO. 155Proposed Plugging Procedure

1) Backflow well. ..

2) Inform BLM 24 hrs. prior to commencement of work.

- 3) MIRU pulling unit. Pull rods and pump. Install BOP. Pull tubing.
- 4) By wireline. RIH with CIBP and set at 2320'. Cap with 35' of cement using a dump bailer.
- 5) RIH with tubing to PBTD. Load hole with salt gel mud consisting of 10 lb. brine with 25 lbs. of gel per barrel.
- 6) Pull up and spot a 25 sx plug of Class "C" cement (1.32 cuft/sx) from 1810'-1625' (base of salt 1625'). Tag plug.
- 7) Pull up and spot a 25 sx plug of Class "C" cement (1.32 cuft/sx) from 700'-515' (top of salt 655', surface casing shoe at 648'). Tag plug.
- 8) Pull up and pump 7 sx of Class "C" cement (1.32 cuft/sx) from 50'-surface.
- 9) Cut off wellhead. Install marker. Clean location.

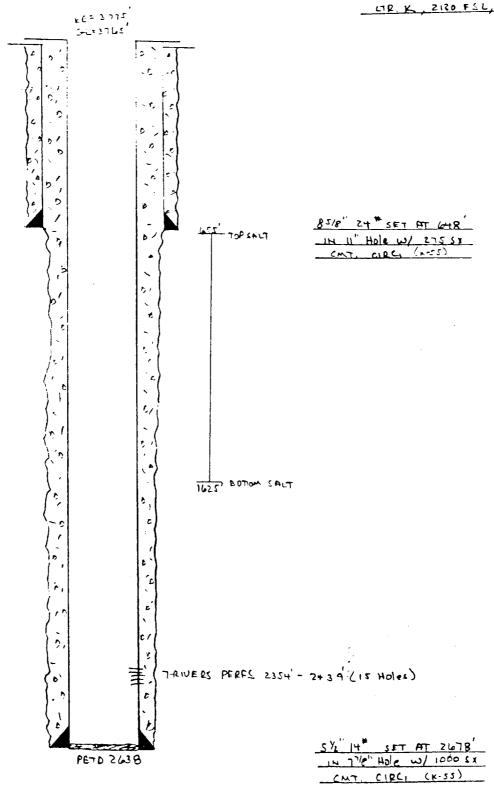

.....

