


STATE OF NEW MEXICO  
ENERGY AND MINERALS DEPARTMENT

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S	
LAND OFFICE	
OPERATOR	

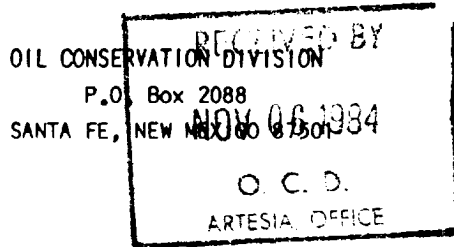

Form C-103  
Revised 10-1-78

5a. Indicate Type of Lease	
State <input type="checkbox"/>	Fee <input checked="" type="checkbox"/>

5. State Oil & Gas Lease No.
-

SUNDRY NOTICES AND REPORTS ON WELLS  
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT-" (FORM C-1011 FOR SUCH PROPOSALS.)

1. OIL WELL <input type="checkbox"/>	GAS WELL <input type="checkbox"/>	OTHER Dry hole
--------------------------------------	-----------------------------------	----------------

2. Name of Operator
Read & Stevens, Inc. ✓

3. Address of Operator
P.O. Box 1518, Roswell, NM 88201

4. Location of Well
UNIT LETTER <u>F</u> 1980 FEET FROM THE <u>West</u> LINE AND 1980 FEET FROM THE <u>North</u> LINE. SECTION <u>30</u> TOWNSHIP <u>18S</u> RANGE <u>27E</u> NMPM

7. Unit Agreement Name
-

8. Farm or Lease Name
Fair

9. Well No.
1

10. Field and Pool, or Wildcat
<u>Wildcat Yeso</u>

5. Elevation(Show whether DF,RT,GR,etc.)
3279.3' GR

12. County	XXXXXXXXXXXXXXXXXX
Eddy	XXXXXXXXXXXXXXXXXX

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data  
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input checked="" type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	
OTHER <input type="checkbox"/>	

REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
CASING TEST AND CEMENT JOB <input type="checkbox"/>	
OTHER <input type="checkbox"/>	

Describe Proposed or Completed Operations(Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

- 1) Set CIBP @ 3100', dump 35' of cmt on plug w/dump baller.
- 2) Load hole w/mud.
- 3) Cut csq @ +2100', spot 40sx plug half in and half out of csq stub, 2150'-2050', WOC 8hrs, tag plug.
- 4) Spot 40sx plug half in and half out of 8 5/8" csq shoe @ 1808', 1858'-1758', tag plug.
- 5) Spot 35sx plug at surface pipe, shoe @ 285', 235'-335'.
- 6) Spot 15sx surface plug w/dry hole marker.
- 7) Clean location, cover pits and prep for inspection.

SIGNED <u>B. Stubbs</u>	TITLE <u>Drilling &amp; Production Manager</u>	DATE <u>11-5-84</u>
-------------------------	--	---------------------

APPROVED BY <u>M. Williams</u>	TITLE <u>OIL AND GAS INSPECTOR</u>	DATE <u>NOV 13 1984</u>
--------------------------------	------------------------------------	-------------------------

CONDITIONS OF APPROVAL, IF ANY:

Notify N.M.D.C.C. in sufficient time to allow  
Plugging