

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

RECEIVED

NOV 6 1990

O. C. D.
APPROVED

FORM APPROVED
Budget Bureau No. 1004-0135
Expires: March 31, 1993

5. Lease Designation and Serial No.

NMA 32594

6. If Indian, Allottee or Tribe Name

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals

SUBMIT IN TRIPLICATE

1. Type of Well

☐ Oil Well ☒ Gas Well ☐ Other

2. Name of Operator

Robert N. Enfield

3. Address and Telephone No.

Box 2431 Santa Fe, New Mexico 87501

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

660 FNL & 660 FEL of Sec 18, Twp 19-S, Rg 27-E

7. If Unit or CA, Agreement Designation

8. Well Name and No.

Federal "18"-1

9. API Well No.

10. Field and Pool, or Exploratory Area

North Lake McMillan (Morro)

11. County or Parish, State

Eddy Co., N. Mexico

12. CHECK APPROPRIATE BOX(s) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

- ☒ Notice of Intent
☐ Subsequent Report
☐ Final Abandonment Notice

TYPE OF ACTION

- ☒ Abandonment
☐ Recompletion
☐ Plugging Back
☐ Casing Repair
☐ Altering Casing
☐ Other


- ☐ Change of Plans
☐ New Construction
☐ Non-Routine Fracturing
☐ Water Shut-Off
☐ Conversion to Injection
☐ Dispose Water

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

Intent is to plug and abandon

1. Load hole with 10#/gallon gelled mud, release packer and circulate tubing and casing with mud.
2. Pull tubing and set a CIBP at 9600' with 35' cement on plug.
3. Free point and cut casing at approximately 5000' (TOC on temp survey is 5800').
4. Set a 20 sx plug at 5000' - 50' in 5-1/2" casing cut-off.
5. Set a 40 sx plug at 2150' - 2250'.
6. Set a 40 sx plug at 250' - 350'.
7. Set a 10 sx plug at surface.
8. Install dry hole marker and clean location.

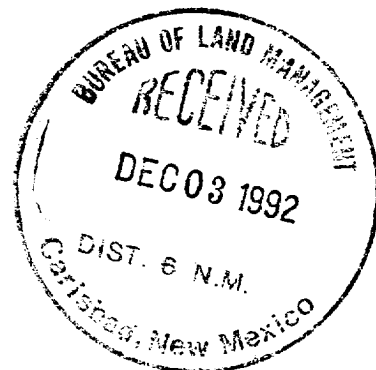

14. I hereby certify that the foregoing is true and correct

Signed

Agent for R. N. Enfield

Date November 17, 1992

(This space for Federal or State office use)


Approved by

Title

Date

Conditions of approval, if any:

Federal "18"-1

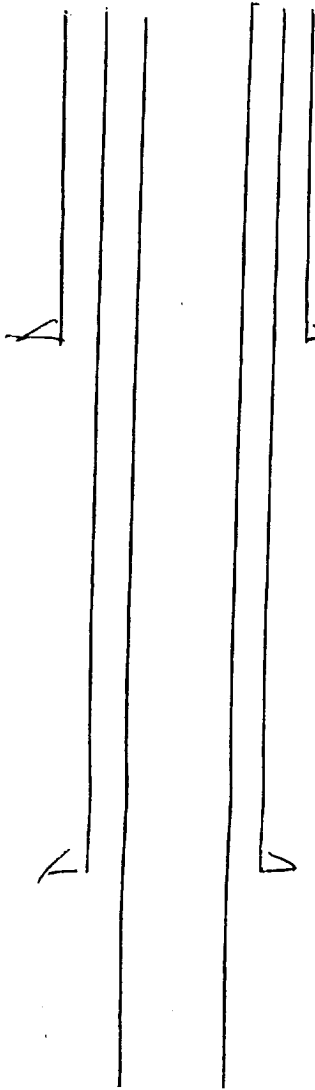

13-3/8 set @ 300'

TOC (circulated)
50s x to pit

8-5/8 set @ 2200'

cmt circulated
100 3x to pit