

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
GEOLOGICAL SURVEY

SUBMIT IN TRIPPLICATE\*  
(Other instructions on reverse side)

Form approved.  
Budget Bureau No. 42-R1424.

5. LEASE DESIGNATION AND SERIAL NO.  
L.M. Phillips No. 7  
NM 070322  
6. IF INDIAN, ALLOTTEE OR TRIBE NAME

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.  
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>		7. UNIT AGREEMENT NAME Carson Unit	
2. NAME OF OPERATOR SHELL OIL COMPANY		8. FARM OR LEASE NAME	
3. ADDRESS OF OPERATOR 1700 BROADWAY, DENVER, COLORADO 80202		9. WELL NO. 33-15	
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.* See also space 17 below.) At surface  1980' FSL & 1980' FEL of Sec. 15, T25N, R12W, N.M.P.M., San Juan Co., N.M.		10. FIELD AND POOL, OR WILDCAT  Bisti	
14. PERMIT NO.		11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA T25N, R12W	
15. ELEVATIONS (Show whether DF, RT, GR, etc.) 6235' D.F.		12. COUNTY OR PARISH San Juan	
		13. STATE N.M.	

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
TEST WATER SHUT-OFF <input type="checkbox"/>	PULL OR ALTER CASING <input type="checkbox"/>	WATER SHUT-OFF <input type="checkbox"/>	REPAIRING WELL <input type="checkbox"/>
FRACTURE TREAT <input type="checkbox"/>	MULTIPLE COMPLETE <input type="checkbox"/>	FRACTURE TREATMENT <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
SHOOT OR ACIDIZE <input type="checkbox"/>	ABANDON* <input checked="" type="checkbox"/>	SHOOTING OR ACIDIZING <input type="checkbox"/>	ABANDONMENT* <input type="checkbox"/>
REPAIR WELL <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	(Other) <input type="checkbox"/>	

(NOTE: Report results of multiple completion on Well Completion or Reconpletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)\*

SEE ATTACHED ABANDONMENT PROGNOSIS

18. I hereby certify that the foregoing is true and correct

SIGNED

*J. W. Dinnel*

TITLE Division Operations Engineer

DATE SEP 19 1975

(This space for Federal or State office use)

APPROVED BY

TITLE

DATE

CONDITIONS OF APPROVAL, IF ANY:

\*See Instructions on Reverse Side

Prognosis  
Plug and Abandonment  
Carson Unit 33-15  
Section 15, T 25N, R 12W  
San Juan County, New Mexico


Pertinent Data

TD: 4865 PBTD: 4863  
8 5/8 Csg. @ 100  
4 1/2 Csg. @ 4863 w/ 150 sax. with 4% gel  
7 7/8 Hole

Elevation: 6237  
KB - GL = 9  
Permanent Datum = KB  
Past and current status: Presently TA'd  
Completed 3/6/60 flowed 33 BOD  
142 MCF/Day

Proposed Work: Plug and Abandon

1. Pull equipment. If tubing is openended, lower to PBTD, load hole with mud. (Add 20 sax aquagel + 1 sack Benex per 100 bbls of mud or 20 sax salt gel per 10 bbls mud).
2. Spot 20 sax Class "G" cement mixed w/1# floccle/sack over perforations and above perforations. Minimum requirements - 100' cement plug above perforations.
3. Pull tubing.
4. Rig up casing pullers.
5. Attempt to shoot and pull casing. (theoretical cement top at 3865. Top of Mancos Shale 3684. If unable to pull any casing, go to step 8.
6. If casing is recovered, run tubing OE and spot Class "G" cement plugs as follows:
  - a. 150' plug across stub of 4-1/2" casing. (50' in casing, 100' in open hole)
  - b. 200' plug from top of Fruitland Coal at 990 to 1190.
  - c. 150' plug across base of Ojo Alamo sand at 250. (100' below base of sand and 50' above base of sand).
  - d. 100' plug across shoe of 8-5/8" casing. (30' in casing, 70' in open hole).
  - e. 10 sack plug at surface.

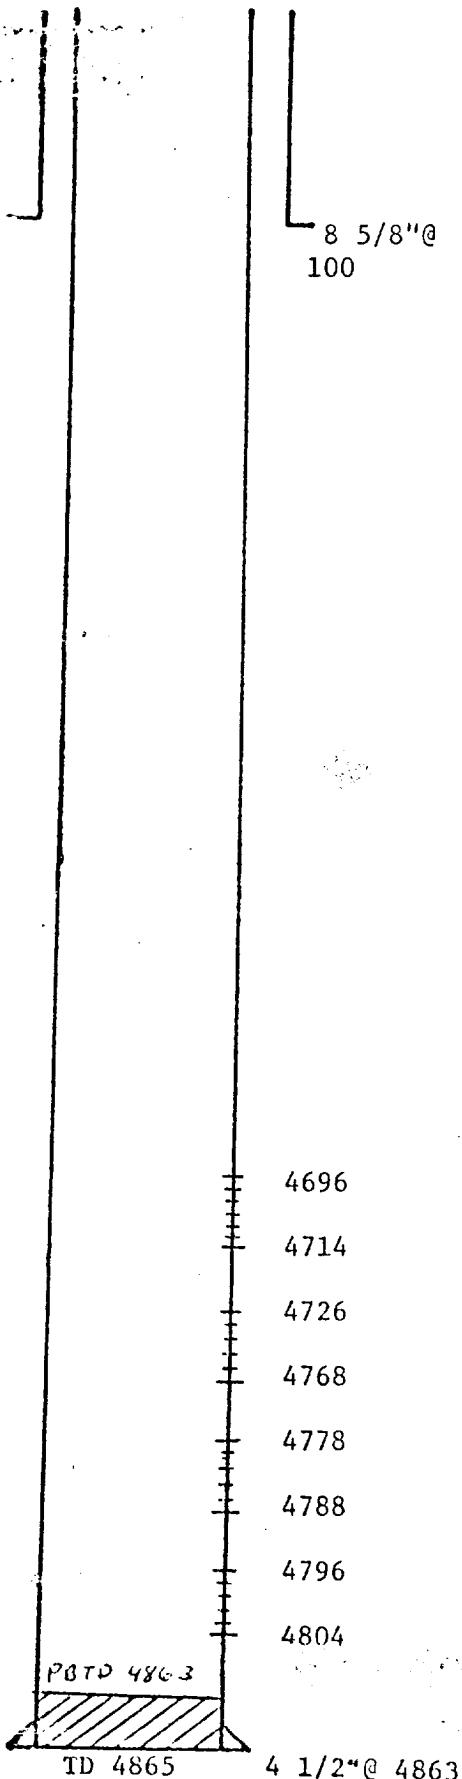

7. Install permanent abandonment marker as follows:

Steel marker at least 4 inches in diameter set in concrete and extending at least 4' above mean ground level. The name and number of the well and its location (Unit letter, section, township and range) shall be welded, stamped, or otherwise permanently engraved into the metal marker.

8. Perforate 4-1/2" casing w/4 JSPF as follows:

- a. Fruitland Coal - Pictures Cliffs interval 1040 to 1041.
- b. Below Ojo Alamo sand from 350 to 351.

- 9. Run tubing, spot a 50 sack (10.3 bols, 630' in 4-1/2" casing) Class "G" cement plug from 1040 to 410.
- 10. Pull tubing to  $\pm 400'$ , close bradenhead, displace 20 sax through perforations 1040 to 1041. WOC 2 hours.
- 11. Pull tubing to perforations 350 to 351.
- 12. Load 4-1/2" casing with cement ( $\pm$  35 sax) and pull tubing. With bradenhead open, displace 20 sax cement through perforations 350 to 351.
- 13. Spot 10 sack plug at surface.
- 14. Install abandonment marker as outlined in step 7.

BK/KWL

  
J. A. Stanzione