

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUBMIT IN TRIPPLICATE*
(Other instructions on re-
verse side)

Form approved.
Budget Bureau No. 42-R1424

5. LEASE DESIGNATION AND SERIAL NO.
L. M. Phillips No. 1

SF 078063

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL ☒ GAS WELL ☐ OTHER ☐

2. NAME OF OPERATOR
Shell Oil Company

3. ADDRESS OF OPERATOR
1700 Broadway, Denver, Colorado 80202

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.*
See also space 17 below.)
At surface
1813' FSL & 530' FWL of Sec. 7, T25N,
R11W, NMPM, San Juan Co., N.M.

14. PERMIT NO.
15. ELEVATIONS (Show whether DF, RT, CR, etc.)
6317.38' KB

7. UNIT AGREEMENT NAME
Carson Unit

8. FARM OR LEASE NAME

9. WELL NO.
3-7

10. FIELD AND POOL, OR WILDCAT
Bisti

11. SEC., T., R., M., OR BLK. AND
SURVEY OR AREA
Sec. 7, T25N,
R11W, NMPM

12. COUNTY OR PARISH
San Juan
13. STATE
N.M.

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF ☐ PULL OR ALTER CASING ☐
FRACTURE TREAT ☐ MULTIPLE COMPLETE ☐
SHOOT OR ACIDIZE ☐ ABANDON* ☒
REPAIR WELL ☐ CHANGE PLANS ☐
(Other) ☐

SUBSEQUENT REPORT OF:

WATER SHUT-OFF ☐ REPAIRING WELL ☐
FRACTURE TREATMENT ☐ ALTERING CASING ☐
SHOOTING OR ACIDIZING ☐ ABANDONMENT* ☐
(Other) ☐

(NOTE: Report results of multiple completion on Well
Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.) *

See attached abandonment prognosis



18. I hereby certify that the foregoing is true and correct

SIGNED L. Plauty

TITLE Division Operations Engr.

DATE JUN 22 1977

(This space for Federal or State office use)

APPROVED BY _____
CONDITIONS OF APPROVAL, IF ANY:

TITLE _____


DATE _____

cc: NMOCC

Obaf

*See Instructions on Reverse Side

24" $\frac{8\frac{5}{8}}{226}$ "

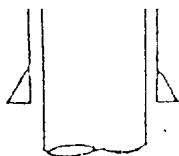

Plug and Abandonment
Carson Unit 3-7
Section 7, T 25 N, R 11 W
San Juan County, New Mexico

Pertinent Data

TD: 5004' PBD: 4980'
8 5/8" Csg. @ 226'

5 1/2" Csg. @ 5002' w/ 200 sax.

7 7/8" Hole

Elevation: 6317' KB


KB - GL = 11'

Permanent Datum = KB

Past and current status: Presently T.A'd.
Has only 4' ML pay. Hole in flowline.
Initial prod: Pumped 58 BDO.

Proposed Work: Plug and Abandon

1. Pull equipment. If tubing is openended, lower to PBD, load hole with mud. (Add 20 sax aquagel + 1 sack Benes per 100 bbls of mud or 20 sax salt gel per 100 bbls mud).
2. Spot 30 sax Class "G" cement mixed w/1# flocele/sack over perforations and above perforations. Minimum requirements - 100' cement plug above perforations. W.L.C. 12 hrs.
3. Pull tubing.
4. Rig up casing pullers. Determine casing free point.
5. Attempt to shoot and pull casing at free point (theoretical cement top at 3670'). Top of Mancos Shale 3680'. Do not spend more than 3 hrs. on attempt to pull casing. If unable to pull any casing go to step 8.
6. If casing is recoverable, place cement plugs by cementing through casing or running tubing inside of csg. as it is pulled. Spot Class "G" cement plugs as follows:
 - a. 150' plug across stub of 5 1/2" casing. (50' in casing, 100' in open hole)
 - b. 200' plug from top of Fruitland Coal at 1170' to 1370'.
 - c. ~~150' plug across base of Ojo Alamo sand at~~ 100' below base of sand and 50' above base of sand.
 - * d. 200' plug across shoe of 8-5/8" casing (30' in casing, 170' in open hole).
 - e. 10 sack plug at surface.

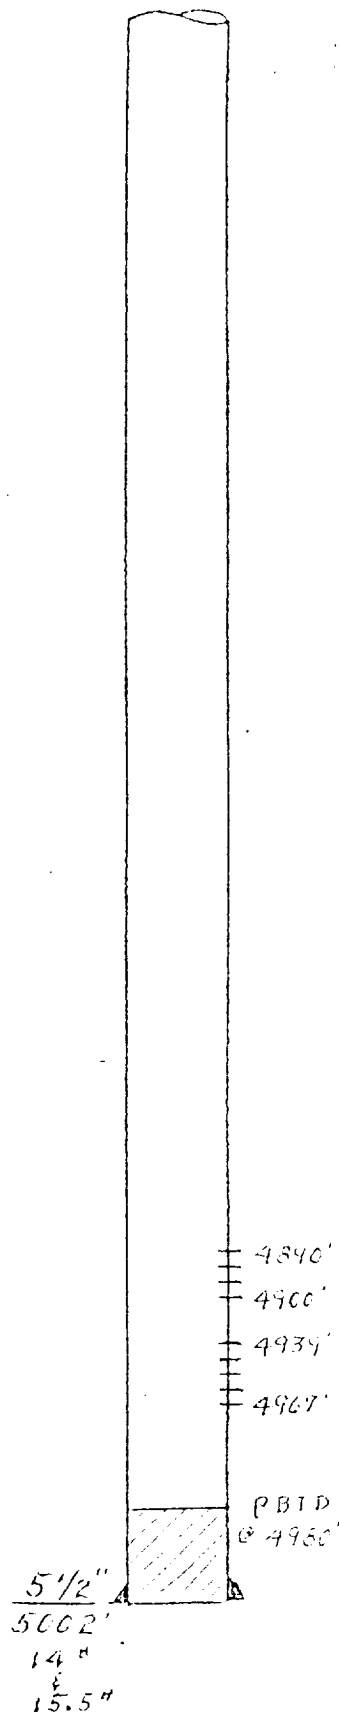

* Provides 100' cement below base of Ojo Alamo

7. Install permanent abandonment marker as follows:

Steel marker at least 4 inches in diameter set in concrete and extending at least 4' above mean ground level. The name and number of the well and its location (Unit letter, section, township and range) shall be welded, stamped, or otherwise permanently engraved into the metal marker.

(Continuation from Step 5)

8. Perforate 5 1/2" casing w/4 JSPP as follows:
- a. Fruitland Coal - Pictures Cliffs interval 1170' to 1171'.
 - b. Below Ojo Alamo sand from 390' to 391'.
9. Run tubing, spot a 50 sack Class "G" cement plug from 1170' to 745'.
10. Pull tubing to $\pm 400'$, close bradenhead, displace 20 sax through perforations 1170' to 1171'. WOC 2 hours.
11. Pull tubing to perforations 390' to 391'.
12. Load 5 1/2" casing with cement (\pm 40 sax) and pull tubing. With bradenhead open, displace 20 sax cement through perforations 390' to 391'.
13. Spot 10 sack plug at surface.
14. Install abandonment marker as outlined in step 7.

gac
COC:maf

J. A. Stanzione