

SF-080516A

5. Lease Number
~~SF 08056-A~~
6. If Indian, All. or
Tribe Name
7. Unit Agreement Name
San Juan 28-5 Unit
8. Well Name & Number
San Juan 28-5 U #17
9. API Well No.
30-039-07364
10. Field and Pool
Blanco MV
11. County and State
Rio Arriba Co., NM

It is intended to repair the tubing on the subject well according to the attached procedure.

RECEIVED
JAN 15 1938

OIL CON. DIV.
DIST. 3

- Signed [Signature] (ROS8) Title Regulatory Admin. Date 12/31/97

APPROVED BY /s/ Duane W. Spencer Title _____ Date JAN 13 1998
CONDITION OF APPROVAL, if any: _____

NMOCB

San Juan 28-5 Unit # 17

Mesaverde

1475'S 1825'W

Unit K, Section 20, T-28-N, R-05-W

Latitude / Longitude: 36° 38.60' / 107° 23.08'

DPNO: 49800A

Tubing Repair Procedure

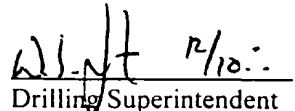
1. Hold safety meeting. Comply with all NMOCD, BLM and Burlington safety and environmental regulations. Test rig anchors and build blow pit prior to moving in rig. **Notify BROG Regulatory (Peggy Bradfield 326-9727) and the appropriate Regulatory Agency prior to pumping any cement job. If an unplanned cement job is required, approval is required before the job can be pumped. If verbal approval is obtained, document approval in DIMS/WIMS.** Allow as much time as possible prior to pump time in case the Agency decides to witness the cement job.
2. MOL and RU workover rig. Obtain and record all wellhead pressures. NU relief line. Blow well down and kill with 2% KCL water if necessary. NU BOP with stripping head. Test and record operation of BOP rams. Have wellhead and valves serviced as necessary. Test secondary seal and replace/install as necessary.
3. Release donut, pick up additional joints of tubing and tag bottom. (Record depth.) TOO H with tubing. Visually inspect tubing for corrosion and replace any bad joints. Check tubing for scale build up and notify Operations Engineer.
4. If casing requires clean out, TIH with bit and bit sub and CO to PBTD prior to running casing scraper. Roundtrip casing scraper and bit to below perforations. (Do not clean out with casing scraper.) PU above perforations and flow the well naturally, making short trips for clean up when necessary. TOO H.
5. TIH with 2-3/8" tubing with an expendable check on bottom and a seating nipple one joint off bottom. Rabbit all tubing. CO to PBTD.
6. Land tubing near 5830'. ND BOP and NU wellhead. Pump off expendable check. Obtain final pitot gauge up the tubing. If well will not flow on its own, make swab run to seating nipple. If a swab run is not necessary, run a broach on slickline to ensure that the tubing is clear. RD and MOL. Return well to production.

Recommended:


Operations Engineer

12-7-97

Approved:


Drilling Superintendent

Rob Stanfield
Office - (326-9715)
Home - (327-7646)
Pager - (324-2674)