

submitted in lieu of Form 3160-5

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

RECEIVED
BLM

Sundry Notices and Reports on Wells

99 AUG 23 PM 2:38

070 FARMINGTON, NM

1. Type of Well
GAS

5. Lease Number
SF-078508
6. If Indian, All. or
Tribe Name

2. Name of Operator

7. Unit Agreement Name

**BURLINGTON
RESOURCES**

OIL & GAS COMPANY

3. Address & Phone No. of Operator

8. Well Name & Number
Nordhaus #7

PO Box 4289, Farmington, NM 87499 (505) 326-9700

9. API Well No.
30-045-11084

4. Location of Well, Footage, Sec., T, R, M

10. Field and Pool
Blanco Mesaverde

990' FNL, 990' FWL, Sec.1, T-31-N, R-9-W, NMMPM

11. County and State
San Juan Co, NM

12. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OTHER DATA

Type of Submission

Type of Action

<input checked="" type="checkbox"/> Notice of Intent	<input type="checkbox"/> Abandonment	<input type="checkbox"/> Change of Plans
<input type="checkbox"/> Subsequent Report	<input type="checkbox"/> Recompletion	<input type="checkbox"/> New Construction
<input type="checkbox"/> Final Abandonment	<input type="checkbox"/> Plugging Back	<input type="checkbox"/> Non-Routine Fracturing
	<input type="checkbox"/> Casing Repair	<input type="checkbox"/> Water Shut off
	<input type="checkbox"/> Altering Casing	<input type="checkbox"/> Conversion to Injection
	<input checked="" type="checkbox"/> Other - Tubing Repair	

13. Describe Proposed or Completed Operations

It is intended to repair the tubing and install a plunger lift in the subject well according to the attached procedure.

14. I hereby certify that the foregoing is true and correct.

Signed [Signature] Title Regulatory Administrator Date 8/23/99
trc

(This space for Federal or State Office use)

APPROVED BY [Signature] Title _____ Date SEP 1 1999
CONDITION OF APPROVAL, if any:

Title 18 U.S.C. Section 1001, makes it a crime for any person knowingly and willfully to make any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

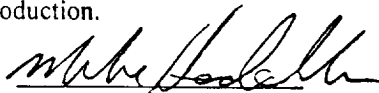
NMOCO

Nordhaus #7
Blanco Mesaverde, DPNO: 3227501
990'FNL, 990' FWL
Unit A, Section 01, T-31-N, R-09-W
Latitude: 36° 55.8618', Longitude: 107° 43.54158'

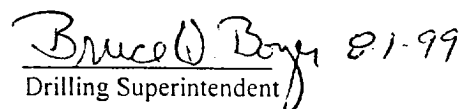
Tubing Repair Procedure / Plunger Lift Installation

1. Hold safety meeting. Comply with all NMOCD, BLM and Burlington safety and environmental regulations. Test rig anchors and build blow pit prior to moving in rig. Notify **BROG Regulatory (Peggy Bradfield 326-9727)** and the appropriate Regulatory Agency prior to pumping any cement job. If an unplanned cement job is required, approval is required before the job can be pumped. If verbal approval is obtained, document approval in DIMS. Allow as much time as possible prior to pump time in case the Agency decides to witness the cement job.
2. MOL and RU workover rig. Hold daily safety meetings. Obtain and record all wellhead pressures. NU relief line. Blow well down and kill with 2% KCL water if necessary. ND WH and NU BOP with stripping head. Test and record operation of BOP rams. Have wellhead and valves serviced as necessary. Test secondary seal and replace/install as necessary.
3. 2-3/8" tubing is set at 5384'. Release donut, pick up additional joints of tubing and tag bottom. (Record depth.) PBDT should be at +/-6079'. TOO H with tubing. Visually inspect tubing for corrosion and replace any bad joints. Check tubing for scale build-up and notify Operations Engineer.
4. If fill is encountered, TIH with 4-3/4" bit, bit sub and watermelon mill on 2-3/8" tubing and round trip to below perforations, cleaning out with air/mist. **NOTE: When using air/mist, minimum mist rate is 12 bph.** If scale is present, contact Operations Engineer to determine methodology for removing scale from casing and perforations. TOO H.
5. TIH with one joint of 2-3/8" tubing with an expendable check on bottom and a seating nipple one joint off bottom then 1/2 of the 2-3/8" production tubing. Run a broach on sandline to insure that the tubing is clear. TIH with remaining 2-3/8" tubing and an additional 606', then broach this tubing. Replace any bad joints. CO to PBDT with air/mist. PU above the perforations and flow the well naturally, making short trips for clean up when necessary.
6. Land tubing at ±5990'. ND BOP and NU WH. Pump off expendable check. Connect to casing and circulate air to assure that expendable check has pumped off. Obtain pitot gauge up the tubing. If well will not flow up the tubing, make swab run to SN. RD and MOL.
7. Production Operations will install plunger lift.
8. Return well to production.

Recommended:


Operations Engineer

Approved:

 8-1-99
Drilling Superintendent

Operations Engineer: Mike Haddenham
BR Office - 326-9577
Pager - 327-8427
Home - 326-3102

MDH/smk
7/19/1999