Form 3160-5 (April 2004)	UNITED STATES. DEPARTMENT OF THE I	NTEDIAD	Hobbs	FORM APPROVED OM B No. 1004-0137 Expires: March 31, 2007
	BUREAU OF LAND MANA	GEMENT	5. Lease S	
	RY NOTICES AND REPO		HOBBS OCD	NM24683
Do not use	e this form for proposals to	drill or to re-enter and a such proposals	n 6. If Ind	ian, Allottee or Tribe Name
apandoned	i well. Use Form 3160 - 3 (Al	D) for such proposals	DEC 1 3 2012	
SUBMIT IN	TRIPLICATE- Other instru	ctions on reverse sid	e. 7. If Uni	t or CA/Agreement, Name and/or No.
	· · · · · · · · · · · · · · · · · · ·		RECEIVED	,
1. Type of Well Oil Well	Gas Wellt Other		8. Well 1	Name and No.
2. Name of Operator OXY US	A Inc.	16696	9. API	Well No.
a. Address P.O. Box 50250 Midland	, TX 79710	Bb. Phone No. (include area cod 432-685-5717		and Pool, or Exploratory Area
	ec., T., R., M., or Survey Description)		······································	Ridge Morrow (Ga
	FWL NWSW(L) Se	(17 T225 R3	3E / 11. Coun	ty or Parish, State
	AME MASALES JE			a NM
12. CHECK	APPROPRIATE BOX(ES) TO I	VDICATE NATURE OF N	NOTICE, REPORT, (OR OTHER DATA
TYPE OF SUBMISSION		TYPE OF A	CTION	
	Acidize	Deepen	oduction (Start/Resume)	Water Shut-Off
Notice of Intent	Alter Casing		clamation	Well Integrity
Subsequent Report	Casing Repair	New Construction Re	complete	Mother Fish Tbs
	Change Plans	Plug and Abandon Te	mporarily Abandon	
Final Abandonment Notice	Convert to Injection] Plug Back 🛛 🗌 Wa	ater Disposal	
	. ·			`
	SI	EE ATTACHED		
4. I hereby certify that the f	oreaging in true and garraget			
 Inereory certify matther Name (Printed/Typed) 	stegoing is the and correct			
David Stewar	t	Title Regulator	y Advisor	
Signature	11			
Signature	STO-	Date	212011200	TOT FOR RECORD
	THIS SPACE FOR FE	DERAL OR STATE	OFFICE USE	
ertify that the applicant holds le	re attached. Approval of this notice doe egal or equitable with to those rights in the	ne subject lease		POEC 1 1 2012
itle 18 U.S.C. Section 1001 and	it to conduct oper Vipe View D Fitle 43 U.S.C. Section 1212, make it a cr dulent statements or representations as t	12-18-2012 ime for any person knowingly a	and willfully to make to	AN OF LAND MANAGEMENT ARISBADELELEOUFFICEDE United
Instructions on page 2)	Success Successing of Tepresentations as 1			· · · · · · · · · · · · · · · · · · ·
inan nonono on puge 2)				\mathcal{N}
				\backslash
				DEC 1 9 2017

.

. . . .


۱

Date Remarks

6/5/12 MI PU, test anchors tomorrow

- 6/6/12 Test anchors, RU PU. RIH w/ slick line to set plug in profile nipple. 1.78 plug was to small. Ran thru packer and tagged fill @ 14,615'. Top perf is at 14,710'. POOH & run impression block. Profile nipple shows to be 1.87.
- 6/7/12 RU slick line, RIH & set 1.87 plug in profile nipple. Pres to 1000#, Held good. NDWH, NU BOP. Could not get on off tool to release.
- 6/8/12 Well had 2200# on tubing and casing on slight vac. Bleed down tubing. RU WL, RIH & shoot hole @ 13,959'. POOH w/ WL, Rig up and pump 600 BBIs 5% KCL water. Circulate well bore clean.
- 6/9/12 No pressure on tubing or casing. RU slickline, RIH & fish plug. POOH, RIH w/ jars and pull plug. Work w/ tubing and try to get seal assy. loose
- 6/11/12 RU WL, found tbg stuck @ pkr, was 100% FREE 10' UP, RIH w/ string shot & try to jar tbg free, could not.
- 6/12/12 RU WL cut tbg off @ 13970', POOH & RD WL.
- 6/13/12 RU tbg scanner. Scan out of the hole w/ the rest of tubing. Found 365 yellow, 55 blue, 13 green and 4 red. All bad jts. showed to have pitting. RD scanner. RIH w/ kill string.
- 6/14/12 POOH w/ Kill string. PU fishing tool , jars , bumper sub and 6 drill collars. RU tbg tester, start testing in hole. Ran 2-3/8" tubing and 160 jts of 2-7/8" tubing. RD tester.
- 6/15/12 RU tbg tester. Finish testing in the hole w/ tbg and fishing tool. Caught fish. Jar on pkr assy. Work w/ tbg for 2 hrs. Jared something loose. Pull about half way out of hole.
- 6/16/12 POOH w/ tbg & tools, had part of mandrel, was parted, break down tools. RIH w/ kill string.
- 6/18/12 Wait on orders, Order mill and equipment from Weatherford. Could not get mill till tomorrow.
- 6/19/12 RIH w/ mill , pkr plucker , drill collars & tbg, RIH to just above packer. Unload reverse unit.
- 6/20/12 RU reverse unit. PU swivel & begin milling on pkr, made 2-1/2', PU tbg, circ clean.
- 6/21/12 Begin milling on pkr, got rubber up, should have packing element drilled up. Mill quit drilling, try to start out of hole but mill was stuck. Start to jar on mill but weight indicator broke. Circ clean.
- 6/22/12 Jar on mill for 2 hrs, got loose. POOH w/ tbg & mill, mill was worn out. Run kill string in hole.
- 6/25/12 PU new mill & RIH w/ tbg, mill about 2 hrs, did not make anything, acts like we are on junk we already cut up.
- 6/26/12 Begin milling on pkr, only made about 3". PU & circ hole clean. RD swivel, POOH w/ 2-7/8" tbg.
- 6/27/12 POOH w/ 2-3/8" tubing. LD drill collars & mill. Pkr catcher had some junk wedged in it & would not let it catch anything. RIH w/ tbg w/ SN on bottom. ND BOP, NUWH.
- 6/28/12 RU WH, Test to 700#, held OK. RDPU

OXY USA Inc. - Current Federal EBR #1 API No. 30-025-27266

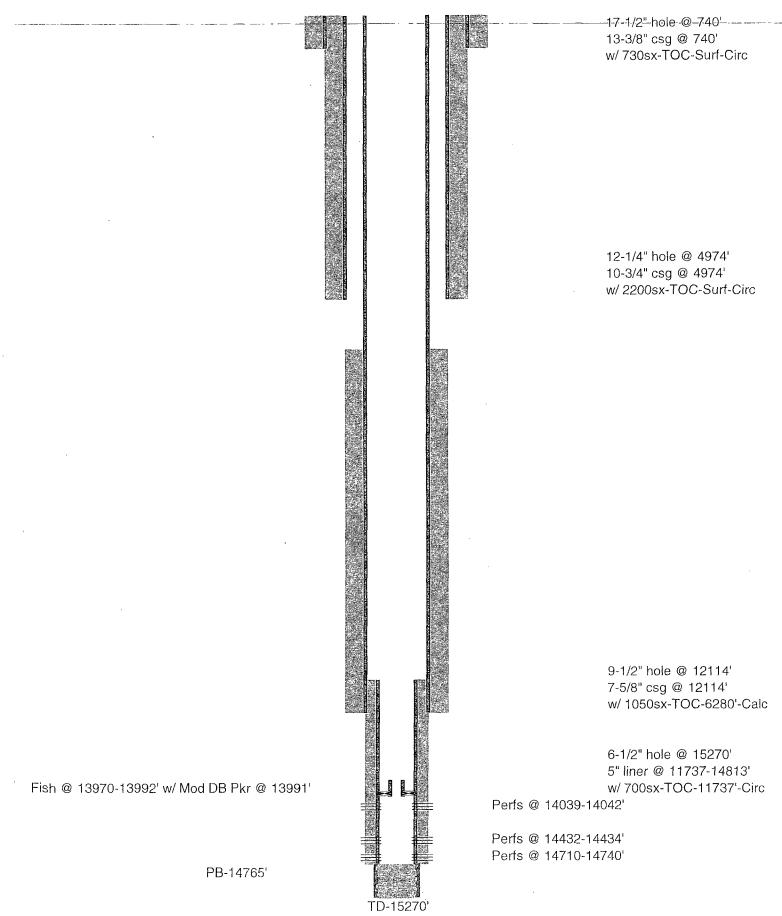

.