U.S. Department of the Interior
BUREAU OF LAND MANAGEMENT

Sunary Frint Report

Well Name: DOME FEDERAL 29-22-6

Well Location: T22N / R6W / SEC 29 / NESW / 36.10644 / -107.495087

County or Parish/State:

Well Number: 2

Type of Well: CONVENTIONAL GAS

SANDOVAL / NM

veli Number: 2

WELL

Allottee or Tribe Name:

Lease Number: NMNM6676

Unit or CA Name:

Unit or CA Number:

US Well Number: 300432040600S1

Well Status: Producing Gas Well

Operator: DUGAN

PRODUCTION CORPORATION

Notice of Intent

Sundry ID: 2645285

Type of Submission: Notice of Intent

Type of Action: Plug and Abandonment

Date Sundry Submitted: 11/22/2021

Time Sundry Submitted: 08:06

Date proposed operation will begin: 01/08/2022

Procedure Description: Dugan Production plans to plug and abandon the well as per the following procedure: 1) Set CIBP @ 1740'. Chacra perforations @ 1790'-1880'. Load casing. Pressure test casing to 600 psi. Run CBL from 1740' to surface. 2) Spot Plug I above CIBP inside 4-1/2", 10.5# casing from 1740' to 1360' w/34 sks (39 cu ft) Class G neat cement (1.15 cu ft/sk, 5 gal/sk mix water, 15.8#/gal). Chacra-PC, Plug I: 1360'-1740'. 3) Spot Plug II inside 4-1/2" casing from 850' to 750' w/12 sks (13.8 cu ft) Class G neat cement (1.15 cu ft/sk, 5 gal/sk mix water, 15.8#/gal). Fruitland, Plug II: 750'-850'. 4) Spot Plug III inside 4-1/2" casing from 520' to surface w/45 sks (52 cu ft) Class G neat cement. Surface-Ojo Alamo-Kirtland, Plug III: 0-520'. 5) Cut wellhead. Tag TOC at surface. Fill cement in case needed. 6) Install dry hole marker. Clean location.

Surface Disturbance

Is any additional surface disturbance proposed?: No

NOI Attachments

Procedure Description

Dome_Federal_29_22_6_2_reclamation_photo3_20211120081748.pdf

Dome_Federal_29_22_6_2_reclamation_photo4_20211120081748.pdf

Dome_Federal_29_22_6_2_reclamation_photo1_20211120081747.pdf

Dome_Federal_29_22_6_2_reclamation_photo5_20211120081748.pdf

Dome_Federal_29_22_6_2_reclamation_photo2_20211120081748.pdf

Received by OCD: 12/28/2021 3:40:45 PM

Well Name: DOME FEDERAL 29-22-6

Well Location: T22N / R6W / SEC 29 /

County or Parish/State: SANDOVAL / NM

NESW / 36.10644 / -107.495087

Type of Well: CONVENTIONAL GAS

Allottee or Tribe Name:

WELL

Lease Number: NMNM6676

Well Number: 2

Unit or CA Name:

Unit or CA Number:

US Well Number: 300432040600S1

Well Status: Producing Gas Well

Operator: DUGAN

PRODUCTION CORPORATION

Dome_Federal_29_22_6_2_planned_wellbore_schematic_20211120081402.pdf

Dome_Federal_29_22_6_2_current_wellbore_schematic_20211120081402.pdf

Dome_Federal_29_22_6_2_Reclamation_Plan_20211120081403.pdf

Operator Certification

I certify that the foregoing is true and correct. Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction. Electronic submission of Sundry Notices through this system satisfies regulations requiring a submission of Form 3160-5 or a Sundry Notice.

Operator Electronic Signature:

Signed on:

Name: DUGAN PRODUCTION CORPORATION

Title: Authorized Representative Street Address: PO Box 420

City: Farmington

State: NM

Phone: (505) 325-1821

Email address: tyrafeil@duganproduction.com

Field Representative

Representative Name: ALIPH REENA

Street Address: PO BOX 420

City: FARMINGTON

State: NM

Zip: 87499-0420

Phone: (505)325-1821

Email address: aliph.reena@duganproduction.com

BLM Point of Contact

BLM POC Name: KENNETH G RENNICK

BLM POC Title: Petroleum Engineer

BLM POC Phone: 5055647742

BLM POC Email Address: krennick@blm.gov

Disposition: Sundry Returned

Disposition Date: 12/14/2021

Signature: null

Formation Tops
Dome Federal 29-22-6 # 2
API; 30-043-20406
Sec 29 T22N R6W
1610 FSL & 1840' FWL, Chacra
Lat; 36.1064339 Long: -107.495124
Lease No: NM6676

Formation Tops

Nacimiento: Surface

Ojo Alamo: 252'

Kirtland: 470'

Fruitland: 800'

Pictured Cliff: 1410'


Chacra: 1762'

Dugan Production plans to plug and abandon the well as per the following procedure.

- Set CIBP @ 1740'. Chacra perforations @ 1790'-1880'. Load casing. Pressure test casing to 600 psi. Run CBL from 1740' to surface.
- Spot plug I above CIBP inside 4 ½", 10.5# casing from 1740' to 1360' w/ 34 sks (39 cu.ft) Class G neat cement. (1.15 cu.ft/sk, 5 gal/sk mix water, 15.8#/gal) (Chacra-PC, Plug I: 1360'-1740')
- Spot plug II inside 4 ½" casing from 850' to 750' w/ 12 sks (13.8 cu.ft) Class G neat cement. (1.15 cu.ft/sk, 5 gal/sk mix water, 15.8#/gal) (Fruitland, Plug II: 750'-850')
- Spot plug III inside 4 ½" casing from 520' to surface w/ 45 sks (52 Cu.ft) Class G neat cement. (Surface-Ojo Alamo-Kirtland, Plug III: 0'-520')
- Cut wellhead. Tag TOC at surface. Fill cement incase needed.
- Install dry hole marker. Clean location.

Current wellbore Schematic

Dome Federal 29-22-6 # 2
API; 30-043-20406
Sec 29 T22N R6W
1610 FSL & 1840' FWL, Chacra
Lat; 36.1064339 Long: -107.495124
Lease No: NM6676

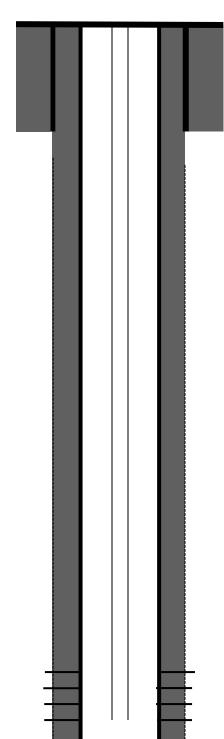

8-5/8" 23# casing @ 137'. Cemented with 100 sks. Hole size: 11"

Cemented w/ 300 sks. Circulated cement


2-3/8" 4.7 # tubing @ 1750'

Chacra Perforated @ 1790'-1880'

4 ½" 10.5 # casing @ 2000'. PBTD @ 1952'

Planned P & A Schematic

Dome Federal 29-22-6 # 2
API; 30-043-20406
Sec 29 T22N R6W
1610 FSL & 1840' FWL, Chacra
Lat; 36.1064339 Long: -107.495124
Lease No: NM6676

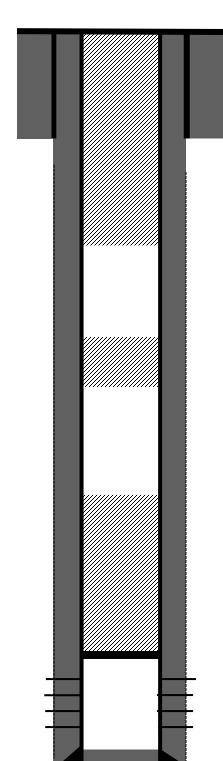

8-5/8" 23# casing @ 137'. Cemented with 100 sks. Hole size: 11"

Spot cement to surface w/ 45 sks Class G cement @ 0-520' (52 cu.ft) [Plug III: Surface-Ojo Alamo-Kirtland, 0-520]

Spot inside plug w/ 12 sks Class G (13.8 cu.ft) @ 750'-850' [Plug II: Fruitland, 750'-850']

Cemented w/ 300 sks. Circulated cement

Set CIBP @ 1740'. Spot inside plug w/ 34 sks Class G @ 1360'-1740' (39 cu.ft) [Plug I: Pictured Cliffs-Chacra]

Chacra Perforated @ 1790'-1880'

4 1/2" 10.5 # casing @ 2000'. PBTD @ 1952'

Released to Imaging: 1/3/2022 2:29:55 PM

BLM - FFO - Geologic Report

				Surf. Loc. Sec.	970 29	Date Completed		12/13/2021	
Well No.	Dome Federal 29-2	9-22-6	# 2			FSL T22N	760	FWL R6W	
Lease No	NMNM6676			C 00.	20	12214		1000	
Operator TVD Elevation	Dugan Production 0 2000 GL	Co PBTD 6997	1952	County Formation Elevation	Sandoval Rusty Cha Est. KB	cra 6997	State	New Mexico	

Geologic Formations	Est. tops Su	ubsea Elev.	Remarks		
San Jose Fm.					
Nacimien to/Animas Fm.	Surface	6997	Surface /fresh water sands		
Ojo Alam OSs	195	6802	Fresh water aquifer		
Kirtland Fm.	470	6527			
Fruitland Fm.	800	6197	Coal/gas/possible water		
Pictured Cliffs	1370	5627	Possible water		
Lewis Shale (Main)	1580	5417	Source rock		
Huerfanito Bentonite	1658	5339	Reference bed		
Chacra (u pper)	1762	5235	Possible gas/water		

Remarks:

-Vertical well bore, all formation depths are TVD

-The TOC for Plug 1 must be moved to 1270' to account for the BLM top and 50' required excess.

-The TOC for Plug 2 must be moved to 700' to account for the 50' required excess.

-The P&A package submitted in AFMSS 2 was missing the Operators formation top picks and a downloadable P&A procedure.

Reference Well:

Fm Tops
 Dugan Production Co
 Same

Prepared by: Walter Gage

Received by OCD: 12/28/2021 3:40:45 PM

UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT FARMINGTON DISTRICT OFFICE

6251 COLLEGE BLVD. FARMINGTON, NEW MEXICO 87402

AFMSS 2 Sundry ID 2645285

Attachment to notice of Intention to Abandon

Well: Dome Federal 29-22-6 2

CONDITIONS OF APPROVAL

- 1. Plugging operations authorized are subject to the attached "General Requirements for Permanent Abandonment of Wells on Federal and Indian Lease."
- 2. Farmington Office is to be notified at least 24 hours before the plugging operations commence at (505) 564-7750.
- 3. The following modifications to your plugging program are to be made:
 - Plug 1: Top of cement must be moved BLM top Pictured Cliffs and the required 50 feet excess.
 - b) Plug 2: Top of cement must be moved to 700 feet to account for the 50 feet excess.

You are also required to place cement excesses per 4.2 and 4.4 of the attached General Requirements.

Office Hours: 7:45 a.m. to 4:30 p.m.

K. Rennick 12/21/2021

GENERAL REQUIREMENTS FOR PERMANENT ABANDONMENT OF WELLS ON FEDERAL AND INDIAN LEASES FARMINGTON FIELD OFFICE

- 1.0 The approved plugging plans may contain variances from the following minimum general requirements.
 - 1.1 Modification of the approved plugging procedure is allowed only with the prior approval of the Authorized Officer, Farmington Field Office.
 - 1.2 Requirements may be added to address specific well conditions.
- 2.0 Materials used must be accurately measured. (densometer/scales)
- 3.0 A tank or lined pit must be used for containment of any fluids from the wellbore during plugging operations and all pits are to be fenced with woven wire. These pits will be fenced on three sides and once the rig leaves location, the fourth side will be fenced.
 - 3.1 Pits are not to be used for disposal of any hydrocarbons. If hydrocarbons are present in the pit, the fluids must be removed prior to filling in.
- 4.0 All cement plugs are to be placed through a work string. Cement may be bull-headed down the casing with prior approval. Cement caps on top of bridge plugs or cement retainers may be placed by dump bailer.
 - 4.1 The cement shall be as specified in the approved plugging plan.
 - 4.2 All cement plugs placed inside casing shall have sufficient volume to fill a minimum of 100' of the casing, or annular void(s) between casings, plus an excess volume sufficient to provide for 50 linear feet of fill above the plug.
 - 4.3 Surface plugs may be no less than 50' in length.
 - 4.4 All cement plugs placed to fill annular void(s) between casing and the formation shall be of sufficient volume to fill a minimum of 100' of the annular space plus 100% excess, calculated using the bit size, or 100' of annular capacity, determined from a caliper log, plus an excess volume sufficient to provide for 50 linear feet of fill above the plug.
 - 4.5 All cement plugs placed to fill an open hole shall be of sufficient volume to fill a minimum of 100' of hole, as calculated from a caliper log, plus an excess volume sufficient to provide for 50 linear feet of fill above the plug. In the absence of a caliper log, an excess of 100% shall be required.
 - 4.6 A cement bond log or other accepted cement evaluation tool is required to be run if one had not been previously ran or cement did not circulate to surface during the original casing cementing job or subsequent cementing jobs.

- 5.0 All cement plugs spotted across, or above, any exposed zone(s), when; the wellbore is not full of fluid or the fluid level will not remain static, and in the case of lost circulation or partial returns during cement placement, shall be tested by tagging with the work string.
 - 5.1 The top of any cement plug verified by tagging must be at or above the depth specified in the approved plan, without regard to any excess.
 - 5.2 Testing will not be required for any cement plug that is mechanically contained by use of a bridge plug and/or cement retainer, if casing integrity has been established.
 - 5.3 Any cement plug which is the only isolating medium, for a fresh water interval or a zone containing a prospectively valuable deposit of minerals, shall be tested by tagging.
 - 5.4 If perforations are required below the surface casing shoe, a 30 minute minimum wait time will be required to determine if gas and/or water flows are present. If flow is present, the well will be shut-in for a minimum of one hour and the pressure recorded. Short or long term venting may be necessary to evacuate trapped gas. If only a water flow occurs with no associated gas, shut well in and record the pressures. Contact the Engineer as it may be necessary to change the cement weight and additives.
- 6.0 Before setting any cement plugs the hole needs to be rolled. All wells are to be controlled by means of a fluid that is to be of a weight and consistency necessary to stabilize the wellbore. This fluid shall be left in place as filler between all plugs.
 - 6.1 Drilling mud may be used as the wellbore fluid in open hole plugging operations.
 - 6.2 The wellbore fluid used in cased holes shall be of sufficient weight to balance known pore pressures in all exposed formations.
- 7.0 A blowout preventer and related equipment (BOPE) shall be installed and tested prior to working in a wellbore with any exposed zone(s); (1) that are over pressured, (2) where the pressures are unknown, or (3) known to contain H_2S .
- 8.0 Within 30 days after plugging work is completed, file a Sundry Notice, Subsequent Report of Abandonment (Form 3160-5), five copies, with the Field Manager, Bureau of Land Management, 6251 College Blvd., Suite A, Farmington, NM 87402. The report should show the manner in which the plugging work was carried out, the extent, by depth(s), of cement plugs placed, and the size and location, by depth(s), of casing left in the well. Show date well was plugged.
- 9.0 All permanently abandoned wells are to be marked with a permanent monument as specified in 43 CFR 3162.6(d). Unless otherwise approved.
- 10.0 If this well is located in a Specially Designated Area (SDA), compliance with the appropriate seasonal closure requirements will be necessary.

All of the above are minimum requirements. Failure to comply with the above conditions of approval may result in an assessment for noncompliance and/or a Shut-in Order being issued pursuant to 43 CFR 3163.1. You are further advised that any instructions, orders or decisions issued by the Bureau of Land Management are subject to administrative review pursuant to 43 CFR 3165.3 and appeal pursuant to 43 CFR 3165.4 and 43 CFR 4.700.

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720

District II 811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720

District III 1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. **Santa Fe, NM 87505**

CONDITIONS

Action 69246

CONDITIONS

Operator:	OGRID:
DUGAN PRODUCTION CORP	6515
PO Box 420	Action Number:
Farmington, NM 87499	69246
	Action Type:
	[C-103] NOI Plug & Abandon (C-103F)

CONDITIONS

Created By		Condition Date
kpickford	Notify NMOCD 24 Hours Prior to beginning operations	1/3/2022
kpickford	Adhere to BLM COAs and plugs	1/3/2022