
PNRM0523129361

C-103 Received 8-9-2005-

PHC No. Assigned 8-19-2005

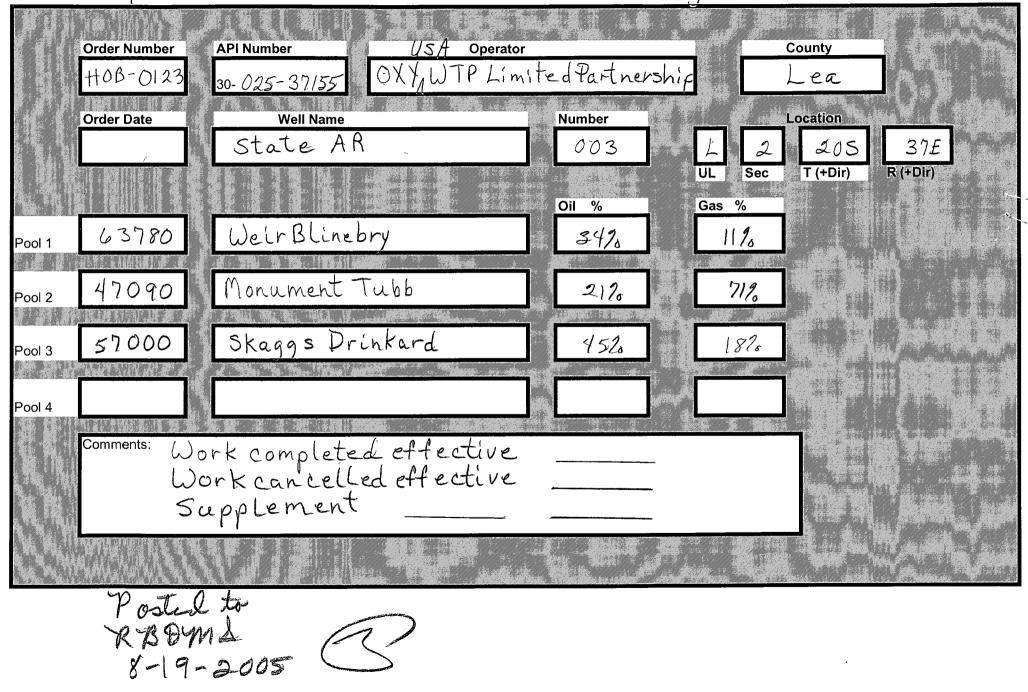

30-025-37155 DOWNHOLE COMMINGLE CALCULATIONS: tel Portruship HOB-0123 **OPERATOR:** () () ()RIY PROPERTY NAME: State LA 20-37 WNULSTR: **ALLOWABLE AMOUNT SECTION I:** 63780 2/4 MCF 2000 107 POOL NO. 1 2220 MCF [0000 - Dac. 47090 222 POOL NO. 2 1420 MCF 10000 142 POOL NO. 3 57000 POOL NO. 4 MCF POOL TOTALS 471 3854 Ail **SECTION II:** 34% 11% POOL NO. 1 21% POOL NO. 2 71% mu 457, X471=211,95 18% POOL NO. 3 POOL NO. 4 OIL GAS **SECTION III:** 238 $51_{0} = 237_{1}$ **SECTION IV:** 1= 80.99 49.98 5 38 10

Submit 3 Copies To Appropriate DistrictState of New MexicoOfficeEnergy, Minerals and Natural Resources	Form C-103 May 27, 2004
District I 1625 N. French Dr., Hobbs, NM 87240	WELL API NO.
District II OIL CONSERVATION DIVISION	<u>30-025-37155</u>
rict III 1220 South St. Francis Dr.	5. Indicate Type of Lease STATE X FEE
1000 Rio Brazos Rd., Aztec, NM 87410 District IV Santa Fe, NM 87505	
1220 S. St Francis Dr., Santa Fe, NM 87505	6. State Oil & Gas Lease No. B-1481
SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	7. Lease Name or Unit Agreement Name: State AR
1. Type of Well: Oil Well X Gas Well Other	8. Well Number 3
2. Name of Operator	9. OGRID Number
OXY USA WTP Limited Partnership	192463
3. Address of Operator	10. Pool name or Wildcat
P.O. Box 50250 Midland, TX 79710-0250	*Skaggs Drinkard
4. Well Location	
Unit Letter <u>L: 1980</u> feet from the <u>south</u> line and	760 feet from the west line
Section 2 Township 20S Range 37E	NMPM County Lea
11. Elevation (Show whether DR, RKB, RT, GR, 3605'	etc.)
Pit or Below-grade Tank Application or Closure	
Pit type Depth to Groundwater Distance from nearest fresh water well D	Distance from nearest surface water
Pit Liner Thickness: mil Below-Grade Tank: Volumebbls; Construc	tion Material
12. Check Appropriate Box to Indicate Nature of Notice NOTICE OF INTENTION TO:	e, Report, or Other Data
	BSEQUENT REPORT OF:
	ALTERING CASING
	ALTERING CASING
PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK TEMPORARILY ABANDON CHANGE PLANS COMMENCE DRIL PULL OR ALTER CASING MULTIPLE CASING TEST AND COMPLETION COMPLETION CASING TEST AND	ALTERING CASING
PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK TEMPORARILY ABANDON CHANGE PLANS COMMENCE DRIL PULL OR ALTER CASING MULTIPLE CASING TEST AND COMPLETION COMPLETION CASING TEST AND	ALTERING CASING
PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK TEMPORARILY ABANDON CHANGE PLANS COMMENCE DRIL PULL OR ALTER CASING MULTIPLE COMPLETION CASING TEST AND CEMENT JOB OTHER: OTHER: Complete OTHER: Complete 13. Describe proposed or completed operations. (Clearly state all pertinent details, and ging of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attact	ALTERING CASING
PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK TEMPORARILY ABANDON CHANGE PLANS COMMENCE DRIL PULL OR ALTER CASING MULTIPLE COMPLETION CASING TEST AND CEMENT JOB OTHER: OTHER: Complet 13. Describe proposed or completed operations. (Clearly state all pertinent details, and gi of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attac or recompletion.	ALTERING CASING
PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK TEMPORARILY ABANDON CHANGE PLANS COMMENCE DRIL PULL OR ALTER CASING MULTIPLE COMPLETION CASING TEST AND CEMENT JOB OTHER: OTHER: Complete OTHER: Complete 13. Describe proposed or completed operations. (Clearly state all pertinent details, and ging of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attact	ALTERING CASING
PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK TEMPORARILY ABANDON CHANGE PLANS COMMENCE DRIL PULL OR ALTER CASING MULTIPLE COMPLETION CASING TEST AND COMPLETION OTHER: Complet: 13. Describe proposed or completed operations. (Clearly state all pertinent details, and gi of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attac or recompletion.	ALTERING CASING
PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK TEMPORARILY ABANDON CHANGE PLANS COMMENCE DRIL PULL OR ALTER CASING MULTIPLE COMPLETION CASING TEST AND COMPLETION OTHER: Complete 13. Describe proposed or completed operations. (Clearly state all pertinent details, and gi of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attac or recompletion.	ALTERING CASING LING OPNS. D PLUG AND ABANDONMENT D D DHC C-107A We pertinent dates, including estimated date ch wellbore diagram of proposed completion A C ge and belief. I further certify that any pit or below-
PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK TEMPORARILY ABANDON CHANGE PLANS COMMENCE DRIL PULL OR ALTER CASING MULTIPLE COMPLETION CASING TEST AND CEMENT JOB OTHER: OTHER: Completed 13. Describe proposed or completed operations. (Clearly state all pertinent details, and gi of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attac or recompletion. DHC Order No, HOB-0123 See Attachment R-11363 pre-Approved pools For P I hereby certify that the information above is true and complete to the best of my knowled grade tank has been/will be constructed or closed according to NMOCD guidelines , a general permis SIGNATURE _ TITLE _ Sr. Regul	ALTERING CASING LING OPNS. D PLUG AND ABANDONMENT D ABANDONMENT D AD AD ABANDONMENT D AD AD ABANDONMENT D AD A
PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK TEMPORARILY ABANDON CHANGE PLANS COMMENCE DRIL PULL OR ALTER CASING MULTIPLE COMPLETION CASING TEST AND CEMENT JOB OTHER: OTHER: Complete 13. Describe proposed or completed operations. (Clearly state all pertinent details, and gi of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attac or recompletion. DHC Order No, HOB-0123 See Attachment <u>R-11363 pre-Approved pools for C</u> I hereby certify that the information above is true and complete to the best of my knowledger grade tank has been/will beconstructed or closed according to NMOCD guidelines , a general permis SIGNATURE	ALTERING CASING LING OPNS. PLUG AND ABANDONMENT D ion - DHC C-107A We pertinent dates, including estimated date ch wellbore diagram of proposed completion A A A A A A A A A A A A A
PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK TEMPORARILY ABANDON CHANGE PLANS COMMENCE DRIL PULL OR ALTER CASING MULTIPLE COMPLETION CASING TEST AND CEMENT JOB OTHER: OTHER: Complet: 13. Describe proposed or completed operations. (Clearly state all pertinent details, and gi of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attac or recompletion. DHC Order No, HOB-0123 See Attachment <u>R-11363 pre-Approved pools for Ser Ser Ser Ser Ser Ser Ser Ser Ser Se</u>	ALTERING CASING LING OPNS. PLUG AND ABANDONMENT D ion - DHC C-107A We pertinent dates, including estimated date ch wellbore diagram of proposed completion A A C ge and belief. I further certify that any pit or below- t or an (attached) alternative OCD-approved plan atory Analyst DATE C david stewart@oxy. com (INED B) Telephone No. 432-685-5717 (AUTZ

STATE AR #3

04/28/2005 CMIC Davis

MIRU KEY #293. Unload and rack 160 jts. 2 7/8 tubing. NU BOP. SION.

04/29/2005 CMIC: Davis

RIH with 4 3/4 Varel Bit - bit sub - 6 3 1/2 od drill collars - top sub on 115 jts 2 7/8 tubing. Tag up at 3843'. RU swivel establish circulation. Drill out cement from 3843' to 4021'. Drill out DV tool at 4021'. RIH to 4052'. CHC. Test csg to 1000#. Held. Bleed off pressure. RIH with BHA on tubing. Tag up at 7291'. POOH w/ 3 jts 2 7/8 to 7197'. SDON

04/30/2005 CMIC: Davis

RIH drill out to 7361'. CHC w/ 2% KCL tested casing to 1000# held OK. POOH LD BHA. SI till Monday 05/01/2005 CMIC: Davis

SI till Monday

05/03/2005 CMIC: Davis\Aksehirli

MIRU Halliburton correlated back to Baker DSN/SDL log from 7340 to 500' TOC 900'. RIH correlated back to DSN/SDL log and select fired drinkard at the following depths 6905, 6895, 93, 67, 56, 53, 51, 49, 42, 26, 21, 17, 15, 13, 6797, 85, 78, 67, 57, 37, reshoot 6905 due to misfire total of 20 holes. RIH w/ second set of select fire guns shot @ 6609, 07, 6582, 77, 75, 73, 66, 63, 61, 55, 53, 51, 33, 26, 24, 22, 6500, 6474, 6467 total of 21 holes. RIH w/ third set guns 5893, 91, 71, 67, 53, 51, 50, 43, 31, 29, 26, 24, 22, 20, 13, 11, 5800, 5798. RIH reshoot 5893, 5891. total of 19 holes after one misfire and one discharge between recommendation. Shot a total of 60 0.41 holes on all three zones RD Halliburton SDON

05/04/2005 CMIC: Davis\Aksehirli

RIH with Baker 5 1/2 RBP, ball catcher and Packer. Set RBP at 6967'(217 jts). Pull up to 6667' and set pkr. On 208 jts. Rig up to swab. IFL at Surface. FFL at 6664'. Recovered 38 BW in 17 runs. SION

05/05/2005 CMIC: Davis\Aksehirli

Well on vacumn. RIH with swab to 6664'. No fluid entry overnite. Lay down swab. RU HES. Test lines to 7000#. Acidize the Drinkard formation per HES Recommendation. With 3000 gal 15% Fercheck acid dropping 30 1.3 sg ball sealers. Flush to top perf with 2% KCL water. ISIP=2252#. 5 min=1914#. 10 min=1858#. 15 min=1814#. Avg. rate 4.9 BPM. Max rate 5.2 BPM. Avg. pressure 2876#. Max pressure 6000#.(Balled out) Close well in. Rig down HES. Bleed press. off tubing. Unset packer and RIH and retrieve BP. Move RBP up to andset at 6680'. Set packer at 6644' and test RBP to 3000#. Held. Release packer and move up and set at 6358'. RU HES. Acidize the Tubb formation per HES recommendation using 3000 gal. 15% Fercheck acid. Dropping 30 1.3 sg ball sealers. Flush to top perf with 2%KCL water. ISIP=1984#. 5 min=1901#. 10 min=1823#. 15 min=1804#. Avg rate = 4.7BPM. Max rate = 5.2 BPM. Avg pressure = 2740#. Max pressure = 3263#. Rig down Halliburton. Bleed off tbg. Release packer and RIH and retrieve BP. Move RBP up hole and reset at 6362'. Set packer at 6326'. Test RBP to 3000#. Held. Move packer up to and set at 5718'. Acidize the Blindbry formation per HES recommendation using 2500 gal. 15% Fercheck acid. Dropping 27 1.3 sg ball sealers. Flush to top perf with 2% KCL water. ISIP=2731#. 5 min=2568#. 10 min=2502#. 15 min=2453#. Avg. rate = 5.1 BPM. Max. rate = 5.5 BPM. Avg. press.=3136#. Max press.= 3737#. Close well in. Rig down HES. Bleed off tubing. Unset packer and RIH and retrieve RBP. POOH laying down 140 jts 2 7/8 tubing. Stand 100 joints in derrick. Lay down 5 1/2 packer and **RBP. SION**

05/06/2005 CMIC: Davis\Aksehirli

Unload and rack 227 jts 3 1/2 9.3# 8rd tubing. Tally tubing. Change rams in BOP. Rig up Bo-Monk tubing Testers. Test in hole(8000# below slips) with 5 1/2 Watson lok-set packer with bottom hole valve on 213 jts 3 1/2 eue tubing. Rig down Bo-Monk tubing testers. Set packer at 6660' in 14,000# compression. Nipple up Frac Stack. SI till Monday

05/10/2005 CMIC: Davis\Aksehirli

MIRU Halliburton to frac the Drinkard Perforations. Loaded well with 22 gals Water Frac G-R 15, 5411 gals SilverStim LT Basic 15, 17058 gals proppant Laden fluid 1-5 lbm/gal premium white 20/40, 15235 gals SilverStim LT basic 15 5 lbm/gal premium white 20/40. total of 65000 lbs of sand lacked 4200lbs sand from design. Switch to flush before stage 4 finished due to communication on backside. Flushed with 3103 gals water frac G-R 15. Max rate 32.7 bpm, Avg 29.7, Avg Press 5732, Max press 5940# Bleed tubing down to 1500#. Bleed pressure off backside. Try to shut down hole valve with no progress. Bleed pressure off tubing. Try to get off on/off tool with no progress. Try to unset 5 1/2 Loc-set packer with no progress. Secure well. SDON. (Could not get wireline truck untill Tuesday AM)

05/11/2005 CMIC: Davis\Aksehirli

Rig up Rotary wireline. RIH and found tubing 50% free 10' above packer. POOH with free point tools. RIH with chemical cutter and cut 3.5 tubing at 6634'. POOH with wireline and rig down. Work 3.5 tubing for 5 hours. Pumped into tbg did not have returns while attempting to rotating tbg with power tongs after rigging down swivel tbg was charged and had flow back. Worked tubing up hole 8'. Could not get wireline truck back untill Wednesday AM.

05/12/2005 CMIC: Davis\Aksehirli

Rig up Rotary wirline. RIH with free point tools. Tools showed 3.5 tubing 100% Free at 6250'. POOH with wireline. RIH and chemical cut 3.5 tubing at 6250'. POOH and rig down wireline. Work 3.5 tubing. POOH with 201 jts. and cut joint.(Cut joint had split from working 3/5 tubing free.) RIH with 4 3/4 od concave mill - bit sub - 6 3 1/2 od drill collars - top sub on 190 joints 2 7/8 tubing. Tag up on fish top at 6250'. Hook up to drill. Establish circulation with 40 bbls. 2% KCL water. Dress off 1' of 3.5 tubing to 6251'. CHC. POOH with 100 joints 2 7/8 tubing to 3060'. SDON.

05/13/2005 CMIC: Davis\Aksehirli

0 pressure on well. POOH with 90 jts. 2 7/8 tubing and BHA. RIH with 6662 overshot - 3 3/4 bumper sub - 3 3/4 Bowen Jars - 6 3-1/2 od drill collars - 3 3/4 Bowen Acc.- top sub on 190 jts 2 7/8 tubing. Tag top of fish at 6251'. Work overshot and get bite on fish. Jar on 3.5 tubing for 5 hrs. Making 5'. Fish quit moving. Got off fish with overshot and POOH. RIH with 4 3/4 SOD X MID shoe - 2 jts 4 1/2 washpipe - top bushing - 3 3/4 od Bowen Super Jars - 6 3 1/2 od drill collars - top sub on 150 joints 2 7/8 tubing to 5054'. SION

05/14/2005 CMIC: Davis\Aksehirli

0 pressure on well. Continue to RIH with 2 7/8 tubing and washpipe. Tag up on 3.5 tubing at 6246'. Hook up to Wash over tubing. Establish circulation. Wash over 3.5 tubing to 6265'. Cut over tubing collar at 6265'. Wash over 3.5 tubing to 6296'. Shoe quit cutting. CHC. POOH with 189 jts 2 7/8 tubing and BHA. (ID of shoe was worn out) RIH with 6662(4 5/8od) overshot - 3 3/4 Bowen Super Jars - 6 3 1/2 od drill collars - top sub on 100 jts 2 7/8 tubing. SION

05/15/2005 CMIC: Davis\Aksehirli

0 pressure on well. Continue to RIH with overshot on tubing. Work overshot on fish. POOH with 190 jts 2 7/8 tubing and 6 3 ½ drill collars - 3 3/4 Bowen jars - overshot. Recovered 15' cut joint. RIH with 4 3/4 SOD X MID shoe - 2 jts 4 1/2 washpipe – top bushing - 3 3/4 Jars - 6 3 1/2 od drill collars - top subon 189 jts 2 7/8 tubing. Tag up on fish at top at 6265'. Work over top of fish. Wash down to 6296'.Cut over tubing collar at 6296'. Wash down to 6328'. Cut over tubing collar at 6328'. Wash down to 6332'. CHC. POOH with 190 jts 2 7/8 tubing and Washpipe. RIH with 6662 overshot (3 5/8 grap) 3 3/4 od Bowen Jars - 6 3 1/2 od drill collars - top sub on 50 jts 2 7/8 tubing. SION

05/17/2005 CMIC: Davis

0 pressure on well. Continue to RIH with overshot on tubing. Tag up on fish at 6265', Work overshot to get bite on fish. POOH with 190 jts 2 7/8 tubing and BHA. Lay down 1 jt. 3.5 tubing. RIH with 6662 o/s - 3 3/4 Bowen jars - 6 3 1/2 od drill collars on 191 jts 2 7/8 tubing. Tag up on fish at 6296'. Work overshot to get bite on fish. POOH with 2 7/8 tubing and BHA. Lay down 1 jt. 3.5 tubing. (TOF @ 6328'.) RIH with 4 3/4 SOD X 1/8ID shoe - 2 jts 4 1/2 washpipe - top bush - 3 3/4 Bowen Jars - 6 3 1/2 od drill collars on 160 jts 2 7/8 tubing to 5371'. SION

05/18/2005 CMIC: Davis

0 pressure on well. Continue to RIH with 4 3/4 SOD X 1/8ID shoe - 2 jts 4 1/2 washpipe - top bushing - 3 3/4 Bowen jars - 6 3 ½ drill collars - top sub on 2 7/8 tubing. Tag up on top of fish at 6328'. Hook up to wash over. Establish circulation. Work over top of fish. Wash down to 6359'. Cut over collar at 6359' and wash down to 6373'. 3.5 tubing turned loose. RIH and tag up on tubing at 6400'. Turn and wash on tubing for 15 minutes. CHC. POOH with 192 jts 2 7/8 tubing and BHA. 3.5 tubing was in washpipe. Lay down 8 jts plus cut joint of 3.5 tubing. RIH with 4 3/4 SOD X 1/8ID shoe - 1 jt. 4 1/2 washpipe - top bushing - 3 3/4 Bowen jars - 6 3 ½ od drill collars top sub on 100 jts. 2 7/8 tubing. SION

05/19/2005 CMIC: Davis

0 pressure on well. Continue to RIH with 4 3/4 shoe - 1 jt. 4 1/2 Washpipe - top bushing - 3 3/4 Bowen Jars - 6 3 1/2 od drill collars - top sub on 202 jts 2 7/8 tubing. Tag up at 6630'. Work shoe over top of tubing at 6630' and wash down to 6647'. Get Friction bite on 3.5 tubing. Unset packer. POOH with tubing and BHA. Recovered 15' 3.5 cut joint of tubing and Ret. Head. RIH with Ret. Head for packer on 209 jts 2 7/8 tubing. Work to latch onto packer and unset. POOH with 90 jts 2 7/8 tubing. Could not feel packer on tubing. RIH to 7100'. Set 20,000# on packer. POOH with tubing and Ret. Head. Recovered packer. Lay packer down. SDON.



STATE AR #3

05/20/2005 CMIC: Davis

0 pressure on well. RIH with Baker 5 1/2 Model "G" RBP - on/off tool on 208 jts 2 7/8 tubing. Set RBP at 6664'. Get off on/off tool and POOH with 2 7/8 tubing. RIH with Baker 5 1/2 Model "M" packer and L-10 on/off tool with 2.31 profile - 2 7/8 X 10' pup jt. - Baker 5 1/2 Big Bore Retrieve-a-matic packer - 2 7/8 X 3 1/2 change over on 212 jts 3 1/2 tubing. Set Model "M" packer at 6647'. Test RBP to 1000# . Held. Release packer. POOH laying down 2 jts 3 1/2 tubing. Dump 1 sx. sand down tubing. POOH laying down 8 jts 3 1/2 tubing. Set Model "M" packer at 6335'. SION

05/24/2005 CMIC: Davis

Frac Tubb formation per Halliburtons recommendation. Loaded tbg pumped 16370 gals pad followed 13940 gals 1-5 lbs propant laden silverstim basic, followed by 5304 gals 5 lbs propant laden silverstim basic flushed with 2366 gals flush. Pumped total of 730.14 100*lb proppant. ISIP = 2305#. Max treating pressure 6392#, Avg 5184#, Max slurry rate 39 bpm, Avg 34.5. Close well in. Rig up Pro Wireline to set plug in 2.31 profile. Plug stuck at 6296', Cut line with 5th cutter dropped. POOH with slickline. Unset packer and POOH with 3 1/2 tubing and packer. Recovered cutters and plug. SION.

05/25/2005 CMIC: Davis

0 pressure on well. RIH with 5 1/2 Baker model "G" RBP on 5 1/2 Retrieve-a-matic packer. Set RBP at 6166'. POOH with 1 jt. 3 1/2 tubing. Set 5 1/2 packer and test RBP to 1500#. Held. Release packer and POOH with 15 jts 3 1/2 tubing. Set packer at 5667'. Load backside with 2% KCL water. Test to 1500#. Held. Rig up Halliburton. Frac the "Blinberry" perforated interval with 45473 gal SilverStim LT. WHTP of 3500#. Approx 70,000# of 20/40 Ottawa placed during treatment coated with Expedite 225. Max treating pressure 7466#. Avg treating pressure 6226#. Max Slurry rate of 37.6 BPM. Avg slurry rate of 35.8 BPM. Flush to top perf. ISIP=3808#. 5 min=3454#. 10 min=3128#.

05/26/2005 CMIC: Davis

Tubing on vacumn. Unset packer and POOH laying down 3 1/2 tubing on racks. Lay down packer. RIH with 4 3/4 Blade Bit - bit sub - 6 3 1/2 od drill collars - top sub on 178 jts 2 7/8 tubing. Tagged up at 5854'. Hook up to clean out sand. Establish circulation with 100 bll. 2% KCL water. Clean out sand from 5854' to 6166'.(312') CHC. POOH with 187 jts 2 7/8 tubing - drill collars and bit. SION

05/27/2005 CMIC: Davis

0 pressure on well. RIH with retrieving head for Baker RBP. Hook up to circulate. Establish circulation with 100 blls. 2% KCL water. Circulate sand off top of RBP. Latch onto RBP and unset. POOH with 193 jts 2 7/8 tubing - ret. Head and RBP. RIH with 4 3/4 Blade Bit - bit sub - 6 3 1/2 od drill collars - top sub on 200 jts 2 7/8 tubing. Tagged up at 6581'. Establish cir. with 75 bll. 2% KCL water. Clean out sand from 6581' to 6664'. CHC. POOH with 203 jts 2 7/8 tubing and BHA. RIH with Ret. head for RBP on 160 jts 2 7/8 tubing to 5133'. SION.

05/28/2005 CMIC: Davis

50# presssure on well. Bleed off pressure. Continue to RIH with Ret. Head for RBP on 208 jts 2 7/8 tubing. Hook up to drill. Establish circulation with 100 bll. 2% KCL water. Wash sand off top of RBP at 6664'. CHC. Unset RBP and POOH with 208 jts 2 7/8 tubing - ret. head and RBP. RIH with 4 3/4 blade bit - bit sub - 6 3 1/2 od drill collars - top sub - 2 7/8 seating nipple on 216 jts. Tagged up at 7105'. Hook up to clean out. Establish circulation with 130 bll. 2% KCL water. Wash sand from 7105' to 7361'(256') CHC. POOH with 74 jts 2 7/8 tubing to 5500'. SI Till Tuesday

06/01/2005 CMIC: Davis

140# on tubing and csg. Bleed off pressure. RIH with 2 7/8 tubing and tag up at 7361'. POOH to 6935'. Rig up to swab. IFL at 1200'. EFL at 1500'. Recovered 116 bbls in 19 runs.(4 hrs) 5% oil cut. Slight gas. Lay down swab. SION

06/02/2005 CMIC: Davis

400# on csg. Slight Blow on tubing. Bleed off pressure. RIH with swab. IFL at 1500'. 300' fluid entry overnite. Rig down swab. RIH with 2 7/8 tubing. Tag for fill. 0.Tagged up at 7361'. POOH laying down 24 jts total on pipe racks. Stand 108 stands in derrick. Laydown drill collars. RIH tubing as follow:

2 7/8 Dump Valve	.81
1 jt. 2 7/8 tubing	32.53
2 7/8 Cavins DeSander	20.20
X-over	.50
2 3/8 seating nipple	1.10
X-over	.50



37 jts 2 7/8 tubing	1180.99
2 7/8 X 5 1/2 TAC	2.90
179 jts 2 7/8 tubing	5722.48
KB	18.00

Nipple down BOP. Set TAC in 22000# tenshion. Flange well up.Rig up to run rods.

06/03/2005 CMIC: Davis

200#on csg. Slight blow on tubing. Bleed off pressure on backside. RIH with 1 1/2 X 2 X 26' pump - 182 3/4 rods - 93 7/8 rods - 4' X 7/8 rod sub - 2' X 7/8 rod sub - 1 1/2 X 26' Polish rod and 1 3/4 X 16' Liner. Load Tubing with 8 bll. 2% KCL water. Start to pressure test pump and could not catch pressure. (pumped 60 bll.) Unseat pump and pump 15 bll. water down tubing. Seat pump back. Load tubing. Pressure up to 500#. Held. Bleed pressure off to 300#. Long stroke pump. Lost all pressure when long stroking pump. Lay down polish rod and liner. POOH with rods and pump. (pump was stuck closed). Send pump in for repairs. SION

06/04/2005 CMIC: Davis

250# on csg. Slight Blow on tubing. RIH with 1 1/2 X 2 X 26' rod pump - 182 3/4 rods - 93 7/8 rods - 4' X 7/8 rod sub - 2' X 7/8 rod sub - 1 1/2 X 26' polish rod and 1 3/4 X 16' liner. Space well out. Load tubing with 16 bll. Produced water. Test pump to 500#. Held. Long stroke pump to test pump action. Good. (pressured up to 600# in three strokes) RDMO.

06/14/2005 CMIC: Davis

MIRU rig up generator balanced unit. Start well pumping @ 1800hrs.

06/15/2005 CMIC: Davis

24 hrs test 72 BO, 246 BW, 1 MCF Left well on test.

06/16/2005 CMIC: Davis

24hrs 73 BO, 269 BW, 0 MCF Left well on test.

06/17/2005 CMIC: Davis

22 hour test 128 BO, 318 BW, 364 MCF. Left well on test.

06/18/2005 CMIC: Davis

76 BO, 487 BW, 403 MCF. Left well on test.

06/19/2005 CMIC: Davis

72 BO, 467 BW, 446 MCF 98% on POC. Left well on test. 06/20/2005 CMIC: Davis

54 BO, 362 BW, 452 MCF 100% on POC. Left well on test. 06/21/2005 CMIC: Davis

53 BO, 359 BW, 470 MCF 100% on POC. Left well on test. 06/22/2005 CMIC: Davis

00/22/2003 CMIC: Davis

52 BO, 395 BW, 441 MCF 92% on POC. Left well on test. 06/23/2005 CMIC: Davis

24 hr test 50 BO, 425 BW, 453 MCF gas ran 97% on POC. 06/24/2005 CMIC: Davis

- 24 hr test 45 BO, 347 BW, 438 MCF gas ran 87% on POC.
- 06/26/2005 CMIC: Davis

24 hrs 52 BO, 248 BW, 408 MCF 82% on POC.

06/27/2005 CMIC: Davis

24 hrs 48 BO, 317 BW, 399 MCF 80% on POC.

06/29/2005 CMIC: Davis

43 BO, 346 BW, 455 MCF gas well pumped 88% on POC.

06/30/2005 CMIC: Davis

50 BO, 352 BW, 442 MCF gas run 87% on POC. Left well on test.

07/01/2005 CMIC: Davis

24 hrs test 57 BO, 381 BW, 408 MCF running 80% on POC. Left well on test.

District I 1625 N French Da

District II 1301 W Grand Avenue, Artesia, NM 88210

1220 S St Francis Dr, Santa Fe, NM 87505

c, Hobbs, NM 88240

RIO Brazos Road, Aziec, NM 87410

District IV

Oil Conservation Division

1220 South St. Francis Dr. Santa Fe, New Mexico 87505 APPLICATION TYPE <u>X</u> Single Well <u>X</u> Establish Pre-Approved Pools EXISTING WELLBORE <u>X</u> Yes <u>No</u>

APPLICATION FOR DOWNHOLE COMMINGLING

OXY USA WTP	Limited Partnership	P.O. Box 50250 M	idland, TX 79710-0250
Operator		Address	
State AR	3	L – 2 – 20S – 37E	Lea
Lease	Well No.	Unit Letter-Section-Township-Range	County

OGRID No. <u>192463</u> Property Code <u>34708</u> API No. <u>30-025-37155</u> Lease Type: ____Federal <u>X</u> State ____Fee

DATA ELEMENT	UPPER ZONE	INTERMEDIATE ZONE	LOWER ZONE
Pool Name	Weir Blinebry	Monument Tubb	Skaggs Drinkard
Pool Code	63780	47090	57000
Top and Bottom of Pay Section (Perforated or Open-Hole Interval)	5798-5893'	6467-6609'	6737-6905'
Method of Production (Flowing or Artificial Lift)	Artificial Lift	Artificial Lift	Artificial Lift
Bottomhole Pressure (Note Pressure data will not be required if the bottom perforation in the lower zone is within 150% of the epth of the top perforation in the upper zone)			
Oil Gravity or Gas BTU (Degree API or Gas BTU)	38.2	38.2	38.2
Producing, Shut-In or New Zone	Producing	Producing	Producing
Date and Oil/Gas/Water Rates of Last Production. (Note For new zones with no production history, applicant shall be required to attach production estimates and supporting data)	Date: 7/1/05 Rates: 57/408/381	Date: 7/1/05 Rates: 57/408/381	Date: 7/1/05 Rates: 57/408/381
Fixed Allocation Percentage (Note If allocation is based upon something other than current or past production, supporting data or explanation will be required)	Oil Gas 34 % 11 %	Oil Gas 21 % 71 %	Oil Gas 45 % 18 %

ADDITIONAL DATA

Are all working, royalty and overriding royalty interests identical in all commingled zones? If not, have all working, royalty and overriding royalty interest owners been notified by certified mail?	Yes X Yes	No No
Are all produced fluids from all commingled zones compatible with each other?	Yes X	No
Will commingling decrease the value of production?	Yes	X
If this well is on, or communitized with, state or federal lands, has either the Commissioner of Public Lands or the United States Bureau of Land Management been notified in writing of this application?	Yes X	No
MOCD Reference Case No. applicable to this well: Rule 303C(5)		

Attachments:

C-102 for each zone to be commingled showing its spacing unit and acreage dedication. Production curve for each zone for at least one year. (If not available, attach explanation.) For zones with no production history, estimated production rates and supporting data. Data to support allocation method or formula. Notification list of working, royalty and overriding royalty interests for uncommon interest cases. Any additional statements, data or documents required to support commingling.

PRE-APPROVED POOLS

If application is to establish Pre-Approved Pools, the following additional information will be required
--

List of other orders approving downhole commingling within the proposed Pre-Approved Pools

List of all operators within the proposed Pre-Approved Pools

Proof that all operators within the proposed Pre-Approved Pools were provided notice of this application.

Bottomhole pressure data.

I hereby certify that the information	above is true and	complete to the best	of my knowledge and belief.
-	-		

SIGNATURE De	_TITLE	Sr. Regulatory Analyst DATE Elecs	
TYPE OR PRINT NAME		TELEPHONE NO. (<u>432</u>) 685-5717	
E-MAIL ADDRESS david_stewart@oxy.com	L		

2/2

P ¹					\$	State of	of New	Mexico				
	STRICT I M. PHINCH DR., III	Denis, Kini aki	849		Energy, b	finerals and	i Natural B	asources Department		в.	orm C-102	
130	STRICT II	ARTEEL, NE	00210		1220 S	OUTH	ST. F	ON DIVISI TRANCIS DR.	ION Subant	Revised JU t to Appropriate Di State Lease	NE 10, 2003 strict Office - 4 Copies	
	DISTRICT III For Lease - 3 Copie 1000 Rio Brases Bd., Astec, NM 87410										- a capital	
	DISTRICT IV WELL LOCATION AND ACREAGE DEDICATION PLAT											
Γ				_	Pool Code			<1.	Pool Name			
-	<u>30-025-</u> Property Co		l		1000	Prop	erty Nam		ags Driv	Well Num	iber	
1	24708		R			-	TE AH					
	OGRID No.					-	ator Nam			Elevatio 3605	· · · ·	
L	192463 OXY USA WTP Limited Partnership Surface Location										<u> </u>	
Г	A er lot No.	Section	Township	Range	Lot idn		om the	North/South line	Feet from the	East/West line	County	
	L	2	20-S	-		19		SOUTH	760	WEST	LEA	
L	A			Bottom	Hole Lo	cation	lf Diffe	rent From Sur	face	·	I	
Γ	UL or lot No.	Section	Township	Range	Lot Idn	Feet fr	om the	North/South line	Feet from the	East/West line	County	
		. <u> </u>										
	Dedicated Acres	Joint	or Iafili Co	nsolidation	Code Or	der No.						
L	40		No]	
-	NU ALLU	WABLE						APPROVED BY		SEN CONSOLID	ат <u>к</u> о	
Ì	LOT 4		LC	DT 3		LOT 2		LOT 1	OPERATO	OR CERTIFICA	TION	
									contained herei	y certify the the in n is true and compl oledge and beliaf.		
	_						{		Signature	. 64		
			ء ا	EODETIC (COORDINAT	TES			David S	the second s		
			i		838.3 N		ļ		Sr. Reg	ulatory Ana	lyst_	
			1		452.2 E		1		Date	28/05		
				LAT. =32*3 ONG. =103			f 1			OR CERTIFICA	TION	
	3604.0'	3604.4			+ 1					y that the well loos		
	600	· · · · ·			1				actual surveys	as plotted from fiel made by me or al that the same is	under my	
		60							correct to th	he best of my beli	v.	
	3604.4	J 3602.9							Date Survey	BANAR 2005	DEL	
	1980`~								Professionat	(12941) 5.11.04205	12841	
	<u> </u>		L		<u> </u>							

State of New Mexico

DISTRICT I LOSS N. PRENCIL DR. MORNE. MM RAPAS

DISTRICT II

DISTRICT IV

1964 W (084

ergy, Minerale and Naturel Resources Department

OIL CONSERVATION DIVISION 1220 SOUTH ST. FRANCIS DR. Santa Fe, New Mexico 87505

Form C-102 Revised JUNE 10, 2003 Submit to Appropriate District Office State Lesse ~ 4 Copies For Lease - 5 Copies

DISTRICT III 1000 Rie Brazos Rd., Axteo, NM 87410

IN ATTRACT ADVICTA ADV ADDID

WELL LOCATION AND ACREAGE DEDICATION PLAT C AMENDED REPORT 1336 3. 57. 784 NC20 DR., SANTA PR, MM 07606 API Number Pool Code Pool Name Monument Tubb 47090 30-025- 37155 **Property** Code Property Name Well Number STATE AR 34708 OGRID No. Operator Name Elevation 3605 192463 OXY USA WTP Limited Partnership Surface Location UL or lot No. Section Township Range Lot idn Fest from the North/South line Feet from the Bast/West line County L 2 20-S 37-E SOUTH 1980 760 WEST LEA Bottom Hole Location If Different From Surface UL or lot No. Section Township Range Lot Idn Feet from the North/South line Feet from the East/West line County Dedicated Acres Joint or Infill Consolidation Code Order No. 80 No NO ALLOWABLE WILL BE ASSIGNED TO THIS COMPLETION UNTIL ALL INTERESTS HAVE BEEN CONSOLIDATED OR A NON-STANDARD UNIT HAS BEEN APPROVED BY THE DIVISION LOT 3 10T 2 LOT 4 LOT 1 **OPERATOR CERTIFICATION** I hereby certify the the information ned herrin is true and complete to the st of my knowledge and belief. Signature David Stewart GEODETIC COORDINATES NAD 27 NME Printed Name Sr. Regulatory Analyst Y=583838.3 N Title X=840452.2 E ଶାଶ୍ୟବଧ Data LAT.=32'36'00.76" N LONG. = 103 13 40.26" W SURVEYOR CERTIFICATION 3604. 600' 1 I hereby certify that the well location sho 3604.0 on this plat was plotted from field notes of actual surveys made by me or under my supervison and that the same is true and 8 760 correct to the best of my belief. Eioso 2005 3604.4 3602.9 DEL Date a SeaMer Signq www.yof 21/05 Certific 12641

DISTRICT I

State of New Mexico)
---------------------	---

Energy, Minerals and Natural Resources Department

1685 N. PRINCE M., SOMM, No. 54540 DISTRICT II

OIL CONSERVATION DIVISION

Form C-102 Revised JUNE 10, 2003 Submit to Appropriate District Office State Lease - 4 Copics Fee Lease - 3 Copics

DISTRICT III 1000 He Brasse Rd., Astoc, NM 87410

1301 W. GRAND AVENUE, ARTENA, JOS 46210

DISTRICT IV

WELL LOCATION AND ACREAGE DEDICATION PLAT

1220 SOUTH ST. FRANCIS DR.

Santa Fe, New Mexico 87505

C AMENDED REPORT

2 /2

API	Number			Pool Code				Pool Name	-	
30-025	- 37155		6	5780			<u> </u>	624	ิ.ศ	
Property (lode				-	rty Nam			Well Nun	ober
34708					STA	TE AI	2			
OGRID No	OGRID No. Operator Name							Elevatio		
192463		·		OXY	USA WI	P Lis	ited Partner	ship	360	5'
					Surfac					
UL ar lot No.	Section	Township	Range	Lot ida	Feet fro	m the	North/South line	Feet from the	East/West line	County
L	2	20-S	37-E		198	30	SOUTH	760	WEST	LEA
	L	1	Bottom	Hole Lo	cation I	f Diffe	rent From Sur	1 face	J	1
UL or lot No.	Section	Township	Rango	Lot idn	Feet fro		North/South line	Feet from the	East/West Line	County
		1							1	1
Dedicated Acre	Joint e	or infill Co	nsolidation	Code 0	rder No.				.	L
40		No								
	WARLE 1	TILL BE A	SSIGNED	TO THIS	COMPLE	TION I	INTIL ALL INTE	RESTS HAVE B	EEN CONSOLID	ATED
							APPROVED BY			
LOT 4		Ľ	DT 3	ł	LOT 2	l	LOT 1	OPERAT	DR CERTIFICAT	rion
	I			(1				dama a bi am
	1			1				11	by certify the the in in is true and compl	-
	I			1		1		11	viedge and belief.	
	1			1						
				}		1			~ / /	,
		ł				1		1 de	·	
L				┢		'_		Signature		
	,	G	EODETIC C	I COORDINA	TES	1		David S	tewart	
	1			7 NME	- 20	1		Printed Nam		
	I		V 607			ł		Sr. Reg	ulatory Ana	lyst
				838.3 N 452.2 E				Title		
	រ	l	~070	TJ2.2 L		1		6	805	
	1		LAT.=32"3	6'00.76"	N			Date		
		LC	ONG.=103	' 13' 40.26	" W	;		SUPVEY	OR CERTIFICAT	
				╆╴╺──					JN CENTIFICA	
				1		1		I hereby certif	y that the well local	ion shown
3604.0'						1			as plotted from field	
600						I			made by me er us that the sume is	
- 760 [°] Ç	200			1		1		1.1	e best of my belie	
				I		- {				
3604.4	3602.9			1		1		MAE	SIG 12, 2005	
				1				Date Survey	S	DEL
				T —		— ; —	,,	Signafur &	SeeME 1.	
- 086				1				Profilesional	Surveyor	۱.
1 16	•					1			(,12641_)]
<u>ا</u> ا								9 man	h tu anni 2	11/05
1 1	ļ			1		1			5 11 0426	
	1			1		I			0.11.042052	
				1				Certificate	OPESSION	12641
1 1				Į					- CAMERAS.	
LI			<u> </u>	L				[<u> </u>