

FSubmit Copy To Appropriate District Office	State of New Me		Form C-103
<u>District 1</u> – (575) 393-6161	Energy, Minerals and Natu	ral Resources	Revised July 18, 2013
1625 N. French Dr., Hobbs, NM 88240 District II – (575) 748-1283		20.01	5-38432
811 S. First St., Artesia, NM 88210 District III – (505) 334-6178	OIL CONSERVATION	DIVISION 5 Inc	licate Type of Lease
$\frac{District III}{1000 \text{ Rio Brazos Rd., Aztec, NM 87410}}$	1220 South St. Fran		STATE STATE
<u>District IV</u> – (505) 476-3460 1220 S. St. Francis Dr., Santa Fe, NM 87505	Santa Fe, NM 87	6. Sta	te Oil & Gas Lease No.
SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A			ase Name or Unit Agreement Name
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)		OR SUCH COTT	ON DRAW UNIT
1. Type of Well: Oil Well 🛛 Gas Well 🗌 Other		8. We 160H	ell Number
2. Name of Operator Devon Energy Production Company, LP		9. OC 6137	GRID Number
3. Address of Operator		10. P	ool name or Wildcat
333 W. Sheridan Avenue, Oklahoma City, OK 73102 4. Well Location			ON DRAW, DELAWARE SOUTH
Unit Letter C:200_feet from theNorth line and2160feet from theWestline			
Section 02	Township 25S	Range 31E	NMPM Eddy County, NM
11. Elevation (Show whether DR, RKB, RT, GR, etc.) 3489.3 KB; 3463.10'GL; 26.2' KB to GL			
12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data			
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:			
— — — ,			ALTERING CASING
TEMPORARILY ABANDON CHANGE PLANS COMMENCE DRILLING OPNS. P AND A PULL OR ALTER CASING MULTIPLE COMPL CASING/CEMENT JOB			
			-
OTHER: OTHER: OTHER: OTHER: OTHER: OTHER:			
of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of			
proposed completion or recompletion.			
1. MIRU. POOH w/2-7/8" production tubing and ESP from 7,876'.			
 Set CIBP @ 8,400'. Spot 30 sx (300') Cl H from 8,400' to 8,100'. Tag TOC. (Delaware open perfs 8,470'-12,702') Spot 25 sx (250') Cl C from 5,100' to 4,850'. Tag TOC. (DV & ECP from 4,989' to 5,014') 			
4. Cut & pull 5-1/2" casing from 4,400".			
5. Spot 70 sx (250') Cl C from 4,450' to 4,200'. Tag TOC. (9-5/8" shoe @ 4,372', Top of Delaware 4,318')			
 Spot 1,020 sx (3,150') Cl C from 4,125' to 975'. Tag TOC. (R111P requires solid plug. B. Salt @ 4,075'. T.Salt @ 1,027') Spot 35 sx (100') Cl C from 818' to 718'. Tag TOC. (13-3/8" shoe @ 768') 			
8. Spot 35 sx (100') Cl C surface plug.			
9. Cut wellhead off. Set dry ho	ole marker.	or plugging of well bore only.	
• 9# mud will be circulated be	Liability un	der bond is retained pending recoi	
	which may t	ubsequent Report of Well Pluggin re found at OCD Web Page under	ARTESIA DISTRICT
	torms, www	.cmnrd.state.nm.us/ocd.	
Spud Date:	Rig Release Da	ite:	
well bare must be	Plusped by 7-23-0	2016	RECEIVED
I hereby certify that the information a	bove is true and complete to the be	est of my knowledge and be	lief.
	Λ.		
SIGNATURE KOMM	ack TITLEOpe	rations_Technician	DATE 6-29-15
Type or print name Ronnie Slack E-mail address: _ Ronnie.Slack@dvn.com PHONE: _405-552-4615			
For State Use Only		Rn . a	shak
APPROVED BY: A DATE 7/03/000 DATE 7/03/000			
* See Attached MAS			

*

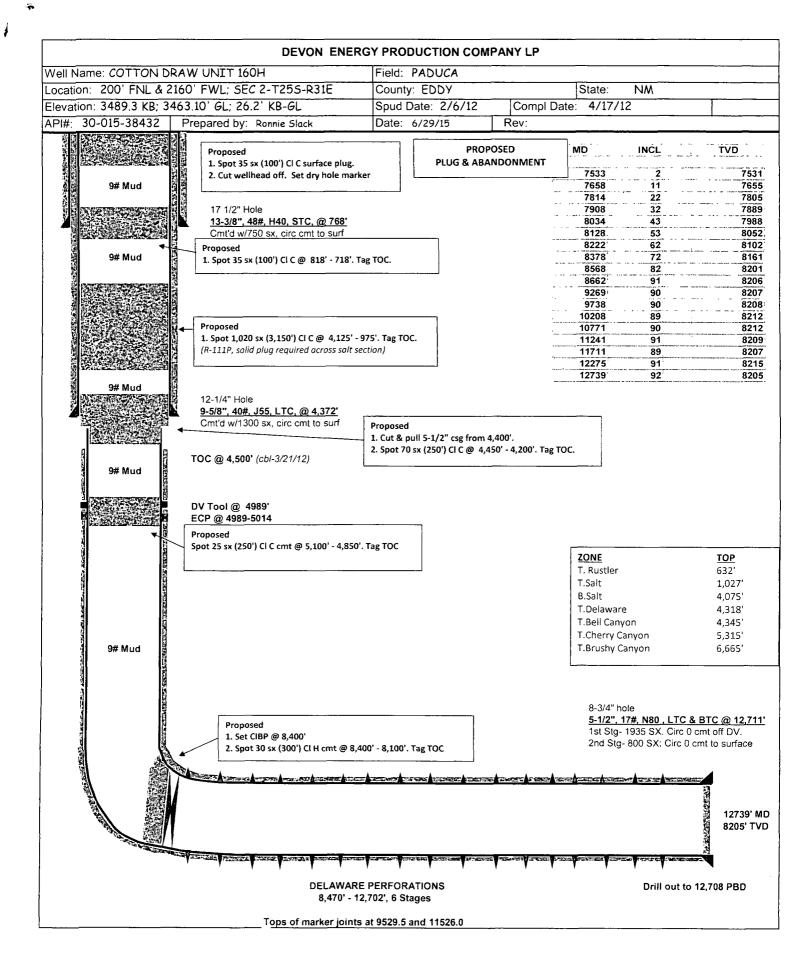

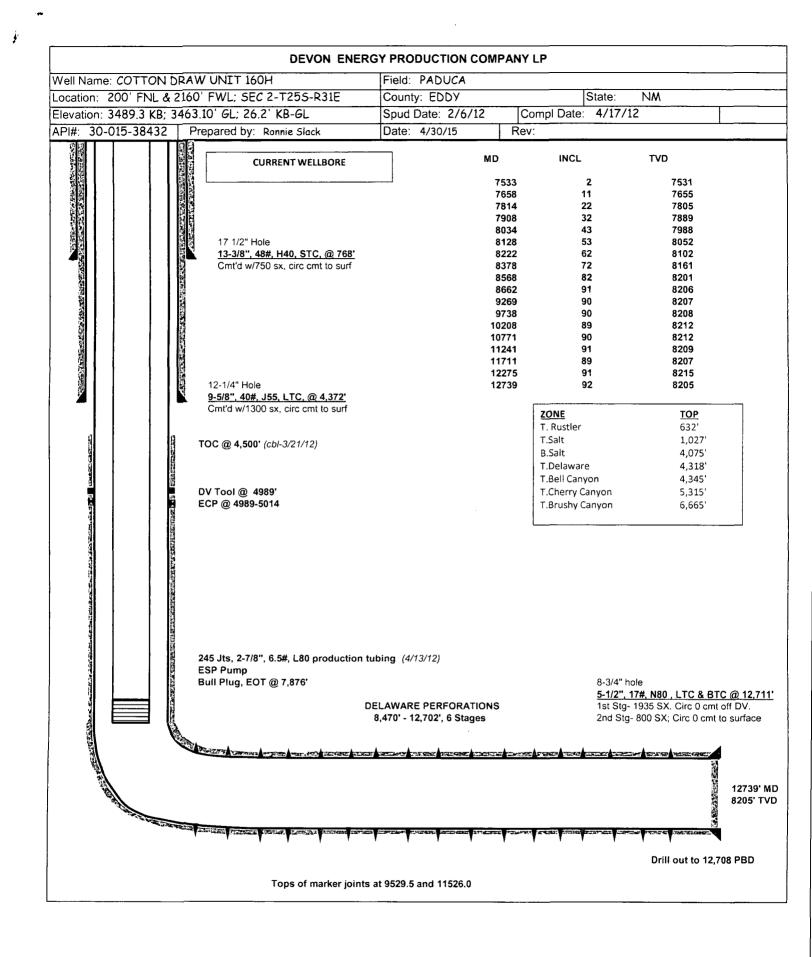

NEW MEXICO OIL CONSERVATION DIVISION DISTRICT 2 OFFICE 811 S. FIRST STREET ARTESIA, NM 88210 (575)748-1283

CONDITIONS OF APPROVAL FOR PLUGGING & ABANDONMENT

Operator: 1000

Well Name & Number: Cotton DrawChit 160H

API #: 30-015-39432

- 1. Produced water <u>will not</u> be used during any part of the plugging & abandonment operation.
- 2. Notify NMOCD Dist. 2 office at least 24 hrs before beginning work.
- 3. Closed Loop System is to be used for entire plugging operation. Upon completion, contents of steel pit are to be hauled to a permitted disposal location.
- 4. Trucking companies being used to haul oilfield waste fluids to a disposal commercial or private shall have an approved NMOCD C-133 permit. A copy of this permit shall be available in each truck used to haul waste products. It is the responsibility of the operator, as well as the contractor, to verify that this permit is place prior to performing work. Drivers shall produce a copy upon request of NMOCD Field Inspectors.
- 5. A subsequent C-103 will serve as notification that the well bore has been plugged ONLY: A C-103 FINAL shall be filed before any bonding can be released on the well. Upon receipt of the Final, an inspection will be performed to verify that the location has been satisfactorily cleaned to NMOCD standards.
- 6. If work has not begun within 90 days of the approval of this procedure, an extension request must be filed, stating reason that well has not been plugged.
- 7. Every attempt must be made to clean the well bore out to below the perfs, before any plugs can be set, by whatever means possible.
- 8. Cement Retainers may not be used.
- 9. Squeeze pressures are not to exceed 500 PSI, unless approval is given by NMOCD.
- 10. Plugs may be combined after consulting with and getting approval from NMOCD.

11. Minimum WOC time for tag plugs will be 4 Hrs.

7/23/05

GUIDELINES FOR PLUGGING AND ABANDONMENT

DISTRICT II / ARTESIA

- All cement plugs will be a minimum of 100' in length or a minimum of 25 sacks of cement, whichever is greater.
- Mud laden fluids must be placed between all cement plugs.
- Mud laden fluids must be mixed at 25 sacks of gel per 100 bbls of water.
- A cement plug is required to be set 50[°] below and 50[°] above all casing shoes and casing stub plugs. These plugs must be tagged.
- A CIBP with 35' of cement on top may be set in lieu of 100' cement plug.
- A plug as indicated above must be placed within 100' of top perforation. This plug must be tagged.
- Plugs set below and above salt zones must be tagged.
- No more than 2000' is to be allowed between cement plugs in open hole and no more than 3000' in cased hole.
- DV tools are required to have a 100' cement plug set 50' above and below the tool and must be tagged.
- Formations to be isolated with plugs placed at the top of each formation are:
 - o Fusselman
 - o Devonian
 - o Morrow
 - o Wolfcamp
 - o Bone Spring
 - o Delaware
 - Any Salt Section (Plug at top and bottom)
 - o Abo
 - o Glorieta
 - Yates (this plus is usually at base of salt section)
- If cement does not exist behind casing strings at recommended formation depths, the casing must be cut and pulled with plugs set at these depths or casing must be perforated and cement squeezed behind casing at the formation depths.
- In the R-111-P area (Potash Mine area) a solid cement plug must be set across the salt section.
 Fluid used to mix the cement shall be saturated with the salts common to the section penetrated and in suitable proportions, but not more than a 3% calcium chloride by weight of cement will be considered the desired mixture whenever possible (50" below and 50' above).