Form 3160-5 (August 2007)

UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

OCD	Artesia

FORM APPROVED OMB NO. 1004-0135 Expires: July 31, 2010

	OMD M	O. 10	,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,	·U
	Expires:	July	31,	2
ase Seria	al No.			

SUNDRY N	OTICES AND REPORTS ON WELLS
Do not use this	form for proposals to drill or to re-enter an
abandoned well.	Use form 3160-3 (APD) for such proposals.

5. Lease Serial No. NMNM13996 6. If Indian, Allottee or Tribe Name

SUBMIT IN TRIPLICATE - Other instructions on reverse side.				7. If Unit or CA/Agreement, Name and/or No.			
1. Type of Well Oil Well Gas Well Other					8. Well Name and No. CEDAR CANYON 22 FEDERAL COM 6H		
2. Name of Operator OXY USA INCORPORATED	Contact: E-Mail: david_stev	DAVID STEV vart@oxy.com	VART		9. API Well N 30-015-4	ło. 3759-00-X1	
			(include area code 5.5717)	10. Field and Pool, or Exploratory UNKNOWN		
4. Location of Well (Footage, Sec., T.	, R., M., or Survey Description	<i>,</i>			11. County or	Parish, and State	
Sec 22 T24S R29E SWSW 1060FSL 207FWL 32.198466 N Lat, 103.979724 W Lon				,	EDDY Co	OUNTY, NM	
12. CHECK APPR	ROPRIATE BOX(ES) TO	O INDICATE	NATURE OF	NOTICE, R	EPORT, OR	OTHER DATA	
TYPE OF SUBMISSION			TYPE O	F ACTION			
The state of the s	☐ Acidize	☐ Dee	pen	☐ Product	tion (Start/Resu	ume) Water Shut-Off	
☑ Notice of Intent	☐ Alter Casing	☐ Frac	ture Treat	☐ Reclam	ation	■ Well Integrity	
☐ Subsequent Report	☐ Casing Repair	□ Nev	Construction	☐ Recom	plete	Other	
☐ Final Abandonment Notice	☐ Change Plans	Plug	and Abandon	☐ Tempo	rarily Abandor		
	☐ Convert to Injection	Plug	g Back	☐ Water I	Disposal.	•	
testing has been completed. Final Abdetermined that the site is ready for fit OXY USA Inc. respectfully registed the hole. See attached for the 1. PU 1000' of 2-7/8" 6.5# tbg 2. Establish circulation at 170 3. Pump cement job at agreetime (70 Bc) is three hours. 4. Under displace cement to I (250' cement above final TOC 5. Trip out of hole at no more to Start with 3 bpm and increase of plug.	inal inspection.) [uest to plug the Cedar Ce WBD for the detail.] [and stinger, trip in hole gpm (cement rate).] [d upon volumes (plug #1 eave 4-5 BBLs of cemen; ~85 psi overbalanced). than 45'/min to 500' abov	to top of fish. Estimated (t inside tubing	deral Com #6H monitoring from the common th	due to lost fish the form the form the following the follo	SEE ATT CONDIT	to surface TACHED FOR TONS OF APPROVAL TO OIL CONSERVATION A OIL CONSERVATION	
14. I hereby certify that the foregoing is	Electronic Submission #				n System	SEP 2 3 2016	
Commit	For OXY USA ted to AFMSS for process	A INCORPORA	TED, sent to the OPHER WALLS	e Carlsbad on 09/12/201	6 (16CRW009	7SF)	
Name (Printed/Typed) DAVID ST	•			LATORY AD		RECEIVED	
						•	
Signature (Electronic S	ubmission)		Date 09/08/2	2016		and	
	THIS SPACE FO	OR FEDERA	L OR STATE	OFFICE U	SE `	4 for 1800	
Approved By (BLM Approver Not	Specified)		Title EV	19 .	Vccebie	d for record	
Conditions of approval, if any, are attached certify that the applicant holds legal or equ which would entitle the applicant to condu	itable title to those rights in the		Office Carlsba		•	R.L.	
Title 18 U.S.C. Section 1001 and Title 43 t States any false, fictitious or fraudulent s					ake to any depart	ment or agency of the United	

Additional data for EC transaction #350524 that would not fit on the form

32. Additional remarks, continued

6. Drop wiper ball

Circulate 3x bottoms up at 300 gpm. (Increased from 170 gpm to 300).

Pick up used 9.875" roller cone bit with bit sub and drill pipe.
 Trip in hole to 500' above plug.
 Wait on cement; 7 hours total from finishing pumping.

- 11. Trip in hole, washing at 300 gpm (100'/min annular velocity).

 12. If no cement is encountered within the top 200'of the top of plug estimate, discuss with FDS, DS and DE.

- DS and DE.

 13. If any cement returns are observed, stop, trip back out to 500' above plug, circulate clean, discuss with FDS, DS, and DE

 14. Tag each cement plug with 15,000 lb.

 15. Trip out of hole with roller cone and drill pipe.

 16. Repeat steps 1-15 for plugs 2-5

 a. Start subsequent plugs at tag depth and callout for additional Class C Neat as needed.

 b. Note that plug #5 has 2% Calcium Chloride and is meant to be the last plug c. Plug #5 70 Bc: 3 hrs 26 minutes

 d. 500 psi compressive strength: 5 hours 39 minutes

 17. Pull out of hole

 18. Wait on cement 7 hours (~500 psi compressive strength) while conducting SIMOPS in preparation to skid the rig to skid the ria.
- 19. Prepare to skid to the Cedar Canyon 22 Federal Com 5H

All cement plugs must be tagged.

OXY USA Inc Cedar Canyon 22 Federal Com #6H API No. 30-015-43759

M&P 190sx @ 167'-Surface


M&P 380sx cmt @ 590-174' Tagged

M&P 480sx cmt @ 1356-599' Tagged

M&P 480sx cmt @ 3009-1368' Tagged

M&P 586sx cmt @ 3678-2940'

Fish @ 3684-4972' - Bit, BHA, DC, HWDP

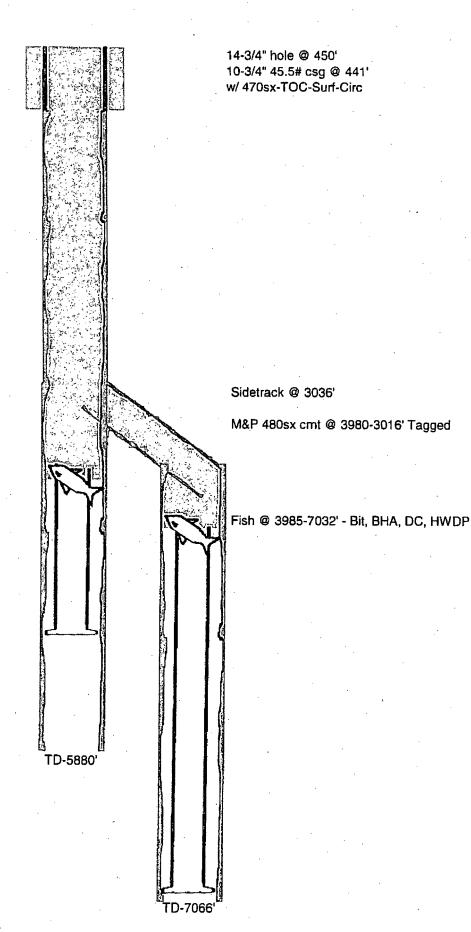

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

- 2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.
- 3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of **brine** water. Minimum nine (9) pounds per gallon.
- 5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. Dry Hole Marker: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off.

The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement, unless otherwise noted in COA (requirements will be attached). The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds).

- 7. <u>Subsequent Plugging Reporting:</u> Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date well was plugged.**
- 8. <u>Trash</u>: All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.