UNITED STATES DEPARTMENT OF THE INTERIOR **BUREAU OF LAND MANAGEMENT**

OCD Artesias

FORM APPROVED OMB NO. 1004-0137 Expires: January 31, 2018

5. Lease Serial No. NMNM10934

SUNDRY NOTICES AND REPORTS ON WELLS						NMNM10934		
SUNDRY NOTICES AND REPORTS ON WELLS Do not use this form for proposals to drill or to re-enter en abandoned well. Use form 3160-3 (APD) for such proposals.						Indian, Allottee or	Tribe Name	
SUBMIT IN TRIPLICATE - Other instructions on p					RECONT	7. If Unit or CA/Agree	nent, Name and/or	No.
1. Type of Well Gas Well Other: UNKNOWN OTH					8. Well Name and No. CC FRISTOE A -1 06			
2. Name of Operator Contact: CINDY H MU CHEVRON USA INCORPORATED E-Mail: CHERRERAMURILLO@C				N.COM		9. API Well No. 30-025-11371-00-D1		
3a. Address 6301 DEAUVILLE BLVD MIDLAND, TX 79706	3b. Phone No. (include area code) Ph: 575-263-0431 Fx: 575-263-0445				10. Field and Pool or Exploratory Area JALMAT-TAN-YATES-7RVRS LANGLIE MATTIX-7RVRS-QN-GB			
4. Location of Well (Footage, Sec., T., R., M., or Survey Description)				11. County or Parish, S			tate	
Sec 35 T24S R37E NWNW 660FNL 660FWL				LEA COUNTY,			IM	
12. CHECK THE A	PPROPRIATE BOX(ES)	TO INDICA	TE NAT	TURE OF	NOTICE,	REPORT, OR OTH	ER DATA	
TYPE OF SUBMISSION TYPE OF ACTION								
Notice of Intent	☐ Acidize	☐ Deep	pen	en		tion (Start/Resume)	☐ Water Shut-0	Off
	☐ Alter Casing	☐ Hyd	draulic Fracturing		☐ Reclamation		☐ Well Integrit	y
☐ Subsequent Report	□ Casing Repair	□ New	Constru	iction	☐ Recomplete		Other	
☐ Final Abandonment Notice	☐ Change Plans	lug	Plug and Abandon		☐ Tempor	☐ Temporarily Abandon		
	Convert to Injection	Plug	☐ Plug Back		☐ Water Disposal			
following completion of the involved testing has been completed. Final Al determined that the site is ready for f. CHEVRON USA INC IS REQUENCED FLOWERS/BLM. PLEASE FIND ATTACHED PEREE TO CONTACT LONNIE	pandonment Notices must be fil- inal inspection. UESTING TO PLUG AND &A PROCEDURE AND C	ed only after all r ABANDON I CURRENT WE	requireme THE AB ELLBOR	ents, includi OVE WEI RE. IF YO	ng reclamation LL. THIS H U HAVE A	n, have been completed a	ed the operator has	
		RECEIVE	Ď					
OCT 2 5 2018 DISTRICT II-ARTESIA O.C.D.						EE ATTACHE CONDITIONS (VAL
14. I hereby certify that the foregoing is true and correct. Electronic Submission #439028 verified by the BLM Well Information System For CHEVRON USA INCORPORATED, sent to the Hobbs Committed to AFMSS for processing by JIM AMOS on 10/10/2018 (19JA0002SE)								
Name (Printed/Typed) CINDY H MURILLO			Title	· · · · · · · · · · · · · · · · · · ·				
Signature (Electronic S	Submission)		Date	10/10/20	18			
	THIS SPACE FO	R FEDERA	LOR	STATE (OFFICE U	SE	environ in the colors of	
Approved By James	a. ams		Title	Sup	v. PE	T	18-11- Date	-18
Conditions of approval of any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon.			Office	Carl	lsbad	field 0	Hice	
Title 18 U.S.C. Section 1001 and Title 43 States any false, fictitious or fraudulent	U.S.C. Section 1212, make it a	crime for any pe	rson knov	wingly and v	willfully to m	ake to any department or	gency of the United	i

(Instructions on page 2)
*** BLM REVISED ** BLM REVISED ** BLM REVISED ** BLM REVISED **

FOR RECORD ONLY

NMOCD 11/26/18

- MIRU Tier 1 workover rig.
 RU slickline, test lubricator, RIH w/ gauge ring to SN. Set 2.25F profile plug and test tubing.
- Monitor well for 15 minutes (WSEA 10A) and ND WH and NU Class II

 2. BOP with 3 1/2" pipe rams (WSEA 8A). Pressure test BOP to 250 psi low and 500 psi high for 5 minutes each chart. (WSEA 9)

RU slickline, test lubricator, RIH w/ to retrieve plug.

- 3. Release AS-1X, kill well as necessary and POOH and laying down 3 1/2" injection tubing.
 - SI Blind rams. Chagne 3 1/2" rams to 2 7/8" rams. (WSEA 8B). Pressure test BOP to 250 psi low and 500 psi high for 5 minutes each chart. (WSEA 9)

RIH w/ tension packer on 2 7/8" L-80 WS and set @ 3320. Test casing

- 4. to 500 psi. Establish injection rate into formation for 50 bbls. Release pkr, POOH
 - RIH w/ retainer and set @ 3320, squeeze open hole w/ Petroplex's
- 5. recommendation and leave 100' on top of retainer WOC tag and pressure test.
- 2658 2846 6. spot cement across yates 2600-2800. WOC, tag, and pressure test

Tie onto intermediate casing and establish rate into formation. Report rate and pressure back to engineer. If rate and pressures are acceptable we will pump a top job down intermediate(8 5/8" X 7" annulus)30 bbl capacity. Have 100% excess on location. Do not exceed 500 psi


Tie onto intermediate casing and establish rate into formation. Report rate and pressure back to engineer. If rate and pressures are acceptable we will pump a top job down surface(10 3/4"X 8 5/8" annulus) 24 bbl capacity. Have 100% excess on location. Do not exceed 500 psi.

All. BISALT Plan Shot OS ST From 2345 - 2145. WOC Tag 9. Spot shoe plug from 1245-1345. WOC, tag, and pressure test

perf @ 1040, break circulation down 5 1/2" and up 7". Notify Engineer if you cant circulate. RIH w/ packer and set @ ~650, circulate cement to surface, go to flush and displace cement to ~850. WOC, tag and pressure test

Spot surface plug from 60' to surface.
 Flow check well, ND BOP, NU B-1 flange and bull plug. RDMO

At cut-off verify ent to surt, all annulas

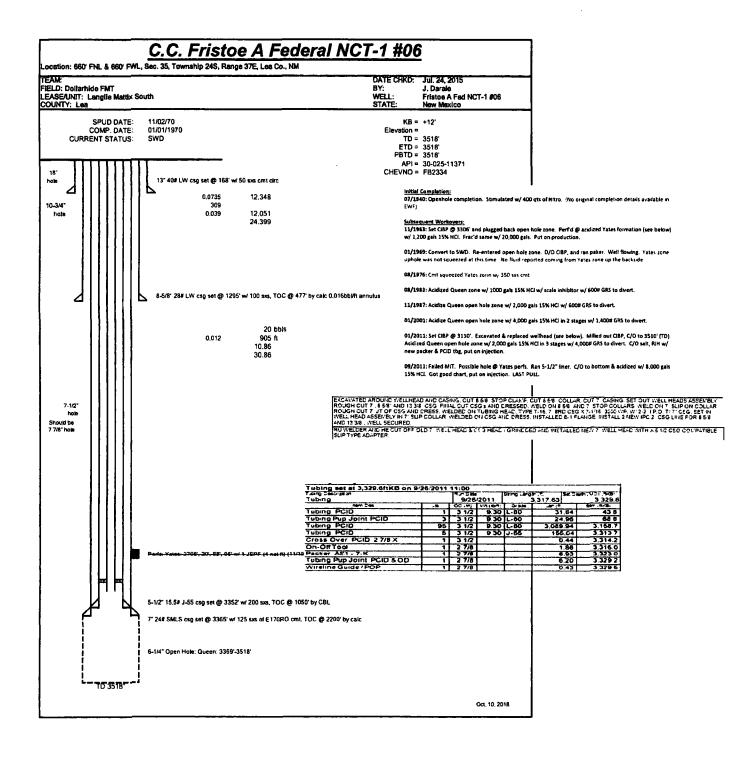

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

- 2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.
- 3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of **brine** water. Minimum nine (9) pounds per gallon.
- 5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. Dry Hole Marker: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off.

The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement, unless otherwise noted in COA (requirements will be attached). The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds).

- 7. <u>Subsequent Plugging Reporting:</u> Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date well was plugged.**
- 8. <u>Trash:</u> All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.