

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO. 30-025-24996
5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No. LG 1733
7. Lease Name or Unit Agreement Name Bagley State
8. Well No. 1
9. Pool name or Wildcat North Bagley Permo Penn

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>
2. Name of Operator ELK OIL COMPANY
3. Address of Operator P.O. Box 310, Roswell, New Mexico 88202-0310
4. Well Location Unit Letter <u>P</u> : <u>660</u> Feet From The <u>East</u> Line and <u>660</u> Feet From The <u>South</u> Line Section <u>36</u> Township <u>11S</u> Range <u>32E</u> NMPM <u>Lea</u> County <u></u>

10. Elevation (Show whether DF, RKB, RT, GR, etc.) 4314 GR

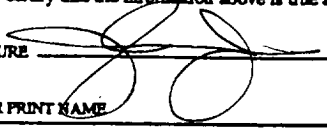
11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>
OTHER: <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
	CASING TEST AND CEMENT JOB <input type="checkbox"/>
	OTHER: <input type="checkbox"/>

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

Plugged and abandoned well as follows:

- 1) Set CIBP and 35' cement over perfs @ 8700'.
- 2) Recover 6000' 5½" Casing +/-.
- 3) Set 100' Plug (50' in 50' out) 5½" casing stub.
- 4) Set 100' Plug @ 8 5/8 Shoe (3755').
- 5) Recover 1000' 8 5/8" Casing +/-.
- 6) Set 100' Plug (50' in 50' out) 8 5/8 casing stub.
- 7) Set 100' Plug @ 12 3/4 Shoe (397').
- 8) Set 10 sxs surfact plug.
- 9) Install dry hole marker.
- 10) Cleanup location.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE 	TITLE <u>President</u>	DATE <u>4/3/89</u>
TYPE OR PRINT NAME		TELEPHONE NO.

(This space for State Use)

ORIGINAL SIGNED BY JERRY SEXTON
DISTRICT I SUPERVISOR

APPROVED BY _____ TITLE _____ DATE _____

CONDITIONS OF APPROVAL, IF ANY:

APR 6 1989