

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103
Supersedes Old
C-102 and C-103
Effective 1-1-65

5a. Indicate Type of Lease
State <input checked="" type="checkbox"/> Fee <input type="checkbox"/>
5. State Oil & Gas Lease No.
E-8244

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>	7. Unit Agreement Name
2. Name of Operator	Jalmat Field Yates Sd. Unit
3. Address of Operator	8. Farm or Lease Name
P. O. Box 670, Hobbs, N.M. 88240	
4. Location of Well	9. Well No.
UNIT LETTER G , 1980 FEET FROM THE North LINE AND 2310 FEET FROM	109
THE east LINE, SECTION 11 TOWNSHIP 22S RANGE 35E NMPM.	10. Field and Pool, or Wildcat
	Jalmat
15. Elevation (Show whether DF, RT, GR, etc.)	12. County
3615' GL	Lea

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>

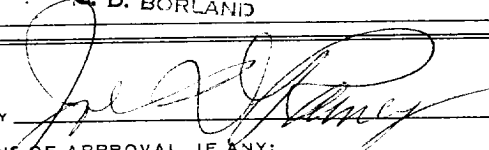
SUBSEQUENT REPORT OF:

REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
CASING TEST AND CEMENT JOBS <input type="checkbox"/>	
OTHER Clean out & frac treat <input checked="" type="checkbox"/>	

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

4015' PB. Dumped 500 gals NE double inhibited acid down esg; dumped 40 bo down casing; started pumping to clean up for frac treating. Pulled rods, pump and 2-3/8" tubing. Ran 4-3/4" bit & 5 1/2" casing scraper on 2-7/8" tubing and cleaned out scale and formation 4093-4015' PB. Circulated hole clean. Pulled tubing, casing scraper & bit. Ran Baker PB packer on 2-7/8" tubing set at 3810'. Loaded casing and pressured to 1000#. Frac treated with 8,000 gallons gelled 9.2# brine with 25# per 1000 gallons friction reducer & gelling agent; 20# per 1000 gallons Adomite Aqua; 1 gallon per 1000 gallons J-4 demulsifier, 6750# 20-40 sand and 1000 gallons gelled 10# brine with 1100# rock salt. Flushed with 30 barrels frac fluid. Average injection rate 16 bpm at 3000#. Pressure dropped to 1650# immediately after shut down; 1600# in 15 minutes. Shut in 13 hours; pressure 1450#. Swabbed and cleaned up. Released packer and pulled out of hole. Ran 4-3/4" bit on 2-7/8" tubing and cleaned out 3940-4015' PB. Circulated hole clean, pulled out of hole. Ran 130 jts, 3987', 2-3/8" tubing and set at 4000'. Ran rods and pump and returned well to production.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

ORIGINAL SIGNED BY	TITLE	DATE
SIGNED C. D. BORLAND	Area Production Manager	11-18-69
APPROVED BY 	TITLE SUPERVISOR	DATE NOV
CONDITIONS OF APPROVAL, IF ANY:		