Operator MEW Enterprise
Well Federal #5
Unit M Section 33 Twnship 6 Range 26
API # 30-005-10063

TOPS

San Andres ~ 900'

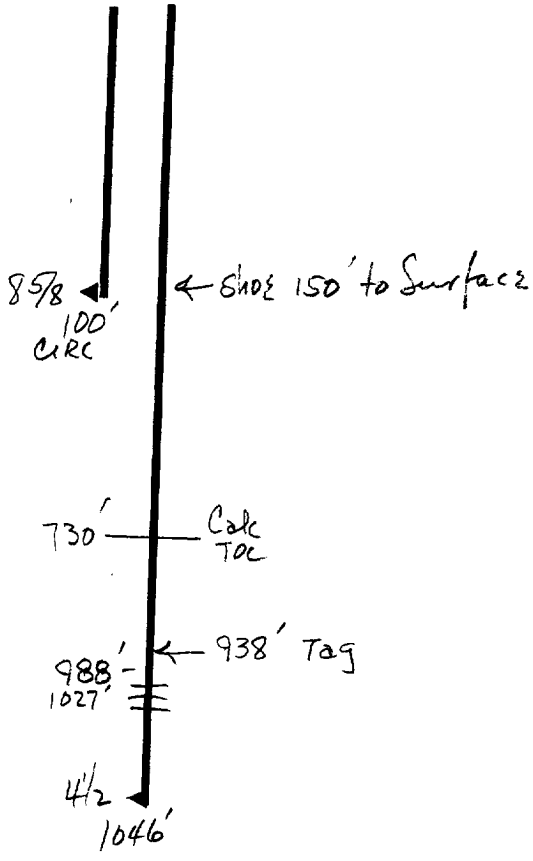

* Contact OCD 24 hrs. prior to any work done.
* Salt gel mud consisting of 10# brine with 25# of gel per barrel must be placed between each plug.
* Install dry hole marker as per Rule 202.B.2
* Plugs are to be set from point indicated **up.**
* Plugs must not be less than 100' or 25 Sacks of cement, whichever is greater, unless specifically indicated.
* Shoe and stub plugs will be 50' above and below shoe or stub and tagged.
* Surface plug will be from 0' - 60'
* Where plugs are required, cement must be placed inside and outside of **all** casing string(s) in the correct footage or sacks required, **if no cement exists.**
* Plugs to be tagged will be indicated.