

Submit 1 Copy To Appropriate District Office
District I - (575) 393-6161
1625 N. French Dr., Hobbs, NM 88240
District II - (575) 748-1283
811 S. First St., Artesia, NM 88210
District III - (505) 334-6178
1000 Rio Brazos Rd., Aztec, NM 87410
District IV - (505) 476-3460
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103
Revised August 1, 2011

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)		WELL API NO. 30-015-10077
1. Type of Well: Oil Well <input checked="" type="checkbox"/> Gas Well <input type="checkbox"/> Other <input type="checkbox"/>		5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
2. Name of Operator QUANTUM RESOURCES MANAGEMENT, LLC		6. State Oil & Gas Lease No.
3. Address of Operator 1400 MCKINNEY ST. SUITE 2400 HOUSTON, TX 77010		7. Lease Name or Unit Agreement Name ARTESIA UNIT
4. Well Location Unit Letter _____ M _____ : 330 _____ feet from the _____ S _____ line and _____ 330 _____ feet from the _____ W _____ line Section 30 Township 17S Range 28E NMPM EDDY County		8. Well Number 6
11. Elevation (Show whether DR, RKB, RT, GR, etc.)		9. OGRID Number 243874
		10. Pool name or Wildcat ARTESIA - Q - RB - SA

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:
PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐ MULTIPLE COMPL ☐
DOWNHOLE COMMINGLE ☐

OTHER: ☐

SUBSEQUENT REPORT OF:
REMEDIAL WORK ☐ ALTERING ☐
COMMENCE DRILLING OPERATIONS ☐
CASING/CEMENT ☐

OTHER: ☐

13. Describe proposed or completed operations. (Clearly state all pertinent details of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple operations, attach separate reports for each operation.

MIRU RIG. NU BOP.
SET CIBP AT 1731'. CIRC W/ MUD LADEN FLUID
SPOT 25 SX CMT ON CIBP
PERFORATE AT 544' AND CIRCULATE CMT TO SURFACE INSIDE/OUTSIDE 4 1/2" CSG.
CUT OFF WELLHEAD AND INSTALL DRY HOLE MARKER.

CONDITIONS OF APPROVAL ATTACHED

Approval Granted providing work is
Spud Completed by

Oct 22, 2014

Approved for plugging of well bore only.
Liability under bond is retained pending receipt
of C-103 (Subsequent Report of Well Plugging)
Rig Release Date: _____
Forms: www.emnrd.state.nm.us/ocd.

RECEIVED
OCT 18 2013
NMOCD ARTESIA

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Ben Montgomery TITLE Agent DATE 10-17-13

Type or print name Ben Montgomery E-mail address: ben@benmontgomery.com PHONE: 732-580-7161
For State Use Only


APPROVED BY: [Signature] TITLE Dist. Supervisor DATE 10/22/13

Conditions of Approval (if any):


Attached COA's

QUANTUM RESOURCES MST, LLC
ARTESIA UNIT # 6

CURRENT

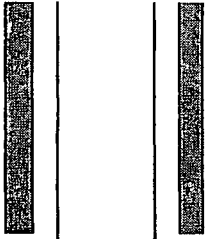

8 5/8" @ 494' w/ 75 sx. Circ.

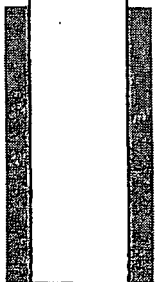

Perfs 1781'-2258'


4 1/2" @ 2291' w/ 175 sx. TOC calc at 1177'.

TD 2291'

QUANTUM RESOURCES MST, LLC
ARTESIA UNIT # 6


PROPOSED

CUT OFF WELLHEAD & INSTALL DRY HOLE MARKER

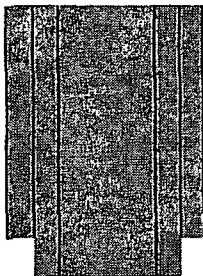

8 5/8" @ 494' w/ 75 sx. Circ.

PERF AT 544'. CIRC CEMENT TO SURFACE.

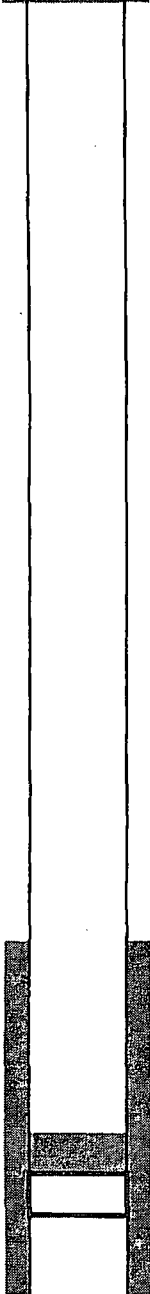

CALCULATED TOC 1177'

Perfs 1781'-2258'

SET CIBP AT 1731'. CAP W/ 25 SX.

4 1/2" @ 2291' w/ 175 sx. TOC calc at 1177'.

TD 2291'

NEW MEXICO OIL CONSERVATION DIVISION
DISTRICT 2 OFFICE
811 S. FIRST STREET
ARTESIA, NM 88210
(575)748-1283

CONDITIONS OF APPROVAL FOR PLUGGING & ABANDONMENT

Operator: Quantum

Well Name & Number: ARTESIA Unit #6

API #: 30 - 015 - 10077

1. Produced water **will not** be used during any part of the plugging & abandonment operation.
2. Notify NMOCD Dist. 2 office at least 24 hrs before beginning work.
3. Closed Loop System is to be used for entire plugging operation. Upon completion, contents of steel pit are to be hauled to a permitted disposal location.
4. Trucking companies being used to haul oilfield waste fluids to a disposal – commercial or private – shall have an approved NMOCD C-133 permit. A copy of this permit shall be available in each truck used to haul waste products. It is the responsibility of the operator, as well as the contractor, to verify that this permit is place prior to performing work. Drivers shall produce a copy upon request of NMOCD Field Inspectors.
5. A subsequent C-103 will serve as notification that the well bore has been plugged **ONLY**. A C-103 FINAL shall be filed before any bonding can be released on the well. Upon receipt of the Final, an inspection will be performed to verify that the location has been satisfactorily cleaned to NMOCD standards.
6. If work has not begun within 90 days of the approval of this procedure, an extension request must be filed, stating reason that well has not been plugged.
7. Every attempt must be made to clean the well bore out to below the perfs, before any plugs can be set, by whatever means possible.
8. **Cement Retainers may not be used.**

9. Squeeze pressures are not to exceed 500 PSI, unless approval is given by NMOCD.
10. Plugs may be combined after consulting with and getting approval from NMOCD.
11. Minimum WOC time for tag plugs will be 4 Hrs.

DATE: 10/22/2013

APPROVED BY:

RDade

GUIDELINES FOR PLUGGING AND ABANDONMENT

DISTRICT II / ARTESIA

- All cement plugs will be a minimum of 100' in length or a minimum of 25 sacks of cement, whichever is greater.
- Mud laden fluids must be placed between all cement plugs.
- Mud laden fluids must be mixed at 25 sacks of gel per 100 bbls of water.
- A cement plug is required to be set 50' below and 50' above all casing shoes and casing stub plugs. These plugs must be tagged.
- A CIBP with 35' of cement on top may be set in lieu of 100' cement plug.
- A plug as indicated above must be placed within 100' of top perforation. This plug must be tagged.
- Plugs set below and above salt zones must be tagged.
- No more than 2000' is to be allowed between cement plugs in open hole and no more than 3000' in cased hole.
- DV tools are required to have a 100' cement plug set 50' above and below the tool and must be tagged.
- Formations to be isolated with plugs placed at the top of each formation are:
 - Fusselman
 - Devonian
 - Morrow
 - Wolfcamp
 - Bone Spring
 - Delaware
 - Any Salt Section (Plug at top and bottom)
 - Abo
 - Glorieta
 - Yates (this plus is usually at base of salt section)
- If cement does not exist behind casing strings at recommended formation depths, the casing must be cut and pulled with plugs set at these depths or casing must be perforated and cement squeezed behind casing at the formation depths.
- In the R-111-P area (Potash Mine area) a solid cement plug must be set across the salt section. Fluid used to mix the cement shall be saturated with the salts common to the section penetrated and in suitable proportions, but not more than a 3% calcium chloride by weight of cement will be considered the desired mixture whenever possible (50' below and 50' above).