Submit I Copy To Appropriate District	State of New Mexico)	Form C-103		
Office <u>District 1</u> – (575) 393-6161	Energy, Minerals and Natural F	Resources	Revised August 1, 2011		
1625 N. French Dr., Hobbs, NM 88240			WELL API NO.		
District II - (575) 748-1283	OIL CONSERVATION DI	V 1 3 11 11 11 11 11 11 11 11 11 11 11 11	30-015-34120		
811 S. First St., Artesia, NM 88210 <u>District III</u> – (505) 334-6178	1220 South St. Francis	D _m 5. Indicate	Type of Lease		
1000 Rio Brazos Rd., Aztec, NM 87410		31 <i>H</i>	STATE X FEE		
District IV - (505) 476-3460	Santa Fe, NM 87505	6. State Oi	I & Gas Lease No.		
1220 S. St. Francis Dr., Santa Fe, NM 87505	·				
	ICES AND REPORTS ON WELLS	7. Lease N	ame or Unit Agreement Name		
(DO NOT USE THIS FORM FOR PROPC	SALS TO DRILL OR TO DEEPEN OR PLUG BA	ACK TO A	<i>y</i>		
	CATION FOR PERMIT" (FORM C-101) FOR SU	CP STATE	COM		
PROPOSALS.)	Con Wall Other	8. Well Nu			
Type of Well: Oil Well X Gas Well Other			001		
2. Name of Operator		9. OGRID	Number		
CIMAREX ENERGY CO. OF CO.	LORADO	162683			
3. Address of Operator			10. Pool name or Wildcat		
600 N. MARIENFELD, SUITE 600, MIDLAND, TEXAS 79701			EMPIRE; MORROW, SOUTH		
4. Well Location			· · · · · ·		
Unit Letter P: 13	S10 feet from the SOUTH line	and 660 feet from the	EAST line		
Section 19	Township 17S Ran				
Section 19	11. Elevation (Show whether DR, RKI		County		
	3,655' - GR	5, K1, GK, etc.)			
***************************************		•			
12 01 1	A	CNI 41 D	0.4 D /		
12. Check	Appropriate Box to Indicate Natur	e of Notice, Report or C	Other Data		
NOTICE OF IN	ITENTION TO:	CLIDGEOLIEN.	T REPORT OF:		
<u> </u>	PERFORM REMEDIAL WORK PLUG AND ABANDON X REMEDIAL WOR		_		
TEMPORARILY ABANDON DIVINOR ALTER CACINO		MMENCE DRILLING OPNS	S.☐ P AND A		
PULL OR ALTER CASING	MULTIPLE COMPL	SING/CEMENT JOB			
DOWNHOLE COMMINGLE		ł			
OTHER:		HER:			
	pleted operations. (Clearly state all perting		ent dates, including estimated date		
	ork). SEE RULE 19.15.7.14 NMAC. For				
proposed completion or rec		n wampie completions. 11	tuen wendere diagram or		
	0'; PUMP 30 SXS. CMT. @ 10,580'-10	380' (T/MRRW): CIRC W	ELL W/ PXA MUD.		
2) PUMP 30 SXS. CMT. @ 8	3.082'-7.902' (DV TOOL).				
	7,327'-7,157' (T/ WC.); WOC X TAG C	MT. PLUG.	RECEIVED		
4) PUMP 25 SXS. CMT. @ 5,981'-5,821' (T/ABO).					
5) PUMP 25 SXS, CMT. @ 4,572'-4,432' (9-5/8" CSG.SHOE); WOC X TAG CMT			DEC 3 0 2013		
6) CUT X PULL 5-1/2" CSG. @ +/-3,000'.			DEC 3 0 E019		
7) PUMP 40 SXS. CMT. @ 3,065'-2,935' (5-1/2" CSG.STUB); WOC X TAG CMT. PLUG.					
0) 10.11 00 01.11 (1) 11.11 00)					
	675'-475' (13-3/8" CSG. SHOE); WOC	X TAG CMT. PLUG.			
10) CIRC. 25 SXS. CMT. @ 6					
11) DIG OUT X CUT OFF W	ELLHEAD 3' B.G.L.; WELD ON STEE	L PLATE TO CSGS. X INS	STALL DRY HOLE MARKER.		
DUDING THE BROCEDING	WE DIAN TO HER THE OLOGED LO	OD CHOTEN MITH A CT			
	WE PLAN TO USE THE CLOSED-LC		EEL TANK AND HAUL		
-	RED DISPOSAL, PER OCD RUNLE 19				
CONDITIONS OF APPROVAL ATTAC	CHED	Approve	ed for plugging of well bore only		
		- inclint	Hilliogr board to an a		
Approval Granted providing wo	rk is		av be found at OCD Will pr		
Completed by	Rig Release Date:	Forms, w	ww.cmnrd.state.nm.us/ocd.		
Jan 2, 20	115		The state of the s		
I hereby certify that the information	above is true and complete to the best of	my knowledge and belief.	·		
4)	$\langle \Delta \rangle / Q$	"			
SIGNATURE Que	TITLE: AGE		DATE: 12/28/13		
Type or print name: DAVID A. E.	YLER > E-mail.address: DEYLE	R@MILAGRO-RES.COM	PHONE: 432,687.3033		
For State Use Only					


DATE Jan 2, 3014


APPROVED BY: See Attached COA'S

TITLE DIST To Security

Conditions of Approval (if any):

See Attached COA'S

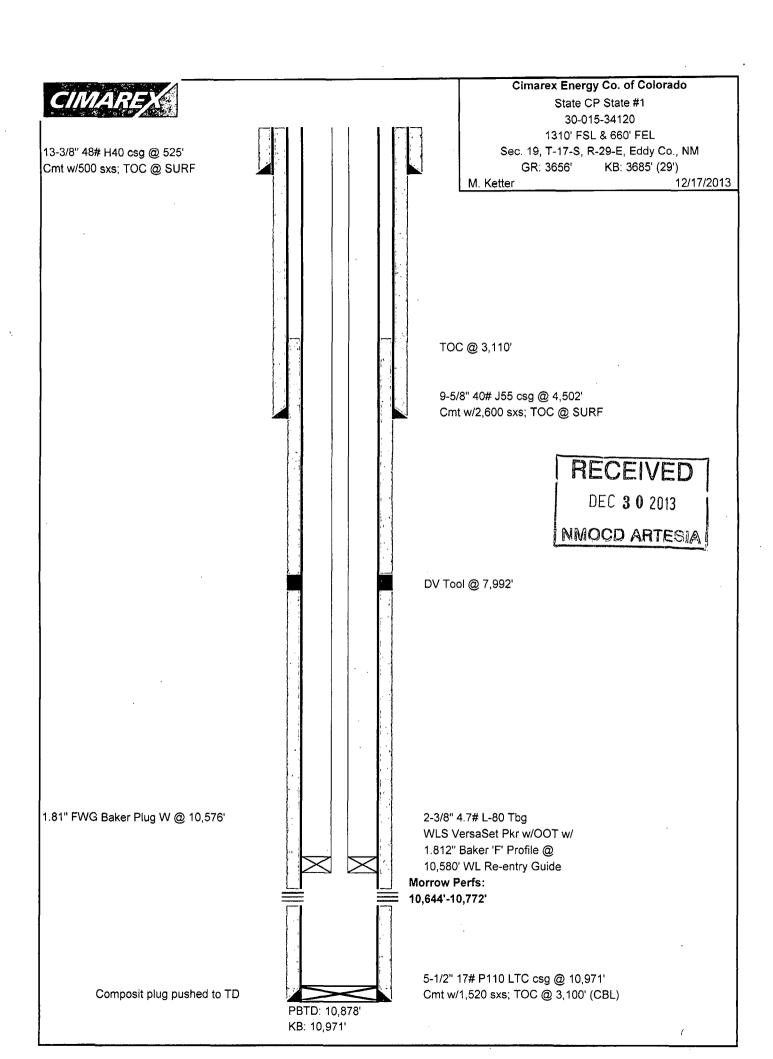

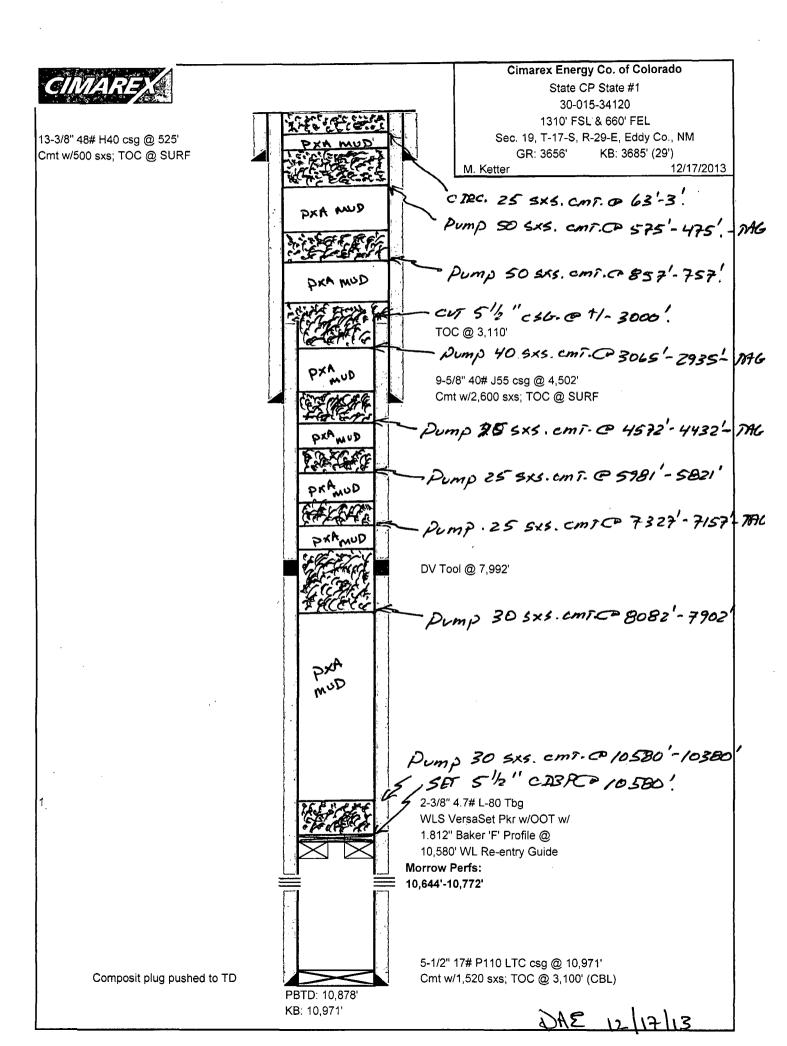

NEW MEXICO OIL CONSERVATION DIVISION DISTRICT 2 OFFICE 811 S. FIRST STREET ARTESIA, NM 88210 (575)748-1283

CONDITIONS OF APPROVAL FOR PLUGGING & ABANDONMENT

Operator:	Cimerax			
Well Name	& Number: Cf	State	Com 21	
API #:	30-015-34	1120		

- 1. Produced water <u>will not</u> be used during any part of the plugging & abandonment operation.
- 2. Notify NMOCD Dist. 2 office at least 24 hrs before beginning work.
- 3. Closed Loop System is to be used for entire plugging operation. Upon completion, contents of steel pit are to be hauled to a permitted disposal location.
- 4. Trucking companies being used to haul oilfield waste fluids to a disposal commercial or private shall have an approved NMOCD C-133 permit. A copy of this permit shall be available in each truck used to haul waste products. It is the responsibility of the operator, as well as the contractor, to verify that this permit is place prior to performing work. Drivers shall produce a copy upon request of NMOCD Field Inspectors.
- 5. A subsequent C-103 will serve as notification that the well bore has been plugged ONLY. A C-103 FINAL shall be filed before any bonding can be released on the well. Upon receipt of the Final, an inspection will be performed to verify that the location has been satisfactorily cleaned to NMOCD standards.
- 6. If work has not begun within 90 days of the approval of this procedure, an extension request must be filed, stating reason that well has not been plugged.
- 7. Every attempt must be made to clean the well bore out to below the perfs, before any plugs can be set, by whatever means possible.
- 8. Cement Retainers may not be used.

- 9. Squeeze pressures are not to exceed 500 PSI, unless approval is given by NMOCD.
- 10. Plugs may be combined after consulting with and getting approval from NMOCD.
- 11. Minimum WOC time for tag plugs will be 4 Hrs.

DATE: Jand, 2014

APPROVED BY: FRedak

GUIDELINES FOR PLUGGING AND ABANDONMENT

DISTRICT II / ARTESIA

- All cement plugs will be a minimum of 100' in length or a minimum of 25 sacks of cement, whichever is greater.
- Mud laden fluids must be placed between all cement plugs.
- Mud laden fluids must be mixed at 25 sacks of gel per 100 bbls of water.
- A cement plug is required to be set 50' below and 50' above all casing shoes and casing stub plugs. These plugs must be tagged.
- A CIBP with 35' of cement on top may be set in lieu of 100' cement plug.
- A plug as indicated above must be placed within 100' of top perforation. This plug must be tagged.
- Plugs set below and above salt zones must be tagged.
- No more than 2000' is to be allowed between cement plugs in open hole and no more than 3000' in cased hole.
- DV tools are required to have a 100' cement plug set 50' above and below the tool and must be tagged.
- Formations to be isolated with plugs placed at the top of each formation are:
 - o Fusselman
 - o Devonian
 - o Morrow
 - o Wolfcamp
 - o Bone Spring
 - o Delaware
 - o Any Salt Section (Plug at top and bottom)
 - o Abo
 - o Glorieta
 - Yates (this plus is usually at base of salt section)
- If cement does not exist behind casing strings at recommended formation depths, the casing must be cut and pulled with plugs set at these depths or casing must be perforated and cement squeezed behind casing at the formation depths.
- In the R-111-P area (Potash Mine area) a solid cement plug must be set across the salt section. Fluid used to mix the cement shall be saturated with the salts common to the section penetrated and in suitable proportions, but not more than a 3% calcium chloride by weight of cement will be considered the desired mixture whenever possible (50' below and 50' above).