
(August 2007)	UNITED STATES DEPARTMENT OF THE INTERIOR				OCD Artesla		0	FORM APPROVED OMB No. 1004-0137 Expirer (July 3) - 2010		
	U OF LAND MANAGEMENT			OCD AI LESIG		5. Lease Serial No.				
SUMP		ICES AND REPO			FIIS		NMNM0405444A	10 11 XI		
Do not use	this forn	for proposals to Form 3160-3 (A	to drill	l or to	re-enter an		6. If Indian, Allottee o	r Tribe Name		
5	UBMIT IN	TRIPLICATE – Other	r instruct	tions or	page 2.		7. If Unit of CA/Agree	ement, Name and/or l	No.	
. Type of Well	Gas Well	Other					8. Well Name and No. TODD 22 D FEDER			
2. Name of Operator DEVON ENERGY PRODUCTION COMPANY, LP						9. API Well No. 30-015-32880				
3a. Address     3b. Phone No. (include area code)       333 West Sheridan Avenue, Oklahoma City, OK 73102-5015     3b. Phone No. (include area code)							10. Field and Pool or Exploratory Area INGLE WELLS;DELAWARE			
405-552-4615 4. Location of Well (Footage, Sec., T.R.M., or Survey Description) 660 FNL & 710 FWL; SEC 22-T23S-R31E							11. Country or Parish, EDDY, NM	State		
12.	CHECK T	HE APPROPRIATE BO	DX(ES) 1	FO IND	CATE NATURE	OF NO	TICE, REPORT OR OTH	ER DATA		
TYPE OF SUBMISSION	1				TYPI	E OF Á	CTION			
Notice of Intent		Acidize		Deepe Fractu	en ire Treat		roduction (Start/Resume) eclamation	Water Shut-C		
Subsequent Report		Casing Repair Change Plans	ם ק	_	Construction and Abandon		ecomplete emporarily Abandon	Other		
Final Abandonment Notice		Convert to Injection		] Plug I		_	Vater Disposal			
RIH w/2-7/8" tubing. Spot : 3. Set CIBP @ 6,600'.  Tag p	e involved op Final Abar eady for fina od string, pu 25 sx (200') lug. Spot 2	perations. If the operation idonment Notices must i inspection.) ump, and 2-7/8" produ CI H @ 8,255' - 8,05 25 sx (250') CI C @ 6,	ion result be filed o uction as 55'. (Top ,600' - 6	ts in a m only afte ssembly Bone S ,350'. (0	ultiple completion r all requirements, /. Spring @ 8,163'). Open Delaware p	or reco includ	ompletion in a new interval ing reclamation, have been		t be filed once	
testing has been completed determined that the site is r I. MIRU for P&A. POOH w/rd 2. RIH w/2-7/8" tubing. Spot 3. Set CIBP @ 6,600'. Tag p 4. Spot 25 sx (250') CI C @ 4 5. Cut & pull 5-1/2" casing fro shoe @ 851'. Well in R-111f 5. Spot 30 sx (115') CI C surf	e involved o Final Abar eady for fina od string, pu 25 sx (200') lug. Spot 2 -300 - 4,05 mp 2,960'. 2). 4 <b>3 2</b> ace plug.	perations. If the operation adonment Notices must it inspection.) (I) mp, and 2-7/8" produ- (C) H @ 8,255' - 8,05 (5 sx (250') CI C @ 6, (50'. (Top of Delaware Spot 675 sx (3,275') ( $\frac{8}{3}$	ion result be filed o uction as 55'. (Top ,600' - 6. @ 4,27t CI C @ 4	ts in a m only afte ssembly Bone S ,350'. (( 8', 8-5/8 4,050' -	ultiple completion r all requirements, Spring @ 8,163'). Open Delaware p " shoe @ 4,235' 775' Tag TOC.	or reco includ eerfs @ ) (B.Sal	ompletion in a new interval ing reclamation, have been 0 6,652' - 7,203')	, a Form 3160-4 mus completed and the o	t be filed once operator has	
testing has been completed determined that the site is r MIRU for P&A. POOH w/rd RIH w/2-7/8" tubing. Spot 2 Set CIBP @ 6,600'. Tag p Socut & pull 5-1/2" casing fro shoe @ 851'. Well in R-111f Socut & pull 5-1/2" casing fro shoe @ 851'. Well in R-111f Socut wellhead off. Set dry h	e involved op Final Abar eady for fina od string, pu 25 sx (200') lug. Spot 2 300' - 4,05 ml2,960'. 2). (432 ace plug. ole marker.	perations. If the operation donment Notices must l inspection.) (Inspec	ion result be filed o uction as 55'. (Top ,600' - 6 @ 4,27t CI C @ 4 S E.	is in a m only after ssembly Bone S ,350'. (0 8', 8-5/8 4,050' - E AT	ultiple completion r all requirements, Spring @ 8,163'). Open Delaware p " shoe @ 4,235' 775' Tag TOC. TACHED F	or reco includ erfs @ (B.Sal	ompletion in a new interval ing reclamation, have been 0 6,652' - 7,203') t @ 4,033'; 5-1/2" stub @	, a Form 3160-4 mus completed and the o	t be filed once operator has	
testing has been completed determined that the site is r MIRU for P&A. POOH w/rd RIH w/2-7/8" tubing. Spot Set CIBP @ 6,600'. Tag p Sot 25 sx (250') CI C @ 4 Sot 25 sx (250') CI C @ 4 Sot 25 sx (250') CI C @ 4 Sot 30 sx (115') CI C surf Cut wellhead off. Set dry h Circulate wellbore w/9# mud	e involved op Final Abar eady for fina 25 sx (200') lug. Spot 2 ,300' - 4,05 2). (432 2). (432 ace plug. ole marker. between pl	perations. If the operation indonment Notices must inspection.) (Inspec	ion result be filed o uction as 55'. (Top ,600' - 6 @ 4,27t CI C @ 4 S E.	is in a m only after ssembly Bone S ,350'. (0 8', 8-5/8 4,050' - E AT	ultiple completion r all requirements, Spring @ 8,163'). Open Delaware p " shoe @ 4,235' 775' Tag TOC.	or reco includ erfs @ (B.Sal	<ul> <li>bompletion in a new intervaling reclamation, have been</li> <li>b) 6,652' - 7,203')</li> <li>t @ 4,033'; 5-1/2" stub @</li> </ul>	, a Form 3160-4 mus completed and the o	t be filed once operator has 877'; 13-3/8" SERVATION	
testing has been completed determined that the site is r . MIRU for P&A. POOH w/rd . RIH w/2-7/8" tubing. Spot Set CIBP @ 6,600'. Tag p . Spot 25 sx (250') CI C @ 4 . Cut & pull 5-1/2" casing fro hoe @ 851'. Well in R-111f . Spot 30 sx (115') CI C surf . Cut wellhead off. Set dry h Circulate wellbore w/9# mud	e involved op Final Abar eady for fina 25 sx (200') lug. Spot 2 ,300' - 4,05 2). (432 2). (432 ace plug. ole marker. between pl	perations. If the operation indonment Notices must inspection.) (Inspec	ion result be filed o uction as 55'. (Top ,600' - 6 @ 4,27t CI C @ 4 S E.	is in a m only after ssembly Bone S ,350'. (0 8', 8-5/8 4,050' - E AT	ultiple completion r all requirements, Spring @ 8,163'). Open Delaware p s' shoe @ 4,235' 775' Tag TOC. TACHED F TIONS OF	or reco includ eerfs @ (B.Sal OR APF	<ul> <li>bompletion in a new intervaling reclamation, have been</li> <li>b) 6,652' - 7,203')</li> <li>t @ 4,033'; 5-1/2" stub @</li> </ul>	, a Form 3160-4 mus completed and the o 2,960'; T.Salt @	t be filed once operator has 877'; 13-3/8" SERVATION STRICT 2015	
<ul> <li>testing has been completed determined that the site is r</li> <li>MIRU for P&amp;A. POOH w/rd</li> <li>RIH w/2-7/8" tubing. Spot 2</li> <li>Set CIBP @ 6,600'. Tag p</li> <li>Spot 25 sx (250') CI C @ 4</li> <li>Cut &amp; pull 5-1/2" casing from the second state of t</li></ul>	e involved o Final Abar eady for fina od string, pu 25 sx (200') lug. Spot 2 -,300 - 4,05 ml2,960'. 3 -,300 - 4,05 -,300 - 4,0	perations. If the operation adonment Notices must it inspection.) ump, and 2-7/8" produ- CI H @ 8,255' - 8,05 55 sx (250') CI C @ 6, 50'. (Top of Delaware Spot 675 sx (3,275') ( ugs. attached.	ion result be filed o uction as 55'. (Top ,600' - 6 @ 4,27t CI C @ 4 S E.	is in a m only after ssembly Bone S ,350'. (0 8', 8-5/8 4,050' - E AT	ultiple completion r all requirements, Spring @ 8,163'). Open Delaware p s' shoe @ 4,235' 775' Tag TOC. TACHED F TIONS OF	erfs @ (B.Sal OR APF	ompletion in a new interval ing reclamation, have been 0 6,652' - 7,203') t @ 4,033'; 5-1/2" stub @ PROVAL N PROCEDURE TACHED	, a Form 3160-4 mus completed and the o 2,960'; T.Salt @ MOIL CONS ARTESIA DI NOV 1 9	t be filed once operator has 877'; 13-3/8" SERVATION STRICT 2015	
<ul> <li>testing has been completed determined that the site is r</li> <li>MIRU for P&amp;A. POOH w/rd</li> <li>RIH w/2-7/8" tubing. Spot 2</li> <li>Set CIBP @ 6,600'. Tag p</li> <li>Spot 25 sx (250') CI C @ 4</li> <li>Cut &amp; pull 5-1/2" casing from the second state of t</li></ul>	e involved oj Final Abar eady for fina od string, pu 25 sx (200') lug. Spot 2 -300' - 4,05 mi 2,960'. 20 - 4,050'. 20 - 4,050	perations. If the operation adonment Notices must it inspection.) ump, and 2-7/8" produ- CI H @ 8,255' - 8,05 55 sx (250') CI C @ 6, 50'. (Top of Delaware Spot 675 sx (3,275') ( ugs. attached.	ion result be filed o uction as 55'. (Top ,600' - 6 @ 4,27t CI C @ 4 S E.	is in a m only after ssembly Bone S ,350'. (0 8', 8-5/8 4,050' - E AT	ultiple completion er all requirements, Spring @ 8,163'). Dpen Delaware p " shoe @ 4,235' 775' Tag TOC. TACHED F TIONS OF RECLA Title Production	erfs @ (B.Sal OR APF MATI ATI	ompletion in a new interval ing reclamation, have been 0 6,652' - 7,203') t @ 4,033'; 5-1/2" stub @ PROVAL N PROCEDURE TACHED	, a Form 3160-4 mus completed and the o 2,960'; T.Salt @ MOIL CONS ARTESIA DI NOV 1 9	t be filed once operator has 877'; 13-3/8" SERVATION STRICT 2015	
<ul> <li>testing has been completed determined that the site is r</li> <li>I. MIRU for P&amp;A. POOH w/rd</li> <li>RIH w/2-7/8" tubing. Spot 2</li> <li>Set CIBP @ 6,600'. Tag p</li> <li>Spot 25 sx (250') CI C @ 4</li> <li>Cut &amp; pull 5-1/2" casing from the second se</li></ul>	e involved oj Final Abar eady for fina od string, pu 25 sx (200') lug. Spot 2 -300' - 4,05 mi 2,960'. 20 - 4,050'. 20 - 4,050	perations. If the operation adonment Notices must it inspection.) ump, and 2-7/8" produ- CI H @ 8,255' - 8,05 55 sx (250') CI C @ 6, 50'. (Top of Delaware Spot 675 sx (3,275') ( ugs. attached.	ion result be filed of uction as $5^{5'}$ . (Top $600^{1} - 6$ @ 4,271 CI C @ 2 S E CO	Is in a monly after seembly Bone S ,350'. (( 8', 8-5/8 4,050' - E AT NDI SCORD	ultiple completion r all requirements, Spring @ 8,163'). Dpen Delaware p shoe @ 4,235' 775' Tag TOC. TACHED F TIONS OF RECLA Title Production Date	erfs @ (B.Sal (B.Sal COR APP MATI ATI Tech 20	PROVAL PROVAL ON PROCEDURE TACHED Note: State of the	, a Form 3160-4 mus completed and the o 2,960'; T.Salt @ MOIL CONS ARTESIA DI NOV 1 9	t be filed once operator has 877'; 13-3/8" SERVATION STRICT 2015	
testing has been completed determined that the site is r MIRU for P&A. POOH w/rd RIH w/2-7/8" tubing. Spot 1 Set CIBP @ 6,600'. Tag p Societ Sex (250') CI C @ 4 Cut & pull 5-1/2" casing fro shoe @ 851'. Well in R-111f Societ & pull 5-1/2" casing	e involved oj Final Abar eady for fina od string, pu 25 sx (200') lug. Spot 2 -300' - 4,05 mi 2,960'. 20 - 4,050'. 20 - 4,050	perations. If the operation adonment Notices must i inspection.) ump, and 2-7/8" produ- (CI H @ 8,255' - 8,05 (55 sx (250') CI C @ 6, (50'. (Top of Delaware Spot 675 sx (3,275') C (3,275') C (4,275') C (4,275'	ion result be filed of uction as $5^{5'}$ . (Top $600^{1} - 6$ @ 4,271 CI C @ 2 S E CO	Is in a monly after seembly Bone S ,350'. (( 8', 8-5/8 4,050' - E AT NDI SCORD	ultiple completion r all requirements, Spring @ 8,163'). Dpen Delaware p shoe @ 4,235' 775' Tag TOC. TACHED F TIONS OF RECLA Title Production Date	erfs @ (B.Sal (B.Sal COR APP MATI ATI Tech 20	PROVAL ON PROCEDURE ACHED NOV	, a Form 3160-4 mus completed and the o 2,960'; T.Salt @ MOIL CONS ARTESIA DI NOV 1 9	t be filed once operator has 877'; 13-3/8" SERVATION STRICT 2015	
testing has been completed determined that the site is r 1. MIRU for P&A. POOH w/rd 2. RIH w/2-7/8" tubing. Spot 3. Set CIBP @ 6,600'. Tag p 4. Spot 25 sx (250') CI C @ 4 5. Cut & pull 5-1/2" casing fro shoe @ 851'. Well in R-111f 5. Spot 30 sx (115') CI C surf 7. Cut wellhead off. Set dry h Circulate wellbore w/9# mud Current & proposed wellbore A. I hereby certify that the foreg Name (Printed/Typed) Ronnie Slack Signature Removal Signature Removal A. I hereby certify that the foreg Name (Printed/Typed) Ronnie Slack	e involved oj Final Abar eady for fina od string, pu 25 sx (200') lug. Spot 2 300' - 4,05 om 2,960'. 1 2). <b>432</b> ace plug. ole marker. between pl schemats a ping is true ar	perations. If the operation adonment Notices must it inspection.) ump, and 2-7/8" produ- it CI H @ 8,255' - 8,05 25 sx (250') CI C @ 6, 50'. (Top of Delaware Spot 675 sx (3,275') C 0 ' ugs. attached.	ion result be filed of uction as 55'. (Top 600' - 6 @ 4,270 CI C @ 2 SE C() V/ (23/, I for re OCD	Is in a monly after seembly Bone S ,350'. (( 8', 8-5/8 4,050' - E AT NDI SCORD FEDE	ultiple completion r all requirements, Spring @ 8,163'). Dpen Delaware p shoe @ 4,235'' 775' Tag TOC. TACHED F TIONS OF RECLA Title Production Date g'- RAL OR STA Title office	or reco includ (B.Sal OR APF MATI ATT 20 TEC	ompletion in a new interval ing reclamation, have been 0 6,652' - 7,203') t @ 4,033'; 5-1/2" stub @ PROVAL ON PROCEDURE TACHED nologist	ARTESIA DI NOV 1 9 RECEIV	t be filed once perator has 877'; 13-3/8" SERVATION STRICT 2015 /ED	
<ul> <li>testing has been completed determined that the site is r</li> <li>1. MIRU for P&amp;A. POOH w/rd</li> <li>2. RIH w/2-7/8" tubing. Spot 1</li> <li>3. Set CIBP @ 6,600'. Tag p</li> <li>4. Spot 25 sx (250') CI C @ 4</li> <li>5. Cut &amp; pull 5-1/2" casing from the second seco</li></ul>	e involved oj Final Abar eady for fina od string, pu 25 sx (200') lug. Spot 2 300' - 4,05 om 2,960'. 1 2). <b>4 32</b> ace plug. ole marker. between pl schemats a ping is true ar	perations. If the operation adonment Notices must it inspection.) ump, and 2-7/8" produ- it CI H @ 8,255' - 8,05 25 sx (250') CI C @ 6, 50'. (Top of Delaware Spot 675 sx (3,275') C 0 ugs. attached.	ion result be filed of uction as 55'. (Top 600' - 6 @ 4,271 CI C @ 2 SE CO I (23/1 I for re OCD	Is in a monly after seembly Bone S ,350'. (( 8', 8-5/8 4,050' - E AT NDI SCORD FEDE	ultiple completion r all requirements, Spring @ 8,163'). Dpen Delaware p shoe @ 4,235'' 775' Tag TOC. TACHED F TIONS OF RECLA Title Production Date & - RAL OR STA Fritte Printle Office rson knowingly and	or reco includ (B.Sal OR APF MATI ATT 20 TEC	ompletion in a new interval ing reclamation, have been 0 6,652' - 7,203') t @ 4,033'; 5-1/2" stub @ PROVAL ON PROCEDURE TACHED nologist	ARTESIA DI NOV 1 9 RECEIV	t be filed once perator has 877'; 13-3/8" SERVATION STRICT 2015 /ED	

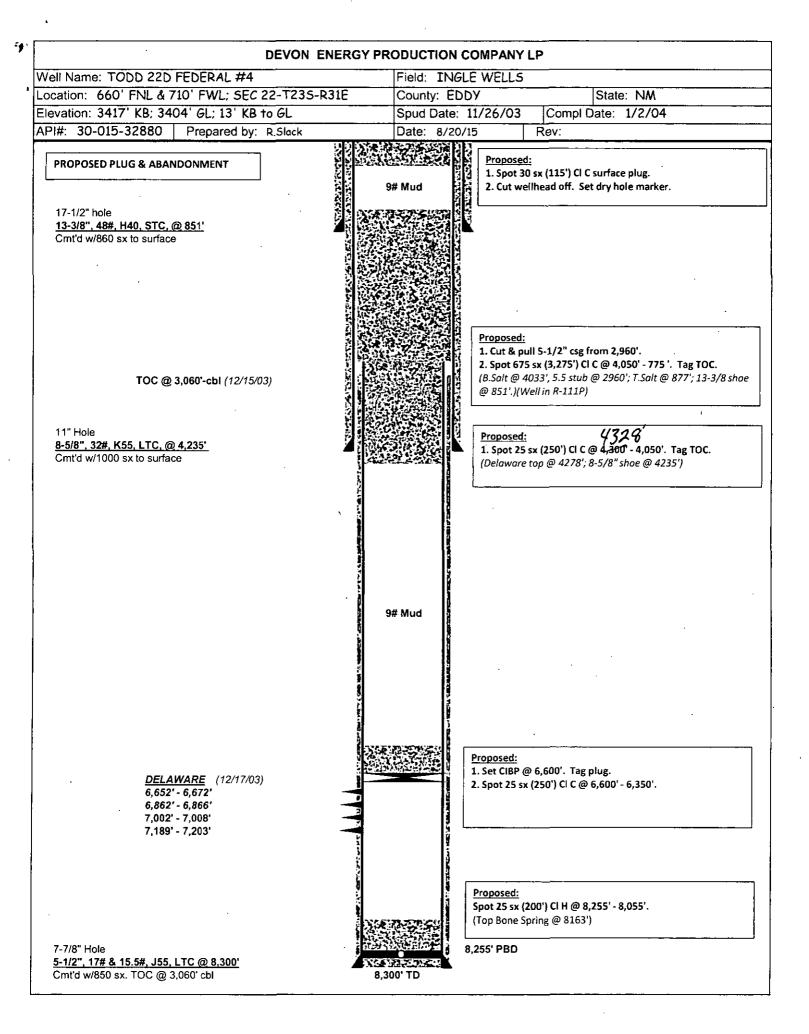

Vell Name: TODD 22D FEDERAL #4	Field: INGLE WELLS
ocation: 660' FNL & 710' FWL; SEC 22-T23S-R31E	County: EDDY State: NM
levation: 3417' KB; 3404' GL; 13' KB to GL	Spud Date: 11/26/03 Compl Date: 1/2/04
PI#: 30-015-32880 Prepared by: R.Slock	Date: 6/25/15 Rev:
CURRENT WELLBORE 17-1/2" hole <u>13-3/8", 48#, H40, STC, @ 851'</u> Cmt'd w/860 sx to surface	Formation tops per cmpl rpt Rustler 549 Salado 877 B.Salado 4033 Delaware 4278 Cherry Canyon 5176 Brushy Canyon 6811 Bone Spring 8163
ТОС (2) 3,060 -сы (12/15/03)	
11" Hole <u>8-5/8", 32#, K55, LTC, @ 4,235'</u> Cmt'd w/1000 sx to surface	
DELAWARE (12/17/03) 6,652' - 6,672' 6,862' - 6,866' 7,002' - 7,008' 7,189' - 7,203'	244 Jts, 2-7/8", 6.5#, production tbg (1/30/14)
	TAC @ 7,790' 9 Jts, 2-7/8", 6.5#, production tbg (1/30/14) SN @ 8,081 EOT @ 8,112'
7-7/8" Hole <u>5-1/2", 17# &amp; 15.5#, J55, LTC @ 8,300'</u> Cmt'd w/850 sx. TOC @ 3,060' cbl	8,255' PBD 8,300' TD

## BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

7

## Permanent Abandonment of Federal Wells Conditions of Approval (LPC Habitat)

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90<sup>th</sup> day provide this office, prior to the 90<sup>th</sup> day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

2. <u>Notification</u>: Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.

3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.

4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of **brine** water. Minimum nine (9) pounds per gallon.

5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. <u>Below Ground Level Cap (Lesser Prairie-Chicken Habitat)</u>: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). **The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses.** Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10<sup>th</sup> day, the BLM is to be contacted with justification to receive an extension for completing the cut off. Upon the plugging and subsequent abandonment of wells that are located in lesser prairie-chicken habitat, the casings shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The well bore shall then be covered with a metal plate at least ¼ inch thick and welded in place. A weep hole shall be left in the plate and/or casing.

NMOCD also requires the operator to notify NMOCD when this type of dry hole marker is used. This can be done on the subsequent report of abandonment which is submitted to the BLM after the well is plugged. State that a below ground cap was installed as required in the COA's from the BLM.

7. <u>Subsequent Plugging Reporting</u>: Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. <u>Show date well was plugged.</u>

8. <u>Trash:</u> All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.

<u>Timing Limitation Stipulation/ Condition of Approval for Lesser Prairie-Chicken:</u> From March 1<sup>st</sup> through June 15<sup>th</sup> annually, abandonment activities will be allowed except between the hours from 3:00 am and 9:00 am. Normal vehicle use on existing roads will not be restricted



## **United States Department of the Interior**

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 E. Greene St. Carlsbad, New Mexico 88220-6292 www.blm.gov/nm



In Reply Refer To: 1310

## **Reclamation Objectives and Procedures**

**Reclamation Objective:** Oil and gas development is one of many uses of the public lands and resources. While development may have a short- or long-term effect on the land, successful reclamation can ensure the effect is not permanent. During the life of the development, all disturbed areas not needed for active support of production operations should undergo "interim" reclamation in order to minimize the environmental impacts of development on other resources and uses. At final abandonment, well locations, production facilities, and access roads must undergo "final" reclamation so that the character and productivity of the land and water are restored.

The long-term objective of final reclamation is to set the course for eventual ecosystem restoration, including the restoration of the natural vegetation community, hydrology, and wildlife habitats. In most cases this means returning the land to a condition approximating or equal to that which existed prior to the disturbance. The final goal of reclamation is to restore the character of the land and water to its predisturbance condition. The operator is generally not responsible for achieving full ecological restoration of the site. Instead, the operator must achieve the short-term stability, visual, hydrological, and productivity objectives of the surface management agency and take steps necessary to ensure that long-term objectives will be reached through natural processes.

To achieve these objectives, remove any and all contaminants, scrap/trash, equipment, pipelines and powerlines. Strip and remove caliche, contour the location to blend with the surrounding landscape, redistribute the native soils, provide erosion control as needed, rip and seed as specified in the original APD COA. This will apply to well pads, facilities, and access roads. Barricade access road at the starting point. If reserve pits have not reclaimed due to salts or other contaminants, submit a plan for approval, as to how you propose to provide adequate restoration of the pit area.

- The Application for Permit to Drill or Reenter (APD, Form 3160-3), Surface Use Plan of Operations must include adequate measures for stabilization and reclamation of disturbed lands. Oil and Gas operators must plan for reclamation, both interim and final, up front in the APD process as per Onshore Oil and Gas Order No. 1.
- 2. For wells and/or access roads not having an approved plan, or an inadequate plan for surface reclamation (either interim or final reclamation), the operator must submit a proposal describing the procedures for reclamation. For interim reclamation, the appropriate time for submittal would be when filing the Well Completion or Recompletion Report and Log (Form 3160-4). For final reclamation, the appropriate time for submittal would be when filing the Notice of Intent, or the Subsequent Report of Abandonment, Sundry Notices and Reports on Wells (Form 3160-5). Interim reclamation is to be completed within 6 months of well completion, and final reclamation is to be completed within 6 months.
- 3. The operator must file a Subsequent Report Plug and Abandonment (Form 3160-5) following the plugging of a well.
- 4. Previous instruction had you waiting for a BLM specialist to inspect the location and provide you with reclamation requirements. If you have an approved Surface Use Plan of Operation and/or an approved Sundry Notice, you are free to proceed with reclamation as per approved APD. If you have issues or concerns, contact a BLM specialist to assist you. It would be in your interest to have a BLM specialist look at the location and access road prior to the removal of reclamation

1

equipment to ensure that it meets BLM objectives. Upon conclusion submit a Form 3160-5, Subsequent Report of Reclamation. This will prompt a specialist to inspect the location to verify work was completed as per approved plans.

- 5. The approved Subsequent Report of Reclamation will be your notice that the native soils, contour and seedbed have been reestablished. If the BLM objectives have not been met the operator will be notified and corrective actions may be required.
- 6. It is the responsibility of the operator to monitor these locations and/or access roads until such time as the operator feels that the BLM objective has been met. If after two growing seasons the location and/or access roads are not showing the potential for successful revegetation, additional actions may be needed. When you feel the BLM objectives have been met submit a Final Abandonment Notice (FAN), Form 3160-5, stating that all reclamation requirements have been achieved and the location and/or access road is ready for a final abandonment inspection.
- 7. At this time the BLM specialist will inspect the location and/or access road. If the native soils and contour have been restored, and the revegetation is successful, the FAN will be approved, releasing the operator of any further liability of the location and/or access road. If the location and/or access road have not achieved the objective, you will be notified as to additional work needed or additional time being needed to achieve the objective.

If there are any questions, please feel free to contact any of the following specialists:

Jim Amos Supervisory Petroleum Engineering Tech 575-234-5909, 575-361-2648 (Cell)

Arthur Arias Environmental Protection Specialist 575-234-6230

Linda Denniston Environmental Protection Specialist 575-234-5974

Henryetta Price Environmental Protection Specialist 575-234-5951

Dara Glass Environmental Protection Specialist 575-234-5924

Shelly Tucker Environmental Protection Specialist 575-234-5979