	DEPARTMENT OF		OCD Artesia	FORM APPROVED OMB Nc 1004-0137 Expires July 31, 2010 5 Lease Serial No	
Do n	BUREAU OF LANE JNDRY NOTICES AND tot use this form for propertion doned well. Use Form 316	REPORTS ON W	enter an	6 If Indian. Allottee or Tribe Name	
	MIT IN TRIPLICATE - Oti	ner instructions on j	page 2	7 If Unit or CA Agreement. Name and/or	
Type of Well     Oil Well     Gas Wel	ll 🔀 Other			8 Well Name and No.	
2 Name of Operator				SKELLY UNIT 81	
Linn Operating LLC 3a Address		p. Phone No (include area ca	<del>dej</del>	30-015-05371	
600 Travis St, Ste 140 Houston, TX 77002 4. Location of Well <i>Contract</i> 8		10 Field and Pool, or Exploratory Area Grayburg Jackson; SR-Q-0			
Sec 23, T17S, R31E, S 810'FSL 660'FEL	SESE		augus - subjective	11 County or Parish. State Eddy Co, NM	
	CK APPROPRIATE BOX(	ES) TO INDICATE N/		PORT. OR OTHER DATA	
TYPE OF SUBMISSI		<b>––––</b>	TYPE OF ACTION		
Notice of Intent	Acidize	Deepen Fracture Treat	Production (Start/Resur	ie) Water Shut-Off	
Subsequent Report		New Construction	Recomplete	Other	
Final Abandonment Notice	Change Plans	Plug and Abandon	Temporarily Abandon	·	
L_ I mai Abandolanen Konce	Convert to Injection	Plug Back	Water Disposal	and and the second	
1. Set 5 ½" CIBP @ 3 2. Spot 25 sx cmt @ 2 3. Spot 25 sx cmt @ 1	eady for final inspection.) 3250'. Circulate hole wit 2900-2800'. (Qucen) 1860-1660'. WOC & Tag 1485-1385'. WOC & Tag	h MLF. Pressure te 1 <b>ZO' minim</b> g (Yates & B/Salt)	st csg. Spot 25 sx cmt nn to 278	0.	
<ol> <li>Set 5 ½" CIBP @ 3</li> <li>Spot 25 sx cmt @ 2</li> <li>Spot 25 sx cmt @ 1</li> <li>Spot 25 sx cmt @ 4</li> <li>Perf &amp; Sqz 50 sx ci</li> <li>Perf &amp; Sqz 20 sx ci</li> <li>Cut off well head, v</li> </ol>	3250'. Circulate hole wit 2900-2800'. (Qucen) 860-1660'. WOC & Tag 485 1385'. WOC & Tag mt @ 850-700'. WOC & mt @ 100'-Surface. verify cmt to surface, we	h MLF. Pressure te 120' Minim (Yates & B/Salt) K Not Reguin Tag (Shoe & P/Sal	st csg. Spot 25 sx cmt nn 70 278 red , t)	@ 3250-3050'.	
<ol> <li>Set 5 ½" CIBP @ 3</li> <li>Spot 25 sx cmt @ 2</li> <li>Spot 25 sx cmt @ 1</li> <li>Spot 25 sx cmt @ 4</li> <li>Perf &amp; Sqz 50 sx ci</li> <li>Perf &amp; Sqz 20 sx ci</li> <li>Cut off well head, v</li> </ol>	3250'. Circulate hole wit 2900-2800'. (Qucen) 860-1660'. WOC & Tag 485 1385'. WOC & Tag mt @ 850-700'. WOC & mt @ 100'-Surface. verify cmt to surface, we	h MLF. Pressure te 120' Minim (Yates & B/Salt) K Not Reguin Tag (Shoe & P/Sal	st csg. Spot 25 sx cmt nn 70 278 red , t)	@ 3250-3050'. D. MM OIL CONSERVA ARTESIA DISTRICT OCT 24 2017	
1. Set 5 ½" CIBP @ 3 2. Spot 25 sx cmt @ 2 3. Spot 25 sx cmt @ 1 4. Spot 25 sx cmt @ 4 5. Perf & Sqz 50 sx cu 6. Perf & Sqz 20 sx cu	3250'. Circulate hole wit 2900-2800'. (Qucen) 860-1660'. WOC & Tag 485 1385'. WOC & Tag mt @ 850-700'. WOC & mt @ 100'-Surface. verify cmt to surface, we	h MLF. Pressure te 120' Minim (Yates & B/Salt) K Not Reguin Tag (Shoe & P/Sal	st csg. Spot 25 sx cmt n + o 27 g red , t) Dry Hole Marker RE	@ 3250-3050'.	
1. Set 5 ½" CIBP @ 3 2. Spot 25 sx cmt @ 2 3. Spot 25 sx cmt @ 1 4. Spot 25 sx cmt @ 1 5. Perf & Sqz 50 sx cu 6. Perf & Sqz 20 sx cu 7. Cut off well head, v	3250'. Circulate hole wit 2900-2800'. (Qucen) 860-1660'. WOC & Tag 485 1385'. WOC & Tag mt @ 850-700'. WOC & mt @ 100'-Surface. verify cmt to surface, we	h MLF. Pressure te 120' minim (Yates & B/Salt) Tag (Shoe & T/Sal eld on Belowground AMATION PROCEDU ATTACHED dry hole	st esg. Spot 25 sx emt no 70 27 8 red , Dry Hole Marker RE S.E. CONI	@ 3250-3050'. NM OIL CONSERVA ARTESIA DISTRICT OCT 2 4 2017 RECEIVED ANTACHED FOR DITIONS OF APPROV	
<ul> <li>1. Set 5 ½" CIBP @ 3</li> <li>2. Spot 25 sx cmt @ 2</li> <li>3. Spot 25 sx cmt @ 1</li> <li>4. Spot 25 sx cmt @ 4</li> <li>5. Perf &amp; Sqz 50 sx ct</li> <li>6. Perf &amp; Sqz 20 sx ct</li> <li>7. Cut off well head, w</li> </ul>	3250'. Circulate hole wit 2900-2800'. (Qucen) 860-1660'. WOC & Tag 1485-1385'. WOC & Tag mt @ 850-700'. WOC & mt @ 100'-Surface. verify cmt to surface, we <b>Y</b> RECL/	h MLF. Pressure te 120' minim (Yates & B/Salt) Tag (Shoe & T/Sal eld on Belowground AMATION PROCEDU ATTACHED dry hole	st esg. Spot 25 sx emt m to 27 g red, t) Dry Hole Marker RE S.E. CONI macker CONI Macker	@ 3250-3050'. MM OIL CONSERVA ARTESIA DISTRICT OCT 2 4 2017 RECEIVED ATTACHED FOR DITIONS OF APPROV	
1. Set 5 1/2" CIBP @ 3 2. Spot 25 sx cmt @ 2 3. Spot 25 sx cmt @ 1 4. Spot 25 sx cmt @ 1 5. Perf & Sqz 50 sx ct 6. Perf & Sqz 20 sx ct 7. Cut off well head, w Accepted for record Accepted for record Abigail Montgomery Signature Abigail	3250'. Circulate hole wit 2900-2800'. (Qucen) 1860-1660'. WOC & Tag 1855-1385'. WOC & Tag mt @ 850-700'. WOC & mt @ 100'-Surface. verify cmt to surface, we "	h MLF. Pressure te 120' minim (Yates & B/Salt) Tag (Shoe & B/Salt) Hot Reguind AMATION PROCEDU ATTACHED Cry hole FOR FEDERAL Comparison a certify the	st esg. Spot 25 sx emt and to Z 7 g red, Dry Hole Marker RE S.E. CONI macker c Agent c 10/17/17 OR STATE OFFICE The Supple	@ 3250-3050". MM OIL CONSERN ARTESIA DISTRIC OCT 2 4 2017 RECEIVED ATTACHED FOR DITIONS OF APPRO	

x /


	1 1	ON KB	1	- 1	1.	TDIM	2 (CU' <u>ENT)</u> T Long/2004 State		
Weil Name	APIANVI	Elev (ft) 3,875.0		(ft) Int Spud D	4/27/1060	(RK	B) Latitude (*3	( <sup>P)</sup>	County ne
the state of the second state of the second state of the	have de the side	-					10.0	internet in	E providence
Wellbore Section Su									
Surface	n Des-			Size (in)	Act Top (	(KB) 4.0	Act Bbn (1×6)	E-10/1960	ind Date
Production				8		709.0	3,840,0	7/2/1000	
Openhole		-		4 3/4	·]3	1840,0	3,810.0	4/27/1996	
Casing Strings	Set Q	rpth (1948)	vn Gesa	Wol er p	Ry Slong Grad		Comment		
Suitage Come Description	799.	0   0	/6/1950 un Date	24.00	155		Comment		
Production	3,78		/2/1960	15.50	1-55		[COD 414		
Cement Squeeze; 3/30/1 Surface; 799.0 ftKB;	lace, 4.0-799,0 982; Sqz perts ( 8.625 in; J-55;	w/ 3505x5 cm Lirc 50 ske 24.00 b/f	N			Ľ		n themañ finn an suit	an a shara na shi ka shi k
Cement Squeeze; 7/24/201 1,458	w/ 150 sx C w 4: Sqz csg leat w/ 150 sx C w ; 799.0-3 840.0 nt; 7/2/1960; 3	2% CBC k f/ 1.426 2% CBC 7/2/1980					–Perf: 1,410.0; 3/2	9/1982; Sqzd 3/3	10182. 2holes, 2
			1				Tubing Detai (8/4 2-3/8" IPC (bg 5-1/2" AS1-X Par Perf: 3,300.0; 4/3 Perf: 3,304.0; 4/3 Perf: 3,323.5; 4/3	oker ( <u>7.</u> 3213) 10/1966: 1 hole 10/1966: 1 hole	
			technicates And indicates	2007 2007 2007 2007			- Perf; 3.331.0; 4/3 - Perf; 3,368.0; 4/3 - Perf; 3,373.0; 4/3 - Perf; 3,385.0; 4/3 - Perf; 3,385.0; 4/3	10/1966; 1 hole 10/1966; 1 hole 10/1966; 1 hole 10/1966; 1 hole	
				()(5) ()(5)(	974,2 9753 9752 9752		-Perl: 3,406.0; 4/0 -Perl: 3,414.0; 4/0 -Perl: 3,420.0; 4/0 -Perl: 3,432.0; 4/0 -Perl: 3,436.0; 4/0 -Perl: 3,442.0; 4/0	80/1966; 1 hole 90/1966, 1 hole 80/1966, 1 hole 80/1966; 1 hole	
				80879 80879 90300 80309 8030 8030	569) 1689 2600 2769		Perf. 3,454,0; 4/ -Perf. 3,458.0; 4/ -Perf. 3,455.0; 4/ -Perf. 3,484.0; 4/ -Perf. 3,501.0; 4/	30/1966; 1 hole 30/1966; 1 hole 30/1966; 1 hole 30/1966; 1 hole 30/1966; 1 hole	
				zənər Kəniz Kəniz Səsər	2012 1010 1010 1010		Parf: 3,505.0: 4/ Parf: 3,521.0: 4/ Perf: 3,521.0: 4/ Sand Frac; 3,30 BDA acid, 45,00 Parf: 3,531.0; 4/	30/1966; 1 hole 30/1966; 1 hole 3.0-3,745 0: 4/30 3 gais water + 45	
				istanta o Katado o 1980a o 1980a o	4555 4650 7444 7565		-Perf; 3,537,0; 4/ -Perf; 3,548.0; 4/ -Perf; 3,548.0; 4/ -Perf; 3,563.0; 4/ -Perf; 3,563.0; 4/	30/1966; 1 hole 30/1966; 1 hole 30/1966; 1 hole	
				nois Men Sono Mari	69429 20029 200525 200525		- Perf; 3,576,0; 4/ - Perf; 3,583,0; 4/ - Perf; 3,589,0; 4/ - Perf; 3,604,0; 4/	80/1956; 1 hole 80/1966; 1 hole 90/1966; 1 hole 90/1966; 1 hole	
				ines Vata Sata Sata	64176 76227 64476 78565		- Pert; 3,614.0; 4/3 - Pert; 3,618.0; 4/3 - Pert; 3,625.0, 4/3 - Pert; 3,630.0; 4/3 - Pert; 3,638.0; 4/3	10/1966; 1 hole 10/1966; 1 hole 10/1966; 1 hole	
				2556 2524 2545 2557 2 2567 2	1953 2004 3526 2012 2012		-Perf: 3.644.0; 4/3 -Perf: 3.649.0, 4/3 -Perf: 3.652.0; 4/3 -Perf: 3.665.0; 4/3 -Perf: 3.665.0; 4/3	10/1966; 1 hole 10/1966, 1 hole 10/1966; 1 hole 10/1966; 1 hole	
32.81504				2000 I 2000 I 2000 I 2000 I	7089 1062 1062 1062		- Perf; 3,676.0: 4/3 - Perf; 3,697.0: 4/3 - Perf; 3.704.0; 4/3 - Perf; 3.721.0: 4/3	0/1966; 1 hole 0/1966; 1 hole 0/1966; 1 hole 0/1956; 1 hole	
-103.833	569	7				H	Perf; 3.728.0; 4/3 Perf; 3.740.0; 4/3 Perf; 3.745.0; 4/3 ISD:0 Frzc; 3.784 Igals 15% reg ad	0/1950; 1 hole 0/1956; 1 hole 0-3,840.0; 7/18/ d, let soat 1 hr. 1	Frac'd w/ 1375bb
Production: 3,764.0 ftKB; 5	i.500 in: J-55	15.50 15/11	<u>`````````````````````````````````</u>	4	6		lease oil, 60.0004	20/40 sand + 1	



۲

.

•

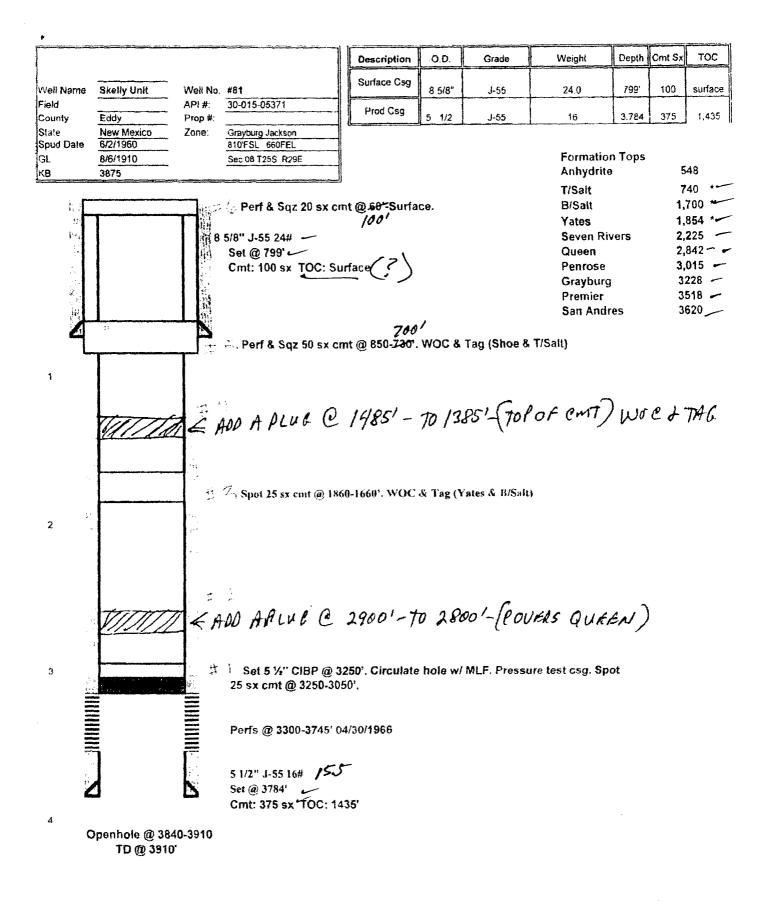

C \Scaris\Wellbores\COG Exxor 8 Fed #1

## BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

## Permanent Abandonment of Federal Wells Conditions of Approval (LPC Habitat)

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90<sup>th</sup> day provide this office, prior to the 90<sup>th</sup> day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.

3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.

4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of brine water. Minimum nine (9) pounds per gallon.

5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. <u>Below Ground Level Cap (Lesser Prairie-Chicken Habitat)</u>: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10<sup>th</sup> day, the BLM is to be contacted with justification to receive an extension for completing the cut off. Upon the plugging and subsequent abandonment of wells that are located in lesser prairie-chicken habitat, the casings shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The well bore shall then be covered with a metal plate at least <sup>1</sup>/<sub>4</sub> inch thick and welded in place. A weep hole shall be left in the plate and/or casing.

NMOCD also requires the operator to notify NMOCD when this type of dry hole marker is used. This can be done on the subsequent report of abandonment which is submitted to the BLM after the well is plugged. State that a below ground cap was installed as required in the COA's from the BLM.

7. <u>Subsequent Plugging Reporting</u>: Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. <u>Show date well was plugged.</u>

8. <u>Trash</u>: All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.

<u>Timing Limitation Stipulation/ Condition of Approval for Lesser Prairie-Chicken:</u> From March 1<sup>st</sup> through June 15<sup>th</sup> annually, abandonment activities will be allowed except between the hours from 3:00 am and 9:00 am. Normal vehicle use on existing roads will not be restricted



## **United States Department of the Interior**

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 E. Greene St. Carlsbad, New Mexico 88220-6292 www.blm.gov/nm



In Reply Refer To: 1310

## **Reclamation Objectives and Procedures**

**Reclamation Objective:** Oil and gas development is one of many uses of the public lands and resources. While development may have a short- or long-term effect on the land, successful reclamation can ensure the effect is not permanent. During the life of the development, all disturbed areas not needed for active support of production operations should undergo "interim" reclamation in order to minimize the environmental impacts of development on other resources and uses. At final abandonment, well locations, production facilities, and access roads must undergo "final" reclamation so that the character and productivity of the land and water are restored.

The long-term objective of final reclamation is to set the course for eventual ecosystem restoration, including the restoration of the natural vegetation community, hydrology, and wildlife habitats. In most cases this means returning the land to a condition approximating or equal to that which existed prior to the disturbance. The final goal of reclamation is to restore the character of the land and water to its predisturbance condition. The operator is generally not responsible for achieving full ecological restoration of the site. Instead, the operator must achieve the short-term stability, visual, hydrological, and productivity objectives of the surface management agency and take steps necessary to ensure that long-term objectives will be reached through natural processes.

To achieve these objectives, remove any and all contaminants, scrap/trash, equipment, pipelines and powerlines. Strip and remove caliche, contour the location to blend with the surrounding landscape, redistribute the native soils, provide erosion control as needed, rip and seed as specified in the original APD COA. This will apply to well pads, facilities, and access roads. Barricade access road at the starting point. If reserve pits have not reclaimed due to salts or other contaminants, submit a plan for approval, as to how you propose to provide adequate restoration of the pit area.

- The Application for Permit to Drill or Reenter (APD, Form 3160-3), Surface Use Plan of Operations must include adequate measures for stabilization and reclamation of disturbed lands. Oil and Gas operators must plan for reclamation, both interim and final, up front in the APD process as per Onshore Oil and Gas Order No. 1.
- 2. For wells and/or access roads not having an approved plan, or an inadequate plan for surface reclamation (either interim or final reclamation), the operator must submit a proposal describing the procedures for reclamation. For interim reclamation, the appropriate time for submittal would be when filing the Well Completion or Recompletion Report and Log (Form 3160-4). For final reclamation, the appropriate time for submittal would be when filing the Notice of Intent, or the Subsequent Report of Abandonment, Sundry Notices and Reports on Wells (Form 3160-5). Interim reclamation is to be completed within 6 months of well completion, and final reclamation is to be completed within 6 months.
- 3. The operator must file a Subsequent Report Plug and Abandonment (Form 3160-5) following the plugging of a well.
- 4. Previous instruction had you waiting for a BLM specialist to inspect the location and provide you with reclamation requirements. If you have an approved Surface Use Plan of Operation and/or an approved Sundry Notice, you are free to proceed with reclamation as per approved APD. If you have issues or concerns, contact a BLM specialist to assist you. It would be in your interest to have a BLM specialist look at the location and access road prior to the removal of reclamation

equipment to ensure that it meets BLM objectives. Upon conclusion submit a Form 3160-5, Subsequent Report of Reclamation. This will prompt a specialist to inspect the location to verify work was completed as per approved plans.

- 5. The approved Subsequent Report of Reclamation will be your notice that the native soils, contour and seedbed have been reestablished. If the BLM objectives have not been met the operator will be notified and corrective actions may be required.
- 6. It is the responsibility of the operator to monitor these locations and/or access roads until such time as the operator feels that the BLM objective has been met. If after two growing seasons the location and/or access roads are not showing the potential for successful revegetation, additional actions may be needed. When you feel the BLM objectives have been met submit a Final Abandonment Notice (FAN), Form 3160-5, stating that all reclamation requirements have been achieved and the location and/or access road is ready for a final abandonment inspection.
- 7. At this time the BLM specialist will inspect the location and/or access road. If the native soils and contour have been restored, and the revegetation is successful, the FAN will be approved, releasing the operator of any further liability of the location and/or access road. If the location and/or access road have not achieved the objective, you will be notified as to additional work needed or additional time being needed to achieve the objective.

If there are any questions, please feel free to contact any of the following specialists:

Jim Amos Supervisory Petroleum Engineering Tech 575-234-5909, 575-361-2648 (Cell)

Arthur Arias Environmental Protection Specialist 575-234-6230

Henryetta Price Environmental Protection Specialist 575-234-5951

Shelly Tucker Environmental Protection Specialist 575-234-5979

Trishia Bad Bear, Hobbs Field Station Natural Resource Specialist 575-393-3612