Form 3160-5 (June 2015)

## **UNITED STATES** DEPARTMENT OF THE INTERIOR

RECEIVED OCD Artesia

FORM APPROVED OMB NO. 1004-0137 Expires: January 31, 2018

■ Water Shut-Off

■ Well Integrity

☐ Other

BUREAU OF LAND MANAGEMENT SUNDRY NOTICES AND REPORTS ON WHAT'S 1 6 2018 Do not use this form for proposals to drill or to re-enter an

5. Lease Serial No. NMLC062407

☐ Production (Start/Resume)

☐ Temporarily Abandon

□ Reclamation

□ Recomplete

■ Water Disposal

6. If Indian, Allottee or Tribe Name

abandoned well. Use form 3160-3 (A	6. If Indian, Allottee or Tribe Name			
SUBMIT IN TRIPLICATE - Other instructions on page 2		7. If Unit or CA/Agreement, Name and/or No.		
1. Type of Well ☐ Gas Well ☐ Other		8. Well Name and No. CHEYENNE FEDERAL 1		
Name of Operator Contact: ABIGAIL MONTGOMERY COG OPERATING LLC E-Mail: Abbym@bcmandassociates.com		9. API Well No. 30-015-30709-00-S1		
3a. Address 600 W ILLINOIS AVENUE MIDLAND, TX 79701	3b. Phone No. (include area code) Ph: 432-580-7161	10. Field and Pool or Exploratory Area EMPIRE-ABO		
4. Location of Well (Footage, Sec., T., R., M., or Survey Description)		11. County or Parish, State		
Sec 30 T17S R29E SWSE 840FSL 2310FEL		EDDY COUNTY, NM		
12. CHECK THE APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA				
TYPE OF SUBMISSION	TYPE OF ACTION			

□ Convert to Injection ☐ Plug Back 13. Describe Proposed or Completed Operation: Clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recomplete horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports must be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompletion in a new interval, a Form 3160-4 must be filed once testing has been completed. Final Abandonment Notices must be filed only after all requirements, including reclamation, have been completed and the operator has determined that the site is ready for final inspection.

Deepen

☐ Hydraulic Fracturing

■ New Construction

☑ Plug and Abandon

Notice of Intent

□ Subsequent Report

☐ Final Abandonment Notice

1. Tag 5 1/2" CIBP @ 4870.
2. Set 5 1/2" CIBP @ 4155'. Circulate hole w/ MLF. Pressure test csg. Spot 25 sx cmt @ 4155-3955'.
3. Spot 25 sx cmt @ 1815-1615'. (Queen) 2572 - 2372 (Son Andres)
4. Spot 30 sx cmt @ 881-600'. WOC & Tag (8 5/8" Shoe & B/Salt)
5. Spot 55 sx cmt @ 500-Surface. (T/Salt & 13 3/8" Shoe)
6. Cut off well head, verify cmt to surface, weld on Dry Hole Marker.

□ Acidize

■ Alter Casing

Casing Repair

Change Plans

Scapted for record - NMOCD

SEE ATTACHED FOR CONDITIONS OF APPROVAL


14. I hereby certify that th	ne foregoing is true and correct.  Electronic Submission #413779 verifie For COG OPERATING LI Committed to AFMSS for processing by PRI	LC. sen	t to the Carlsbad		
Name (Printed/Typed)		Title	AGENT		
Signature	(Electronic Submission)	Date	05/04/2018	*	
THIS SPACE FOR FEDERAL OR STATE OFFICE USE					
Approved By	emes a. Comes	Title	Supr. PET	5-9-18 Date	
certify that the applicant hol	ny, are attached. Approval of this notice does not warrant or ds legal or equitable title to those rights in the subject lease licant to conduct operations thereon.	Office	Carlsbad		
Title 19 IV Continue 1001 and Title 42 IV S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United					

States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

Well: Cheyenne Federal #1

API#: 30-015-30709

Formation: Yeso

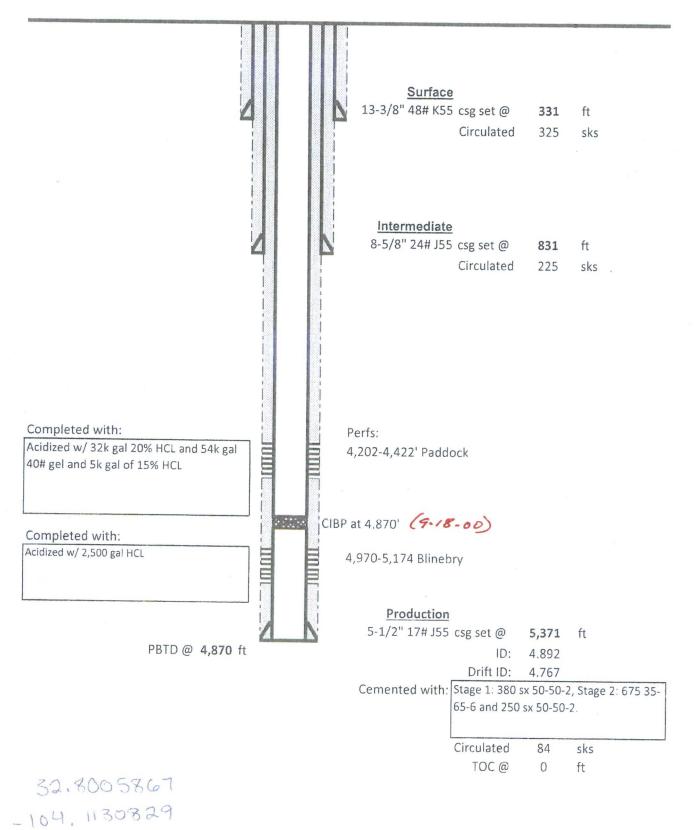

Well: Cheyenne Federal #1 API#: 30-015-30709

Formation: Yeso 17/2" hole 13-3/8" 48# K55 csg set @ 331 325 sks Circulated B/salf 770 121/4" hole 5. Spot 55 sx cmt @ 500'-Surface. (T/Salt & 13 3/8" Shoe Intermediate 8-5/8" 24# J55 csg set @ Circulated 225 sks / 4. Spot 30 sx cmt @ 881-600'. WOC & Tag (8 5/8" Shoe & B/Salt) 77/8" hole 3. Spot 25 sx cmt @ <del>1815-1615'</del> (Queen) | 76| 2572 - 2372 (SA) 2. Set 5 1/2" CIBP @ 4155'. Circ hole w/ MLF. Pressure Completed with: test csg. Spot 25 sx cmt @ 4155-3955'. Acidized w/ 32k gal 20% HCL and 54k gal Perfs: 40# gel and 5k gal of 15% HCL 4,202-4,422' Paddock -1. Tag 5 1/2" CIBP @4870'. |CIBP at 4,870' Completed with: Acidized w/ 2,500 gal HCL 4,970-5,174 Blinebry Production 5-1/2" 17# J55 csg set @ 5,371 ft PBTD @ 4,870 ft 4.892 ID: 4.767 Drift ID: Cemented with: Stage 1: 380 sx 50-50-2, Stage 2: 675 35-65-6 and 250 sx 50-50-2. Circulated sks TOC @ 0 ft



## BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

## Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90<sup>th</sup> day provide this office, prior to the 90<sup>th</sup> day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

- 2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.
- 3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of brine water. Minimum nine (9) pounds per gallon.
- 5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. Dry Hole Marker: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10<sup>th</sup> day, the BLM is to be contacted with justification to receive an extension for completing the cut off.

The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement, unless otherwise noted in COA (requirements will be attached). The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds).

- 7. <u>Subsequent Plugging Reporting</u>: Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date well was plugged.**
- 8. <u>Trash</u>: All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.