Submit 1 Copy To Appropriate District	State of New Me	xico	Form C-103			
Office • <u>District 1</u> – (575) 393-6161	Energy, Minerals and Natural Resources		Revised July 18, 2013			
1625 N. French Dr., Hobbs, NM 88240 <u>District II</u> - (575) 748-1283	OIL CONSERVATION DIVISION		WELL API NO. 30-015-21260			
811 S. First St., Artesia, NM 88210 <u>District III</u> – (505) 334-6178	OIL CONSERVATION DIVISION 1220 South St. Francis Dr.		5. Indicate Type of Lease			
1000 Rio Brazos Rd., Aztec, NM 87410 District IV – (505) 476-3460	Santa Fe, NM 87		6. State Oil & Gas Lease No.			
1220 S. St. Francis Dr., Santa Fe, NM 87505			B-2071			
SUNDRY NOT	ICES AND REPORTS ON WELLS		7. Lease Name or Unit Agreement Name			
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH			NG Phillips State 8. Well Number #11			
PROPOSALS.) 1. Type of Well: Oil Well 🖾 Gas Well 🗌 Other			8. well Number #11			
2. Name of Operator	9. OGRID Number					
COG Operating, LLC 3. Address of Operator			229137 10. Pool name or Wildcat			
600 W. Illinois Ave, Midland, TX 79701			E. Empire Yates S R			
4. Well Location						
Unit Letter <u>E</u> :		_line and330				
Section 27	Township 17S Rang 11. Elevation (Show whether DR,		MPM County Eddy			
3672' GR						
12 Charle	Ammenuiste Desete I. d'acte M					
	Appropriate Box to Indicate Na	ature of Notice, I	Report or Other Data			
	SEQUENT REPORT OF:					
PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK PERFORM PERFORM REMEDIAL WORK PERFORM REMEDIAL WORK PER			LING OPNS. P AND A			
PULL OR ALTER CASING		CASING/CEMENT	—			
OTHER:		OTHER:				
13. Describe proposed or com	pleted operations. (Clearly state all p ork) SEE BLUE 19 15 7 14 NMAC	ertinent details, and	give pertinent dates, including estimated date pletions: Attach wellbore diagram of			
proposed completion or re	completion.		ipietions: Attach wellbore diagram of			
1. Set 4 ½" CIBP @ 710'. C	irculate hole w/ MLF. Pressure tes	t asa Snot 75 sy an	at @ 710 4102 WOC & Tag			
2. Perf & Sqz 30 sx cmt @	113'-Surface.		n @ 710-410 [°] . WOC & Tag.			
3. Cut off well head, verify	cmt to surface, weld on Dry Hole M	larker.				
	Notify OC	D 24 hrs. pric	RECEIVED			
	-	work done.	4			
	<i>~</i> •1y	WOIN QUIE.	SEP 0 4 2018			
			DISTRICT II-ARTESIA O.C.D.			
······································		· · · · · · · · · · · · · · · · · · ·				
Spud Date:	Rig Release Dat	te:				
KG AHII	$\Delta \Delta \Lambda'$	1 41 0				
I hereby certify that the information	above is true and complete to the be	st of my knowledge	and belief $57 7 - 4 - 19$			
SIGNATURE Lingil M	Et compare TITLE An.	st	DATE_8/30/18			
Transition And State	A 1 abbu	mabamanda	ssociates.com			
Type or print name Abig ail Montyonery E-mail address: PHONE: <u>432-580-7161</u>						
	no (t	Aria	- 11 - 7			
APPROVED BY: Conditions of Approval (if any):	TITLE STA	H Mg-	DATE_9-4-18			

Note: Ran 7" casing to 492', could not get water shut off with cement. Drilled to 813' and kicked pulled 7" leaving two joints in the hole appx. 63'

			Wel	I ID Info:
			API No:	30-015-21260
			Spud Date:	
	Csg:	<u>-</u>		
	Set @	<u> </u>		
	Cement w/	-		
	circ.	-		
	Tubing Detail	Rod Detail		
	2-3/8" Tubing	2', 6' X 3/4" SUBS		
		30-3/4" 750' USED		
	C	2" X 1 1/2" X 8' RWTC M	TI-MTI	
	Yates 7 Rivers:			
111 E	756'-776'	19 holes		
E	Water Gel Frac			
	200,000 # sand			
	200,000 # Sand			
	•			
				1
	Csg:	4-1/2" 10.5#		
	Depth:	809'		
	Cement w/	250 sx		
	circ.	Cemented to surface		

PBTD 798' TD 813'


32.8064117 -104.1713791 ٩

NG Phillips St #11

Note: Ran 7" casing to 492', could not get water shut off with cement. Drilled to 813' and kicked pulled 7" leaving two joints in the hole appx. 63'

PBTD 798'

TD 813'

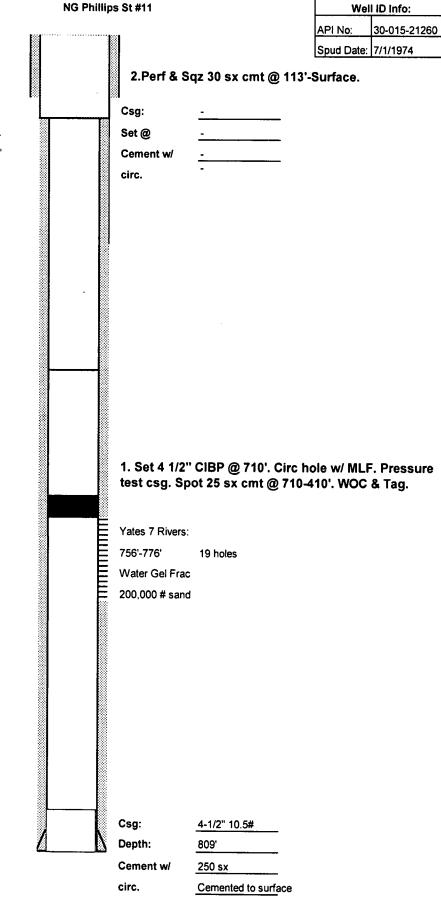

CONDITIONS FOR PLUGGING AND ABANDONMENT

District II / Artesia N.M.

The following is a guide or checklist in preparation of a plugging program, this is not all inclusive and care must be exercised in establishing special plugging programs in unique and unusual cases, Notify NMOCD District Office II at (575)-748-1283 at least 24 hours before beginning work.

- 1. A notice of intent to plug and abandon a wellbore is required to be approved before plugging operations are conducted. A cement evaluation tool is required in order to ensure isolation of producing formations, protection of water and correlative rights. A cement bond log or other accepted cement evaluation tool is to be provided to the division for evaluation if one has not been previously run or if the well did not have cement circulated to surface during the original casing cementing job or subsequent cementing jobs.
- 2. Closed loop system is to be used for entire plugging operation. Upon completion, contents of steel pits are to be hauled to a permitted disposal location.
- 3. Trucking companies being used to haul oilfield waste fluids to a disposal commercial or private shall have an approved NMOCD C-133 permit. A copy of this permit shall be available in each truck used to haul waste products. It is the responsibility of the operator as well as the contractor, to verify that this permit is in place prior to performing work. Drivers shall be able to produce a copy upon request of an NMOCD Field inspector.
- 4. Filing a subsequent C-103 will serve as notification that the well has been plugged.
- 5. A final C-103 shall be filed (and a site inspection by NMOCD Inspector to determine if the location is satisfactorily cleaned, all equipment, electric poles and trash has been removed to Meet NMOCD standards) before bonding can be released.
- 6. If the well is not plugged within 1
- 7. If work has not begun within 1 Year of the approval of this procedure, an extension request must be file stating the reason the well has not been plugged.
- 8. Squeeze pressures are not to exceed 500 psi, unless approval is given by NMOCD.
- 9. Produced water will not be used during any part of the plugging operation.
- 10. Mud laden fluids must be placed between all cement plugs mixed at 25 sacks per 100 bbls of water.
- 11. All cement plugs will be a minimum of 100' in length or a minimum of 25 sacks of cement, whichever is greater. 50' of calculated cement excess required for inside casing plugs and 100% calculated cement excess required on outside casing plugs.
- 12. Class 'C' cement will be used above 7500 feet.
- 13. Class 'H' cement will be used below 7500 feet.
- 14. A cement plug is required to be set 50' above and 50' below, casing stubs, DV tools, attempted casing cut offs, cement tops outside casing, salt sections and anywhere the casing is perforated, these plugs require a 4 hour WOC and then will be tagged
- 15. All Casing Shoes Will Be Perforated 50' below shoe depth and Attempted to be Squeezed, cement needs to be 50' above and 50' Below Casing Shoe inside the Production Casing

- 16. When setting the top out cement plug in production, intermediate and surface casing, wellbores should remain full at least 30 minutes after plugs are set
- 17. A CIBP is to be set within 100' of production perforations, capped with 100' of cement, WOC 4 hours and tag.
- 18. A CIBP with 35' of cement may be used in lieu of the 100' plug if set with a bailer. This plug will be placed within 100' of the top perforation, (WOC 4 hrs and tag).
- 19. No more than **3000' is allowed between cement plugs in cased hole and 2000' in open** hole.
- 20. Some of the Formations to be isolated with cement plugs are: These plugs to be set to isolate formation tops
 - A) Fusselman
 - B) Devonian
 - C) Morrow
 - D) Wolfcamp
 - E) Bone Springs
 - F) Delaware
 - G) Any salt sections
 - H) Abo
 - I) Glorieta
 - J) Yates.
 - K) Potash--- (In the R-111-P Area (Potash Mine Area), a solid cement plug must be set across the salt section. Fluid used to mix the cement shall be saturated with the salts that are common to the section penetrated and in suitable proportions, not more than 3% calcium chloride (by weight of cement) will be considered the desired mixture whenever possible, WOC 4 hours and tag, this plug will be 50' below the bottom and 50' above the top of the Formation.
- 21. If cement does not exist behind casing strings at recommended formation depths, the casing can be cut and pulled with plugs set at recommended depths. If casing is not pulled, perforations will be shot and cement squeezed behind casing, WOC and tagged. These plugs will be set 50' below formation bottom to 50' above formation top inside the casing

DRY HOLE MARKER REQUIRMENTS

The operator shall mark the exact location of the plugged and abandoned well with a steel marker not less than four inches in diameter, 3' below ground level with a plate of at least ¼" welded to the top of the casing and the dry hole marker welded on the plate with the following information welded on the dry hole marker:

1. Operator name2. Lease and Well Number3. API Number4. Unit Letter5. QuarterSection (feet from the North, South, East or West)6. Section, Township and Range7. Plugging Date8. County(SPECIAL CASES)------AGRICULTURE OR PRARIE CHICKEN BREEDING AREAS

In these areas, a below ground marker is required with all pertinent information mentioned above on a plate, set 3' below ground level, a picture of the plate will be supplied to NMOCD for record, the exact location of the marker (longitude and latitude by GPS) will be provided to NMOCD (We typically require a current survey to verify the GPS)